General Information or Other (PAR) Event# 43982 Notification Date / Time: 02/13/2008 15:26 Rep Org: AREVA NP, INC. (EST) Supplier: AREVA NP, INC. Event Date / Time: 12/27/2007 (EST) Last Modification: 02/13/2008 Docket #: Region: 1 City: LYNCHBURG Agreement State: No County: License #: State: VA NRC Notified by: GAYLE ELLIOTT Notifications: GLENN DENTEL R1 R2 **HQ Ops Officer: STEVE SANDIN** EUGENE GUTHRIE PART 21 COORD NRR **Emergency Class: NON EMERGENCY** 10 CFR Section: **UNSPECIFIED PARAGRAPH** 21.21

PART 21 INVOLVING POTENTIALLY DAMAGED FUEL ASSEMBLY SPACER SIDE PLATES

The following information was received via facsimile:

"Reportable Defect

- "(i) Name and address tithe individual informing the Commission: Gayle Elliott, 3315 Old Forest Road, Lynchburg, VA 24501
- "(ii) Identification of the facility, the activity, or the basic component supplied for such facility or such activity within the United States which fails to comply or contains a defect: Susquehanna Steam Electric Station, Units 1 and 2, potentially may contain ATRIUM- fuel assemblies with damaged spacer side plates.
- "(iii) Identification of the firm constructing the facility or supplying the basic component which falls to comply or contains a defect: AREVA NP Inc. (AREVA NP) supplied the ATRIUM-10 fuel assemblies to the Susquehanna units. The spacer side plates were damaged during recent re-channeling campaigns at the reactor site.
- "(iv) Nature of the defect or failure to comply and the safety hazard which is created or could be created by such a defect or failure to comply. The damaged (missing) spacer side plates could impact the critical power performance of the fuel assemblies and the local power peaking distribution within the fuel assembly.
- "(v) The date on which the information of such a defect or failure to comply was obtained: This issue was determined to be a deviation on December 27, 2007.
- "(vi) In the case of a basic component which fails to comply, the number and the location of all such components in

IE19

NICR

General Information or Other (PAR)

Event # 43982

use at, supplied for, or being supplied for one or more facilities or activities subject to the regulations in this part: The known defect has occurred at Susquehanna Unit 1. Based on the number of spacer pieces found, four (4) fuel assemblies could be damaged.

"(vii) The corrective action which has been, is being, or will be taken; the name of the individual or organization responsible for this action; and the length of time that has been or will be taken to complete the action: AREVA NP recommended and PPL Implemented Operating Limit penalties for the potentially damaged fuel assemblies to protect the MCPR Safety Limit and LHGR SAFDL.

"(viii) Any advice related to the defect or failure to comply about the facility, activity, or basic component that has been, is being, or will be given to purchasers or licensees: See (vii) above."



3315 Old Forest Road P. O. Box 10935 Lynchburg, VA 24506-0935

Project Management Department FAX COVER SHEET

			DATE:	8
ATTENTION:	NRC'S OF	ERATION CENTE	2	
COMPANY NAM	IE:		4	
CITY, STATE:		FAX NU	JMBER: (301)816-51	5/
FROM:	AYLE ELLIS	77		
DEPARTMENT:	Co <i>rporate</i> <u>Regulatory</u> Affairs	(434) 832- <u>884</u>	Z COST CENTER:	
		ŅŲ	IMBER OF PAGES TO FOLLOW:	2
dissemination,	distribution, or copy ition in error, please	ying of this communication	ciplent, you are hereby notif is strictly prohibited. If you h lephone and return the origina	ave received
COMMENTA:				
			· · · · · · · · · · · · · · · · · · ·	
		· · · · · · · · · · · · · · · · · · ·		
FAX NUMBER (434) 832-4121	,	VERIFICATION NUMBERS (434) 832-4124
OR FAND USE C	NLY:	· , · · · · · · · · · · · · · · · · · ·		
RETURN E		DISCARD	HOLD FOR I	PICKUP
REVA NP Inc., an	AREVA and Siemens C	omnany		•

Reportable Defect

- (i) Name and address of the individual informing the Commission
 - Gayle Elliott, 3315 Old Forest Road, Lynchburg, VA 24501
- (ii) Identification of the facility, the activity, or the basic component supplied for such facility or such activity within the United States which fails to comply or contains a defect.
 - Susquehanna Steam Electric Station, Units 1 and 2, potentially may contain ATRIUM-10 fuel assemblies with damaged spacer side plates.
- (iii) Identification of the firm constructing the facility or supplying the basic component which fails to comply or contains a defect.
 - AREVA NP Inc. (AREVA NP) supplied the ATRIUM-10 fuel assemblies to the Susquehanna units. The spacer side plates were damaged during recent rechanneling campaigns at the reactor site.
- (iv) Nature of the defect or failure to comply and the safety hazard which is created or could be created by such a defect or failure to comply.
 - The damaged (missing) spacer side plates could impact the critical power performance of the fuel assemblies and the local power peaking distribution within the fuel assembly.
- (v) The date on which the information of such a defect or fallure to comply was obtained.
 - This issue was determined to be a deviation on December 27, 2007.
- (vi) In the case of a basic component which falls to comply, the number and the location of all such components in use at, supplied for, or being supplied for one or more facilities or activities subject to the regulations in this part.
 - The known defect has occurred at Susquehanna Unit 1. Based on the number of spacer pieces found, four (4) fuel assemblies could be damaged.

- (vii) The corrective action which has been, is being, or will be taken; the name of the individual or organization responsible for this action; and the length of time that has been or will be taken to complete the action.
 - AREVA NP recommended and PPL implemented Operating Limit penalties for the potentially damaged fuel assemblies to protect the MCPR Safety Lmit and LHGR SAFDL.
- (viii) Any advice related to the defect or failure to comply about the facility, activity, or basic component that has been, is being, or will be given to purchasers or licensees.

See (vii) above.