www.exeloncorp.com



March 22, 2001

10 CFR 50.73

Exelon

Nuclear

United States Nuclear Regulatory Commission Attention: Document Control Desk Washington, D.C. 20555

> LaSalle County Station, Units 1 and 2 Facility Operating License Nos. NPF-11 and NPF-18 NRC Docket Nos. 50-373 and 50-374

Subject: Licensee Event Report

In accordance with 10 CFR 50.73(a)(2)(iv)(A), Exelon Generation Company, (EGC), LLC, is submitting Licensee Event Report Number 01-001-00, Docket No. 050-373.

Should you have any questions concerning this letter, please contact Mr. William Riffer, Regulatory Assurance Manager, at (815) 357-6761, extension 2383.

Respectfully,

harles G. Pardee

Site Vice President

Attachment: Licensee Event Report

cc: Regional Administrator - NRC Region III NRC Senior Resident Inspector - LaSalle County Station

TEZZ

NRC FOR	RM 366			11.9	S. NUCLEA	ARRECH	ATOPY		DOVED D	VOMP NO 2150 0104		TYDIDI	0 6 20 2004		
(1-2001)					COM	AISSION	I Fetin	EXPIRES 6-30-200 Estimated hurden per response to comply with this mondotory							
							information collection request: 50 bro. P.				with this mandatory				
7	~ (* *							incorporated into the licensing process and fed l				o indust	neu are		
í í								comr	comments regarding burden estimate to the Records Management Dranch						
						(T-6	(T-6 E6), U. S. Nuclear Regulatory Commission Washington DC								
	L	ICENS	SEE EV	/ENT REPO	RT (LI	ER)		2055	20555-0001, and by internet e-mail to bis1@nrc gov and to the Desk						
(See reverse for required number of						Offic	Officer, Office of Information and Regulatory Affairs NOFR-10202								
		di	gits/chara	cters for each b	lock)			(3150	(3150-0104), Office of Management and Budget, Washington DC						
			-					20503. If a means used to impose information collection does not display							
								a currently valid OMB control number, the NRC may not conduct or							
								spons	sponsor, and a person is not required to respond to, the information						
FACILIT	VNAM	F (1).	7 - 0 - 1 1					collection.							
		LD (1).	LaSall	e County S	tation,	ion, Unit 1			KET NUM	1BER (2)		PAG	E (3)		
TITLE (4)	D		0	1	· · ·					5000373		1 0	f 4		
		actor	Scram	aue to Ele	ectrica	1 Faul	t on	Trans	former	Yard 345 KV Lin	ne C Pł	nase			
		isulato	or												
EVEN	T DAT	<u>E (5)</u>		LER NUMBER (6)	REPORT DATE				OTHER FACILITIES	S INVOLV	VOLVED (8)			
мо	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REV	МО	DAY	YEAR	FACILITY NAME						
				TOMOER	NO				LaSal	le County	DC	DCKETN	IUMBER		
							1		Stati	on, Unit ²		0500	0374		
01	31	01	01	- 001 -	00	03	22	01	FACILIT	TY NAME	DC	CKET N	UMBER		
OPEN (TT	100	<u> </u>													
MODE (NG 9)	1	THIS R	EPORT IS SUB	MITTED	PURSUA	NT TO	THE RE	QUIREN	MENTS OF 10 CFR §: (Check all	that app	ly) (11)		
POWER	2	100								Ŭ (<i>y</i> / (/		
LEVEL	<u>(u)</u>		20.2	201(b)		20 22027									
		1.00	20.2	201(0)	_ 님	20.2203(8	1)(3)(11)			50.73(a)(2)(ii)(B)		50.73(a	ı)(2)(ix)(A)		
			20.2	201(d)		20.2203(a	a)(4)			50.73(a)(2)(iii)		50.73(a	1)(2)(x)		
	20		20.2	203(a)(1)		50.36(c)(1)(i)(A)		\square	50.73(a)(2)(iv)(A)		73.71(a	ı)(4)		
	20		20.2203(a)(2)(i)			50.36(c)(50.73(a)(2)(v)(A)			73.71(a)(5)			
	apl 1	ng line	20.2203(a)(2)(ii)			50.36(c)(2)				50.73(a)(2)(v)(B)		OTHER			
		14. T	20.2203(a)(2)(iii)			50.46(a)(3)(ii)			50.73(a)(2)(v)(C)			Specify in Abstract below or in			
	1.		- 20.2	203(2)(2)(iv)		50 72620					NRC	From 366.	A		
49				203(a)(2)(1)		50.73(a)(2	2)(I)(A)			50.73(a)(2)(v)(D)		- Alter			
				203(a)(2)(v)		50.73(a)(2	2)(i)(B)			50.73(a)(2)(vii)	10				
	-		20.2	203(a)(2)(vi)		50.73(a)(2	2)(i)(C)			50.73(a)(2)(viii)(A)					
104 104			20.2	203(a)(3)(i)		50.73(a)(2	2)(ii)(A)			50.73(a)(2)(viii)(B)					
					LICENS	EE CONTA	ACT FO	R THIS I	ER (12)						
NAME								<u>т</u> т	TELEPHONE NUMBER (Include Area Code)						
<u>k</u>	Kent	Nelson	n, Syst	tem Enginee	ering		-			(815) 357-6761 1	Extens	ion 2	079		
CAUSE	T sv	STEM	COMPONEN	ETE ONE LINE F	OR EACH	COMPON	IENT FA	ILURE	DESCRIB	ED IN THIS REPORT (13)					
CITCOE	51	STEM	COMPONE	FACTURER	REP T	ORTABLE O EPIX			CAUSE	SYSTEM COMPONENT	MANU-	ED F	EPORTABLE		
							19	ŀ			FACTURE		TOEPIX		
										╎───┤────┤─	······	— -			
SUPPLEMENTAL REPORT EXP					T EXPECT	ED (14)				EXPECTED	MONTH		VEAD		
YES					NO				SUBMISSION						
(If yes, complete EXPECTED SUBMISSION DATE)									DATE (15)						
	1 "F / I	innit to 1	400		1 1 01	~ .				· · · · · · · · · · · · · · · · · · ·		1			

ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single-space typewritten lines)(16)

On January 31, 2001, at 2147 hours, current from the "C" phase of the 345 KV power line between the Unit 1 main power transformer and the switchyard flashed to ground across a support insulator. The phase-to-ground fault activated the transformer protective relays, resulting in a turbine generator trip and reactor scram.

The cause of the phase-to-ground fault was determined to be an excess of bird excrement that had built up on the support insulator. Corrective actions included replacement of the damaged insulator, and inspection and cleaning of the other insulators. An evaluation to determine how to prevent birds from roosting on the equipment was begun.

The safety consequences of this event were minimal. All safety systems operated as expected. A turbine generator trip is an analyzed condition of moderate frequency. The reactor was safely shut down and recovery performed without incident.

NRC FORM 366A U.S. NUCLEAR REGULATORY COMMISSION (1-2001)LICENSEE EVENT REPORT (LER) فيج 2-**FACILITY NAME (1) DOCKET NUMBER (2)** LER NUMBER (6) PAGE (3) YFAF SEQUENTIAL REVISION NUMBER NUMBER LaSalle County Station, Unit 1 05000373 01 001 00 2 of 4

NARRATIVE (If more space is required, use additional copies of NRC Form 366A) (17)

PLANT AND SYSTEM IDENTIFICATIONQ

General Electric - Boiling Water Reactor, 3489 Megawatts Thermal Rated Core Power

A. CONDITION PRIOR TO EVENT

Unit(s): 1/2Event Date: 01/31/01Event Time: 2147 HoursReactor Mode(s): 1/1Power Level(s): 100/100Mode(s) Name: Run/Run

B. DESCRIPTION OF EVENT

At 2147 hours on January 31, 2001, LaSalle County Station, Unit 1, experienced a turbine generator trip and subsequent reactor scram. Initial indications were of an electrical fault at or near the Unit 1 main power transformer (MPT)[EL]. Witnesses heard a loud boom, and an associated bright flash was seen several miles away. The operators responded to the scram in accordance with management expectations, and the plant responded as expected, with the following exceptions:

- The 1A Circulating Water pump tripped during the power supply fast transfer. The slip guard relay was found tripped. The relay was reset and the pump was restarted without additional corrective action.
- The Division 1 Alternate Rod Insertion failed to reset on scram recovery. A work request was written, and Electrical Maintenance reset the power converters and the system reset successfully.
- A low oil level alarm was received on the 1B Reactor Recirculation pump when the attempt was made to restart it. A containment entry was made to inspect the pump motor, and the oil reservoir level was found about five pints low. There was no sign of a large leak. The reservoir was refilled and the pump started.
- There was an electrical perturbation on Unit 2 that resulted in a loss of the 2A heater drain pump and the 24B and 25B feedwater heaters. Power was stablized at 930 MWe. The heaters were restored and Unit 2 was returned to full power at 0625 hours on February 1, 2001.

The cause of the main generator trip was determined to be a phase-to-ground fault on the "C" phase of the transmission line between the MPT and the switchyard. The fault activated the differential relay scheme for the MPT, which led to the unit trip and activated the deluge system for the transformers. System digital fault recorders and relaying targets showed that the system responded properly to the fault.

The MPT consists of two Westinghouse 7,000,000 series 625 MVA three phase transformers connected in parallel. Aluminum cable connects the transformers to a common aluminum hard bus, which extends to an A-frame tower, where it is supported by an underslung insulator. Aluminum cable from the 345 KV switchyard is then bolted to the aluminum bus via a pad connection. A strain bell insulator is used to provide lateral support for the cable between the A-frame tower and the next transmission tower.

NRC FORM 366A (1-2001)			U.S. NI	UCLEAR REGU	LATORY COMMISSION				
LICENSEE EVENT REPORT (LER)									
FACILITY NAME (1)	DOCKET NUMBER (2)	· · · · · ·	LER NUMBER (PAGE (3)					
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	· · · · · · · · · · · · · · · · · · ·				
LaSalle County Station, Unit 1	05000373	01	- 001 -	00	3 of 4				

NARRATIVE (If more space is required, use additional copies of NRC Form 366A) (17)

A track of bird excrement approximately one half inch wide was found on the top of the "C" phase underslung support insulator. Arcing was evident across the underslung insulator, as was flashover across the strain-bell insulator. The flash ended at the corona ring at the end of the strain-bell insulator, which was heavily damaged. The transmission line was also damaged. An inspection of the surrounding area found no other secondary damage from the event.

This event is reportable pursuant to 10 CFR 50.73(a)(2)(iv) as an event that resulted in an automatic actuation of the reactor protection system.

C. CAUSE OF EVENT

The root cause of the event was a build up of bird excrement, which resulted in tracking across the underslung support insulator. The most probable initiator of the tracking was the weather conditions just prior to the event. The air temperature had increased and a light, misty rain was falling, which is postulated to have washed the excrement down the side of the underslung insulator.

D. SAFETY ANALYSIS

The safety consequences of this event were minimal. No equipment failed to operate during this event. The potential for a turbine generator trip is an analyzed condition of moderate frequency (Updated Final Safety Analysis Report, Section 15.2.3, "Turbine Trip".) The reactor was safely shut down and recovery performed without incident.

E. CORRECTIVE ACTIONS

Corrective Actions:

- 1) The damaged insulators and transmission line were repaired.
- 2) The other Unit 1 insulators and the MPT were inspected and cleaned.

Corrective Action to Prevent Recurrence:

- 3) Substation Engineering will investigate and design appropriate measures to prevent birds from roosting on "A" frame structures.
- 4) LaSalle Station, with the assistance of Transmission and Distribution Engineering, will determine long term plans to address the bird issue.

F. PREVIOUS OCCURRENCES

LER NUMBER TITLE

LER 373/90-006 Reactor Scram Caused By Generator Trip Due To B Phase Insulator Failure And Subsequent Flashover To Ground

On March 28, 1990, the "B" phase support insulator on the same Unit 1 tower failed. This was a catastrophic failure, typical of internal breakdown as approved to the surface damage caused by the tracking and phase-to-ground arcing in this most recent event. There is no indication that this most recent trip was caused by a failure of the insulator.

NRC FORM 366A (1-2001)		······································	U.S. NUCI	EAR REGU	LATORY COMMISSION				
LICENSEE EVENT REPORT (LER)									
FACILITY NAME (1)	DOCKET NUMBER (2)		LER NUMBER (6)	PAGE (3)					
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER					
LaSalle County Station, Unit 1	05000373	01	- 001 -	00	4 of 4				

NARRATIVE (If more space is required, use additional copies of NRC Form 366A) (17)

G. COMPONENT FAILURE DATA

Since no component failure occurred, this section is not applicable.