## ML020630189.txt

REGION III MORNING REPORT 1993

PAGE 2

FEBRUARY 24,

Licensee/Facility:

Notification:

Commonwealth Edison Co. Braidwood 1 2

Date: 02/24/93

MR Number: 3-93-0054

Braceville, Illinois

VIA RI

Dockets: 50-456,50-457

PWR/W-4-LP, PWR/W-4-LP

Commonwealth Edison Co.

Byron 1 2

Byron, Illinois

Dockets: 50-454,50-455 PWR/W-4-LP, PWR/W-4-LP

Subject: ENTRY INTO LCO 3.0.3

Reportable Event Number: N/A

## Discussion:

On February 23, 1993, at 3:43 p.m. (CST), the licensee entered Technic

Specification 3.0.3 for both units after it was determined the Phase "

Containment Isolation Automatic Actuation Logic and Actuation Relays h ad

not been tested in accordance with applicable surveillance requirement

At the time, it was discovered that the test lead for Phase "B" Isolat

was landed on the Containment Spray Actuation terminal. Therefore, whe

the monthly SSPS Actuation Logic Surveillance was conducted, the Phase

"B" Containment Isolation Logic was not tested. However, logic system

functional test performed each refueling outage demonstrated operabili

of the Phase "B" Actuation Logic. The leads (four total) were lifted a

relanded to their proper terminal position. The required surveillances

## ML020630189.txt

were performed satisfactorily and the LCO was exited at 9:53 p.m. (CST).

This also affected the Byron Station and may have generic implications at other Westinghouse facilities.

## Regional Action:

The resident inspectors are following up on the licensees reasoning for not reporting this event and generic reporting requirements.

Contact: R. B. LANDSMAN (708) 790-5587