ML020640092.txt

REGION III MORNING REPORT 1993

PAGE 2

OCTOBER 19,

Licensee/Facility:

Notification:

Cleveland Electric Illuminating Co.

Perry 1 Perry, Ohio MR Number: 3-93-0316

Date: 10/19/93 SRI VIA PC

Dockets: 50-440

BWR/GE-6

Subject: AGASTAT RELAY FAILURES

Reportable Event Number: N/A

Discussion:

st

In response to an Agastat relay failure in January, 1993, the licensee removed four normally energized Agastat relays for functional testing and inspection during the present maintenance outage. All four relays pass ed the functional test. However, the licensee noted heat related degradat ion of two of the relays during a visual inspection (the other two had not yet been inspected). As a result, the licensee decided to remove an additional sample of 58 relays for testing and inspection. Sixteen relays have been removed and tested to date with three confirmed functional failures. The failures consisted of relays that either functioned slow ly or failed to operate. All of the failed relays had been in service for less than General Electric's calculated 4.5 year service life for normally energized Agastat relays. The licensee is evaluating the failures, as they are found, for operability impact. The licensee testing and investigation efforts are continuing. The licensee now plans to te

ML020640092.txt

and replace more than 260 additional normally energized relays during this outage.

Regional Action:

The resident and regional inspection staff are monitoring licensee testing activities.

Contact: R. Lanksbury (708) 790-5578