

PRIORITY ATTENTION REQUIRED MORNING REPORT - REGION IV SEPTEMBER 20, 1994

Licensee/Facility:

Southern California Edison & San
Diego Gas & Electric Co.
San Onofre 3

Notification:

MR Number: 4-94-0102
Date: 09/19/94
SRI

San Clemente, California
Dockets: 50-362
PWR/CE

Subject: AFW TURBINE TRIP THROTTLE VALVE DEFECT

Reportable Event Number: N/A

Discussion:

Morning Report (MR) 3-94-0146, "Part 21 Notification - Davis-Besse AFW Turbine Trip Throttle Valve," dated August 11, 1994, identified a defect associated with auxiliary feedwater (AFW) turbine trip throttle valves (TTVs). The absence of a detent in the TTV stem at Davis Besse allowed the setscrew to slip from its installed position, which prevented the TTV from opening fully during surveillance testing. The resident inspector at San Onofre provided the information from this MR to the licensee.

On September 14, 1994, the licensee at San Onofre inspected the Unit 3 AFW turbine TTV and discovered that the TTV stem did not have an indentation in the stem to accept the setscrew used to anchor the valve stem coupling to the TTV stem. During this inspection, the inspector observed that the setscrew had engaged the TTV stem threads and had

crushed some of the threads. The coupling was in the proper position on the stem. The licensee indented the stem and reinstalled the setscrew. The licensee plans to perform an inspection of the Unit 2 TTV the week of September 19, 1994.

Regional Action:

The resident inspectors had monitored the licensee's inspection of the Unit 3 TTV and will monitor the licensee's inspection of the Unit 2 TTV.

Contact:	D. Solorio	(714) 492-2641
	J. Sloan	(714) 492-2641