

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF NUCLEAR REACTOR REGULATION
WASHINGTON, D.C. 20555

September 11, 2002

NRC INFORMATION NOTICE 2002-26: FAILURE OF STEAM DRYER COVER PLATE
AFTER A RECENT POWER UPRATE

Addressees

All holders of operating license or construction permits for nuclear power reactors, except those that have permanently ceased operations and have certified that fuel has been permanently removed from the reactor.

Purpose

The U.S. Nuclear Regulatory Commission (NRC) is issuing this information notice to alert addressees to a recent failure of a steam dryer cover plate during operations following a power uprate at a boiling water reactor (BWR). It is expected that the recipients will review the information for applicability to their facilities and consider actions, as appropriate, to avoid similar problems. However, suggestions contained in this information notice are not NRC requirements; therefore, no specific action or written response is required.

Description of Circumstances

In March 2002, Quad Cities Unit 2, a BWR, completed a refueling outage. The outage included a modification to add baffle plates to the steam dryer to reduce the excessive moisture carryover expected as a result of an extended power uprate from 2511 MWt to 2957 MWt (17.8% increase). On June 7, 2002, the unit began experiencing fluctuations in steam flow, reactor pressure and level, and moisture carryover in the main steam lines. After more fluctuations in June and July, the licensee conducted an engineering evaluation of one of the fluctuations, and concluded that the steam flow irregularities could be caused by loose parts in the steam line, and that the loose parts could impair the proper functioning of safety systems.

Initially, the licensee believed that the newly installed baffle plates were the source of the loose parts. However, after shutting down the unit and removing the reactor pressure vessel head, the licensee discovered that a dryer cover plate on the outside of the steam dryer had broken loose. The cover plate separates the steam exit region from the steam dryer and separator space below. One piece of the dryer cover plate had fallen onto the separator, causing no apparent damage. Another piece was found in the dryer, and a third piece had lodged in the A main steam line flow venturi (upstream of the main steam isolation valves). Subsequent inspections by the licensee discovered that several other pieces had been swept down the A main steam line downstream of the main steam isolation valves into a turbine stop valve strainer. Other than minor scratches and gouges to the main steam nozzle and piping, there was no damage.

ML022530291

The licensee stated that the preliminary results of scale model testing by General Electric indicated that the failure of the plate was due to high cycle fatigue. This fatigue was attributed to excessive vibration caused by the synchronization of the cover plate resonance frequency, the nozzle chamber standing acoustic wave frequency, and the vortex shedding frequency. The first two frequencies depend on the construction and geometry of the dryer. The vortex shedding frequency depends on the geometry and construction of the dryer and the flow rate of the steam passing through the dryer area. The licensee concluded that the three frequencies synchronized in a very narrow band of steam flow at or near the steam flow required to reach full power under the power uprate.

Discussion

General Electric and the licensee did not foresee this phenomenon. Because of design and manufacturing differences, General Electric believes that only a few BWRs are susceptible to this event. Licensees should be aware of similar unanticipated effects from increasing flow, power, or differential pressure associated with a major modification such as an extended power uprate.

This information notice requires no specific action or written response. If you have any questions about the information in this notice, please contact one of the technical contacts listed below or the appropriate Office of Nuclear Reactor Regulation (NRR) project manager.

/RA/

William D. Beckner, Program Director
Operating Reactor Improvements Program
Division of Regulatory Improvement Programs
Office of Nuclear Reactor Regulation

Technical Contacts: Karla Stuedter, Region III
(309) 654-2227
E-mail: kkb@nrc.gov

Robert Caldwell, NRR
(301) 415-1243
E-mail: rkc1@nrc.gov

Carl Lyon, NRR
(301) 415-2296
E-mail: cfl@nrc.gov

Attachment: List of Recently Issued NRC Information Notices

The licensee stated that the preliminary results of scale model testing by General Electric indicated that the failure of the plate was due to high cycle fatigue. This fatigue was attributed to excessive vibration caused by the synchronization of the cover plate resonance frequency, the nozzle chamber standing acoustic wave frequency, and the vortex shedding frequency. The first two frequencies depend on the construction and geometry of the dryer. The vortex shedding frequency depends on the geometry and construction of the dryer and the flow rate of the steam passing through the dryer area. The licensee concluded that the three frequencies synchronized in a very narrow band of steam flow at or near the steam flow required to reach full power under the power uprate.

Discussion

General Electric and the licensee did not foresee this phenomenon. Because of design and manufacturing differences, General Electric believes that only a few BWRs are susceptible to this event. Licensees should be aware of similar unanticipated effects from increasing flow, power, or differential pressure associated with a major modification such as an extended power uprate.

This information notice requires no specific action or written response. If you have any questions about the information in this notice, please contact one of the technical contacts listed below or the appropriate Office of Nuclear Reactor Regulation (NRR) project manager.

/RA/

William D. Beckner, Program Director
Operating Reactor Improvements Program
Division of Regulatory Improvement Programs
Office of Nuclear Reactor Regulation

Technical Contacts: Karla Stoedter, Region III (309) 654-2227 E-mail: kkb@nrc.gov
Robert Caldwell, NRR (301) 415-1243 E-mail: rkc1@nrc.gov
Carl Lyon, NRR (301) 415-2296 E-mail: cfl@nrc.gov

Attachment: List of Recently Issued NRC Information Notices

DISTRIBUTION:

ADAMS
IN Folder

ADAMS ACCESSION NUMBER: ML022530291

TEMPLATE #NRR-052

DOCUMENT NAME: C:\MYFILES\Copies\IN STM Dryer Rev 4.wpd

OFFICE	RSE:OES:RORP:DRIP	Tech Editor	LPD3:DLPM	SRXB:DSSA	EMCB:DE	LPD3:DLPM
NAME	DRLanyi*	PKleene*	AJMendiola*	RCaruso*	SMCoffin*	CFLyons*
DATE	08/12/2002	07/29/2002	08/13/2002	08/14/2002	08/14/2002	08/13/2002
OFFICE	DE:EMEB	RIII:DRP:RPB1	RIII:DRP:RPB1	SC:OES:RORP:DRIP	PD:RORP:DRIP	
NAME	KAManoly*	MARing*	KKStoedter*	TReis	WDBeckner	
DATE	08/14/2002	08/23/2002	08/22/2002	09/09/2002	09/11/2002	

OFFICIAL RECORD COPY

LIST OF RECENTLY ISSUED
NRC INFORMATION NOTICES

Information Notice No.	Subject	Date of Issuance	Issued to
2002-25	Challenges to Licensees' Ability to Provide Prompt Public Notification and Information During an Emergency Preparedness Event	08/26/2002	All holders of operating licenses for nuclear power reactors, except those who have permanently ceased operations and have certified that fuel has been permanently removed from the reactor vessel.
2002-24	Potential Problems With Heat Collectors on Fire Protection Sprinklers	07/19/2002	All holders of licenses for nuclear power, research, and tests reactors and fuel cycle facilities.
2002-02, Supplement 1	Recent Experience With Plugged Steam Generator Tubes	07/17/2002	All holders of operating licenses for pressurized-water reactors (PWRs), except those who have permanently ceased operations and have certified that fuel has been permanently removed from the reactor.
2002-23	Unauthorized Administration of Byproduct Material for Medical Use	07/16/2002	All Medical Licensees.
2002-22	Degraded Bearing Surfaces in GM/EMD Emergency Diesel Generators	06/28/2002	All holders of operating licenses for pressurized- or boiling-water nuclear power reactors, including those that have ceased operations but have fuel on site.

Note: NRC generic communications may be received in electronic format shortly after they are issued by subscribing to the NRC listserver as follows:

To subscribe send an e-mail to <listproc@nrc.gov>, no subject, and the following command in the message portion:

subscribe gc-nrr firstname lastname