



FLORIDA POWER  
A Progress Energy Company

# CRYSTAL RIVER NUCLEAR PLANT SUPERINTENDENT SHIFT OPERATIONS' LOG



Wednesday, January 9, 2001  
Martin Wolf / Dave Schulker  
0700-1500

PLANT STATUS: Mode 1, 100% Power, 2544 MW<sub>TH</sub>, 887 MW<sub>E</sub>  
Primary: 579 T<sub>Ave</sub>, 1598 ppmb, PZR 220", 75 gpm Letdown,  
Secondary: 78/75% OTSG, 1.2 Hga Vacuum, 52°F UHS  
Rx Bldg.: 113°F Ave., -0.2 psig, AHF-1C: Low, AHF-1B, High & SW Cooled

Int.	Time*	Item	Description
MGW	0831	Relief	Martin Wolf assumes the duties of Superintendent Shift Operations [0638]. Dave Schulker assumes the duties of Control Room Supervisor [0708].
MGW	1150	NCR 53719 Reportable Turtle	Received notification from Mariculture Center Staff (E. Latimer) that the turtle rescued from the intake area was a Kemp's Ridley Sea Turtle [0838]. A 4 Hour Non-Emergency report has been made to the NRC per 10 CFR 50.72 for the offsite notification (NMFS) related to capture of the latest turtle (#64) this biennial period (NRC Event# 38602 Updated) [1107]. Notifications have been made to: NRC ENS (J. MacKinnon), NRC Resident (S. Sanchez), PGM (D. Roderick), MO (M. Annacone), MSO (L. Clewett), and the Regulatory representative (P. Infanger).
MGW	1203	RM-A6	The Reactor Building Air Sample Radiation Monitor was removed from service to support Chemistry sampling activities [1105-1126]. The actions of ITS 3.4.14(b), Condition B, were applicable during this time.
MGW	1200	OI-13	The Fire Service Tanks recirculation utilizing FSP-1 per CP-140 has been restored. Since the crosstie of FST-1A and FST-1B has also been restored, the actions of the FPP, Table 6.1a, are no longer applicable [0846].
MGW	1210	SP-194B	Calibration Of EFIC Channel "B" Instrument Strings has been initiated. The following action statements are applicable during performance of the surveillance: [0905] ITS 3.3.11 Condition A&D, ITS 3.3.12 Condition B, ITS 3.3.13 Condition A, ITS 3.3.14 Condition A. ITS 3.3.17 Condition A and FPP Table 6.9a for the following equipment: SP-26-LI, SP-30-LI, SP-18-LI, SP-22-LI, MS-107-PI, MS-107-PIR, MS-111-PI and MS-111-PIR. Due to the above actions, the "B" EFW Train has been declared Inoperable. However, per the provisions of ITS 3.0.6, ITS 3.7.5 actions have not been entered. A "Loss of Safety Function" determination has been made with none noted.

(Continued on next page)

SSO \_\_\_\_\_

\* Indicates time log entry was initiated

B/20

Page 2