

**Don E. Grissette**  
Vice President

**Southern Nuclear  
Operating Company, Inc.**  
40 Inverness Center Parkway  
Post Office Box 1295  
Birmingham, Alabama 35201  
  
Tel 205.992.6474  
Fax 205.992.0341



December 16, 2005

Docket No.: 50-424

NL-05-2237

U. S. Nuclear Regulatory Commission  
ATTN: Document Control Desk  
Washington, D. C. 20555-0001

Vogtle Electric Generating Plant - Unit 1  
Licensee Event Report 1-2005-004  
Manual Reactor Trip Following Main Feedwater Regulating Valve Failure

Ladies and Gentlemen:

In accordance with the requirements of 10 CFR 50.73, Southern Nuclear Operating Company hereby submits a Vogtle Electric Generating Plant licensee event report for a condition that was determined to be reportable on October 17, 2005.

This letter contains no NRC commitments. If you have any questions, please advise.

Sincerely,

A handwritten signature in black ink, appearing to read "Don E. Grissette", is written over a horizontal line.

Don E. Grissette

DEG/RJF/daj

Enclosure: LER 1-2005-004

cc: Southern Nuclear Operating Company  
Mr. J. T. Gasser, Executive Vice President  
Mr. T. E. Tynan, General Manager – Plant Vogtle  
RType: CVC7000

U. S. Nuclear Regulatory Commission  
Dr. W. D. Travers, Regional Administrator  
Mr. C. Gratton, NRR Project Manager – Vogtle  
Mr. G. J. McCoy, Senior Resident Inspector – Vogtle

**LICENSEE EVENT REPORT (LER)**

(See reverse for required number of digits/characters for each block)

Estimated burden per response to comply with this mandatory collection request: 50 hours. Reported lessons learned are incorporated into the licensing process and fed back to industry. Send comments regarding burden estimate to the Records and FOIA/Privacy Service Branch (T-5 F52), U.S. Nuclear Regulatory Commission, Washington, DC 20555-0001, or by internet e-mail to infocollects@nrc.gov, and to the Desk Officer, Office of Information and Regulatory Affairs, NEOB-10202, (3150-0104), Office of Management and Budget, Washington, DC 20503. If a means used to impose an information collection does not display a currently valid OMB control number, the NRC may not conduct or sponsor, and a person is not required to respond to, the information collection.

1. FACILITY NAME Vogle Electric Generating Plant – Unit 1	2. DOCKET NUMBER 05000-424	3. PAGE 1 OF 4
--	-------------------------------	-------------------

4. TITLE  
**MANUAL REACTOR TRIP FOLLOWING MAIN FEED REGULATING VALVE FAILURE**

5. EVENT DATE			6. LER NUMBER			7. REPORT DATE			8. OTHER FACILITIES INVOLVED	
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAME	DOCKET NUMBER(S)
10	17	2005	2005	004	00	12	16	2005		05000
									FACILITY NAME	DOCKET NUMBER(S)
										05000

9. OPERATING MODE  1	11. THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR § : (Check all that apply)										
	20.2201(b)		20.2203(a)(3)(i)		50.73(a)(2)(i)(C)		50.73(a)(2)(vii)				
10. POWER LEVEL  100%	20.2201(d)		20.2203(a)(3)(ii)		50.73(a)(2)(ii)(A)		50.73(a)(2)(viii)(A)				
	20.2203(a)(1)		20.2203(a)(4)		50.73(a)(2)(ii)(B)		50.73(a)(2)(viii)(B)				
	20.2203(a)(2)(i)		50.36(c)(1)(i)(A)		50.73(a)(2)(iii)		50.73(a)(2)(ix)(A)				
	20.2203(a)(2)(ii)		50.36(c)(1)(ii)(A)	X	50.73(a)(2)(iv)(A)		50.73(a)(2)(x)				
	20.2203(a)(2)(iii)		50.36(c)(2)		50.73(a)(2)(v)(A)		73.71(a)(4)				
	20.2203(a)(2)(iv)		50.46(a)(3)(ii)		50.73(a)(2)(v)(B)		73.71(a)(5)				
		20.2203(a)(2)(v)		50.73(a)(2)(i)(A)		50.73(a)(2)(v)(C)				OTHER	
		20.2203(a)(2)(vi)		50.73(a)(2)(i)(B)		50.73(a)(2)(v)(D)				Specify in Abstract below or in NRC Form 366A	

12. LICENSEE CONTACT FOR THIS LER	
FACILITY NAME Tom Webb, Performance Analysis	TELEPHONE NUMBER (Include Area Code) (706) 826-3105

13. COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT										
CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO EPIX		CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO EPIX
A	SJ	TD	M120	Y		B	SJ	AFV	A609	Y

14. SUPPLEMENTAL REPORT EXPECTED				15. EXPECTED SUBMISSION DATE			
YES (If yes, complete 15. EXPECTED SUBMISSION DATE)	X	NO			MONTH	DAY	YEAR

16. ABSTRACT (Limit to 1400 spaces, i.e., approximately 15 single-spaced typewritten lines)

On October 17, 2005, at 1816 EDT, Unit 1 was manually tripped from 100% power due to a rapidly decreasing Steam Generator (SG) #2 water level. The Loop 2 Main Feedwater Regulating Valve (MFRV), 1FV0520, closed unexpectedly and could not be re-opened from the control room.

A review found that 1FV0520 closed due to an electronic circuit board failure resulting from moisture intrusion into the air operated valve's electro-pneumatic transducer. The transducer was mounted in an inverted manner that did not prevent water ingress and allow drainage. Washdown activities in this area allowed moisture into the transducer, causing the subsequent failure.

The failed transducer was replaced and mounted in the upright configuration. Furthermore, the appropriate procedure has been revised to ensure that electro-pneumatic transducers are mounted in the preferred position, and all washdowns within the power block have been halted until proper administrative controls have been established.

**LICENSEE EVENT REPORT (LER)**

1. FACILITY NAME	2. DOCKET	6. LER NUMBER			3. PAGE
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	
Vogtle Electric Generating Plant - Unit 1	05000-424	2005	-- 004	-- 00	2 OF 4

**17. NARRATIVE** (If more space is required, use additional copies of NRC Form 366A)

**A) REQUIREMENT FOR REPORT**

10 CFR 50.73 (a)(2)(iv)(A) requires this report because an unplanned actuation of the reactor protection system occurred.

**B) UNIT STATUS AT TIME OF EVENT**

At the time of this event, Unit 1 was in Mode 1 (Power Operation) at 100% rated thermal power. Other than that described herein, there was no inoperable equipment that contributed to the occurrence of this event.

**C) DESCRIPTION OF EVENT**

On October 17, 2005, at 1816 EDT, Unit 1 was manually tripped from 100% power due to a rapidly decreasing Steam Generator (SG) #2 water level. The Loop 2 Main Feedwater Regulating Valve (MFRV), 1FV0520, closed unexpectedly and could not be re-opened from the control room. Another anomaly occurred when, following the reactor trip, operators had to manually close the Loop 1 MFRV, 1FV0510, when it did not close after a feedwater isolation (FWI) signal had been initiated from the reactor trip signal. Auxiliary Feedwater (AFW) actuated as expected to provide water to the SGs and the unit was returned to normal operation in Mode 3 (Hot Standby). The NRC Operations Center was notified of this event on October 17, 2005, at 1918 EDT.

A review found that the Loop 2 Main Feedwater Regulating Valve (MFRV), 1FV0520, closed unexpectedly and could not be re-opened due to an electronic circuit board failure resulting from moisture intrusion in this air-operated valve's electro-pneumatic transducer. The transducer, installed in 2003 as a replacement for an obsolete model, was mounted in the inverted position. The vendor manual for the transducer states that it will operate in any position, but should be mounted upright if dust and water ingress effects are to be minimized. Located just outside the North Main Steam Valve Room, the Loop 2 MFRV (and transducer) is under a concrete overhanging roof with one side of the room exposed to the environment. The inverted mounted position exposed a vent in the base assembly of the transducer to the outside environment and was a direct pathway (through screens) to the internal electronics compartment of the body assembly.

Further investigation determined that, prior to the reactor trip, personnel had been cleaning the Main Feedwater Regulating Valve area with a hose and sprayer. Although the washdown was planned, approved, and personnel were mindful of the trip hazard signs, evidence suggests that water from this washdown penetrated through the vent in the transducer to the electronic circuit board. When the failed electro-pneumatic transducer was unmounted, water dripped from the transducer. Inspection of a circuit

**LICENSEE EVENT REPORT (LER)**

1. FACILITY NAME	2. DOCKET	6. LER NUMBER			3. PAGE
Vogtle Electric Generating Plant - Unit 1	05000-424	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	3 OF 4
		2005	-- 004	-- 00	

**17. NARRATIVE** (If more space is required, use additional copies of NRC Form 366A)

board revealed material deposits in the area of the vent hole and a burned electrical smell. The inverted mounting of the transducer and the washdown of the area were the causes of the electronics failure, which resulted in a loss of output from the transducer causing the Loop 2 MFRV, 1FV0520, to close.

Following the trip, the Loop 1 MFRV, 1FV0510, had to be manually closed from the control room when it did not close after receiving a feedwater isolation (FWI) signal resulting from the reactor trip. When de-energized, MFRV solenoid valve, 1FY0510A, would not vent out of its exhaust port and therefore had clearly failed to shift to exhaust air from the volume booster and the valve when the FWI signal was present. Testing of this failed solenoid was performed on the bench test and no shuttling of the solenoid valve could be observed with 30 psi pressure and cycling of the electrical source. Therefore, the cause of the MFRV failure to close was binding of this solenoid valve which prevented air from being vented from the MFRV diaphragm. Further internal investigation of the failed solenoid valve will be performed to determine the exact cause for the binding.

**D) CAUSE OF EVENT**

The Loop 2 Main Feedwater Regulating Valve (MFRV), 1FV0520, closed unexpectedly and could not be re-opened due to an electronic circuit board failure resulting from moisture intrusion in this air-operated valve's electro-pneumatic transducer. The transducer, installed in 2003 as a replacement for an obsolete model, was mounted in the inverted position. The inverted mounted position exposed a vent in the base assembly of the transducer to the outside environment and was a direct pathway (through screens) for moisture intrusion into the internal electronics compartment of the body assembly.

**E) ANALYSIS OF EVENT**

Operators responded properly to control feedwater flow and stabilized the unit in Mode 3. Based on these considerations, there was no adverse effect on plant safety or on the health and safety of the public as a result of this event. Operators closed MFRV 1FV0510 after its initial failure to close automatically. However, the system's safety function had already been completed by the closure of the Loop 1 Main Feedwater Isolation Valve. In addition, the AFW system actuated as designed following initiation of the reactor trip.

This event does not represent a safety system functional failure.

**LICENSEE EVENT REPORT (LER)**

1. FACILITY NAME	2. DOCKET	6. LER NUMBER			3. PAGE
Vogtle Electric Generating Plant - Unit 1	05000-424	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	4 OF 4
		2005	-- 004	-- 00	

17. NARRATIVE (If more space is required, use additional copies of NRC Form 366A)

**F) CORRECTIVE ACTION**

- 1) The failed transducer was replaced and mounted in the upright configuration.
- 2) Transducers for the remaining three (3) MFRVs in Unit 1 were inspected and were found to be mounted in the upright position. The Unit 2 transducers are of a different design and are not susceptible to this kind of failure.
- 3) Procedure 22283-C, "Air Operated Valve & Dampers Flowscanner Checkout," has been revised to ensure that electro-pneumatic transducers are mounted in the upright position unless evaluated on a case-by-case basis. These evaluations will consider environmental conditions and the need for housekeeping activities.
- 4) All washdowns within the power block have been halted until proper administrative controls have been established.

**G) ADDITIONAL INFORMATION**

- 1) Failed Components:  
 I/P Transducer manufactured by Masoneilan International, Inc.  
 Model #7000.  
 Solenoid valve manufactured by ASCO Valve Co.  
 Model #NP8321A5E
- 2) Previous Similar Events:  
 There have been no previous similar events in the last three years.
- 3) Energy Industry Identification System Codes:  
 Main Feedwater System – SJ  
 Auxiliary Feedwater System – BA
- 4) The MFRV 1FV0510 solenoid valve was replaced and the failed solenoid is being sent to the vendor for failure analysis. Additional corrective action will be initiated upon receipt of failure analysis.