

UNITED STATES NUCLEAR REGULATORY COMMISSION REGION II 101 MARIETTA ST., N.W., SUITE 3100 ATLANTA, GEORGIA 30303

FEB 27 1931

In Reply Refer To: RIL: JPO 50-259 50-260 50-296 50-327 50-328 50-390

Tennessee Valley Authority Attn: H. G. Parris Manager of Power 500A Chestnut Street Tower II Chattanooga, TN 37401

Gentlemen:

0

This Information Notice is provided as an early notification of a possibly significant matter and it is expected that recipients will review the information for possible applicability to their facilities. No response is requested at this time. If further NRC evaluations so indicate, an IE Circular or Bulletin will be issued to further recommend or request specific licensee actions. If you have questions regarding this matter, please contact the Director of the appropriate NRC Regional Office.

Sincerely.

James P. O'Reilly Director Enclosures: IE Information Notice No. 81-04 1. 2. Recently Issued IE Information Notices cc w/encl: H. L. Abercrombie, Plant Superintendent R. E. Rogers, Project Engineer H. N. Culver, Chief, Nuclear Safety H. J. Green, Division Director **Review** Staff G. G. Stack, Project Manager J. M. Ballentine, Plant Superintendent J. F. Cox, Supervisor, Nuclear M. J. Burzynski, Project Engineer Licensing Section C. C. Mason, Acting Plant Superintendent J. E. Wilkins, Project Manager D. P. Crmsby, Project Engineer 8108160 612

SSINS No.: 6835 Accession No.: 8011040265 IN 81-04 DUPLICATE

UNITED STATES NUCLEAR REGULATORY COMMISSION OFFICE OF INSPECTION AND ENFORCEMENT WASHINGTON, D.C. 20555

February 27,1981

IE Information Notice No. 81-04: CRACKING IN MAIN STEAM LINES

Description of Circumstances:

.

The Virginia Electric Power Company promptly notified the NRC on February 23, 1981 that a radiography examination, during the ongoing steam generator replacement outage at Surry Unit 1, had revealed a lengthy crack indication in the I.D. counterbore area of a weldment on the in-line "T" fitting which connects the vertical run of 30-inch piping to the safety relief valve header and 30-inch main steam line of Steam Generator "A". This piping connection is located outside the containment penetration immediately upstream of the main steam isolation valve as shown in the attached sketch.

A visual and dye penetrant examination on the pipe I.D. surface of the weldment nearest the containment penetration established that the cracking extended about 120° around the fitting counterbore between the 4 o'clock to 8 o'clock position. Cracking was also observed in the weld counterbore at the opposite end of the T-fitting during visual examination of the piping interior. Radiographic examination of "B" and "C" main steam line T-fitting welds disclosed crack indications at similar locations.

Mctallurgical specimens of the cracking were trepanned from the T-fitting of the "A" main steam line for analysis. Controlled excavation and depth measurements of the crack at its mid-length indicated a crack depth of about 0.090" in this location. The cause of cracking has not yet been established.

VEPCO has planned an ultrasonic examination of similar weldments in Surry Unit 2 main steam lines utilizing "Hot Piping" ultrasonic techniques. Preparations are also being made to ultrasonic examine similar weldments at North Anna Unit 1, currently in cold shutdown for refueling.

Recommendation to Licensees:

This information is provided as an early notification of a significant safety matter that is still under review by the NRC staff. It is expected that recipients will review the information for possible applicability to their plants. For those plants having similar main steam line configurations which are currently in a refueling or extended repair outage, it is recommended that a ultrasonic and/or radiographic examination of the three welds and counterbore areas of the T-fittings be performed before resumption of operations, unless some current basis for assurance of piping integrity is available.

IN 81-04 February 27, 1981 Page 2 of 2

No response to this notice is requested at this time. If you have any questions regarding this matter, please contact the Director of the appropriate NRC Regional Office.

Attachments:

٠

1. Sketch

2. Recently issued IE Information

Notices



Attachment 2 IN 81-04

RECENTLY ISSUED IE INFORMATION NOTICES

Information		Date of	
Notice No.	Subject	Issue	Issued to
81-03	Checklist for Licensees Making Notifications of Significant Events in Accordance with 10 CFR 50.72	2/12/81	All power reactor facilityes with an OL
81-02	Transportation of Radiography Devices	1/23/81	All Radiography licensees
81-01	Possible Failures of General Electric Type HFA Relays	1/16/81	All power reactor facilities with OL or CP.
80-45	Potential Failure of BWR Backup Manual Scram Capability	12/17/80	All PWR facilities with an OL or CP
80-44	Actuation of ECCS in the Recirculation Mode While in Hot Shutdown	12/16/80	All PWR facilities with an OL or CP
80-43	Failures of the Continuous Water Level Monitor for the Scram Discharge Volume at Dresden Unit No. 2	12/5/80	All power reactor facilities with OL or CP
80-42	Effect of Radiation on Hydraulic Snubber Fluid	11/24/80	All power reactor facilities with OL or CP
80-41	Failure of Swing Check Valve in the Decay Heat Removal System at Davis- Besse Unit No. 1	11/10/80	All power reactor facilities with an OL or CP
80-40	Excessive Nitrogen Supply Pressure Actuates Safety- Relief Valve Operation to Cause Reactor Depressur- ization	11/10/80	All power reactor facilities with OL or CP

OL = Operating Licenses CP = Construction Permits