

Indian Point 3  
Nuclear Power Plant  
P.O. Box 215  
Buchanan, New York 10511  
914 736.8001



John H. Garrity  
Resident Manager

February 15, 1994  
IPN-94-017

U.S. Nuclear Regulatory Commission  
ATTN: Document Control Desk  
Mail Stop PI-137  
Washington, D.C. 20555

SUBJECT: Indian Point 3 Nuclear Power Plant  
Docket No. 50-286  
Licensee Event Report # 93-050-01  
"The Plant Is Outside Design Basis Because Air  
Operated Solenoid Valves Can Fail On Overpressure  
Due To Personnel Error"

Dear Sir:

The attached Licensee Event Report (LER) 93-050-01 is hereby submitted in accordance with the requirements of 10CFR50.73. This event is of the type defined in the requirements pursuant to 10CFR50.73(a)(2)(ii)(B). The supplement provides information on the extent of condition and revises two commitments made in the original LER. Also attached are the commitments made by the Authority in this LER.

Very truly yours,

A handwritten signature in black ink that reads 'John H. Garrity'.

John H. Garrity  
Resident Manager  
Indian Point 3 Nuclear Power Plant

JHG/vjm

cc: See Next Page

9402240252 940215  
PDR ADDCK 05000286  
S PDR

Handwritten initials 'JHG' and the date '2/11' written vertically.

cc: Mr. Thomas T. Martin  
Regional Administrator  
Region I  
U.S. Nuclear Regulatory Commission  
475 Allendale Road  
King of Prussia, Pennsylvania 19406-1415

INPO Records Center  
700 Galleria Parkway  
Atlanta, Georgia 30339-5957

U.S. Nuclear Regulatory Commission  
Resident Inspectors' Office  
Indian Point 3 Nuclear Power Plant

Attachment 1  
List of Commitments

Number	Commitment	Due
IPN-94-017-01	For safety related SOVs that can potentially overpressurize either install new SOVs with a MOPD $\geq 120$ psig or install safety related air regulators or safety related relief valves. This commitment revises commitment no. 3 in IPN-93-159, dated December 15, 1993.	Prior to Startup
IPN-94-017-02	Establish setpoints in accordance with MCM-8 for any new safety related regulators installed. This commitment revises commitment no. 3 in IPN-93-159, dated December 15, 1993.	Prior to Startup
IPN-94-017-03	Review orientation of existing 109 SOVs identified in extent of condition to ensure they were installed in the proper flow configuration.	Prior to Startup
IPN-94-017-04	Increase sample of SOVs for inspection if orientations are found incorrect for any of the 109 SOVs identified in extent of condition.	Prior to Startup
IPN-94-017-05	Department managers will review this LER with staff personnel who respond to Information Notices, to stress the requirements that evaluation of industry experience and its applicability to IP3 must be broad scoped and comprehensive.	Prior to Startup
IPN-94-017-06	To evaluate extent of condition for inadequate Information Notice (IN) evaluations, a representative sample of INs will be re-evaluated to ensure the original evaluations were broad scoped and comprehensive.	Prior to Startup