

PROJECT: CRYSTAL RIVER UNIT NO. 3 GROTHER:	NONCONFO	ER CORPORATION ORMANCE AND ACTION REPORT	Green: Pink:	Quality Engineer Dir. Gen. Construction Mgr. Gen. Q. & S. Extra Copy
ITEM: CONCRETE VO	QTY:	YEMBOR/CONT		rue now
P. O. NO. ACCT NO. RMF 3/204/0	R NO.:	R.O. / SPEC. NO SP 56/8		G. NO.: Se 431-023
NONCONFORMING CHARACTERISTIC	CS: NONCONFORMANCE DE	SCRIPTION: RE	TECT T	46 # 720
YOUATIN OF JAJ-WS.				
SAND IN CONSTRUCT	SAND AND	DIRT IN	CONSTR	nction Jour
BINT OF CONCRETE	OF REM TER B	406 outer	WALL BA	CONCEN BUTT
Pour # 528 RB	BANDY AT	EL. 98', A	PROXIM	OTELY. Cove.
	Pour #528	RB ON 7-25.	72 - Fu	L EXTENT
and the state of t	OF VOID TO	BE DETERA	INC	
	INSPECTOR:	n. Maa	DAT	E: /2-/4-72
REQUIRED DISPOSITION AND	CORRECTIVE ACTION	:		
DISPOSITION: Waiver #24	was issued to perm	it exploratory co	ncrete remo	val: end product
	Lt" shown on dwg. CR			
	of repair, as outlin			
at motion	JI 100011, 00 00011		-,,	
CORRECTIVE ACTION: Instru	cted foremen, PTL &	OC to perform fin	al cleanline	ess inspection
Denmit	ately before concret	ing. See copy of	Terral arm	cnet.
ATTACH REQUEST FOR WAIV				ER SER. NO. 243
SITE ACCEPTANCE	SITE REVIEW APPRO	DVAL:	BOARD REVIEW APPROVAL:	
DIR. GEN CONST. S. Parto	DIR, GEN, CONST.	D	DIR. GEN CONST.	
QUALITY ENGR. D. M. P. A. P. P. A. P.	DALITY ENGR.		DIR. GEN. ENG'RG	
10 1AN 1923	CONTR MGR.		GR. GEN. Q. & S	
REPAIR/REWORK-ENGRG. APPROVAL: None		INSPECTOR: DATE TO DATE TO THE PROPERTY OF THE		
REPAIR/REWORK PROCEDURE REQUIRED:		REPAIR/REWORK PROCEDURE NO.: See attached		
Jies Pour 52	2.8		Nº	0213
FORM NO: G-008 - Rev. December 15, 1971		NO 0213 Les atteched MC ROZZ		

P/241

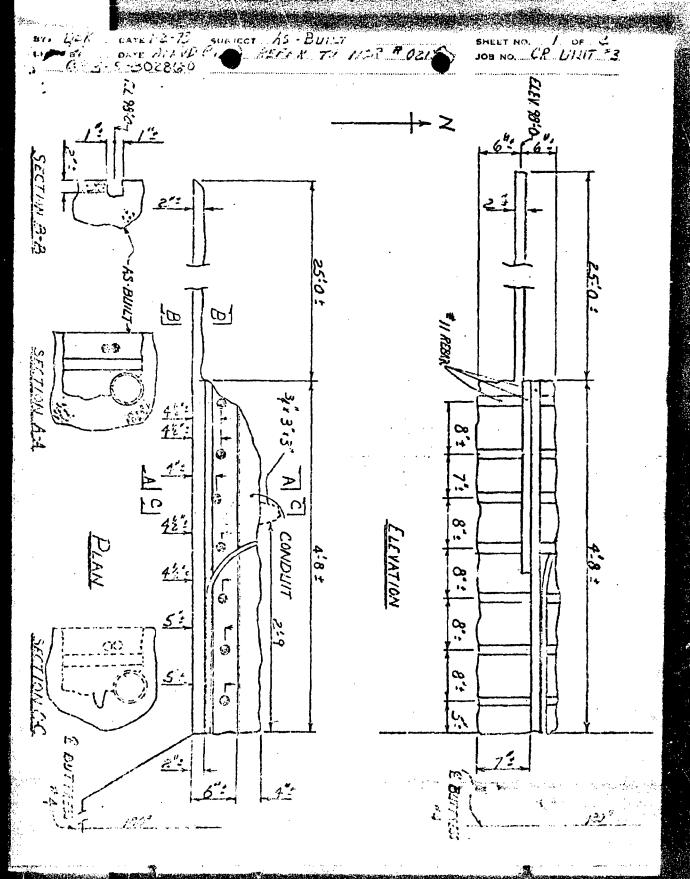

5 3056.0

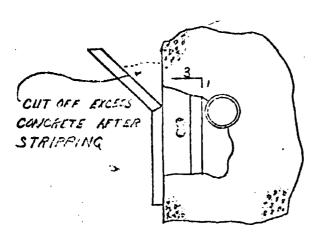


SECTION A-A


I] CHIP CAVITY SUCH THAT TOP SLOPES 1:3 OR STEEPER

2) COAT DUST-FREE, DRY SURFACES WITH EPOXY BONDING COMPOUND.

3.1 POUR WITH DM-7, 39" STONE MIX, 5000 PSI, 70°F, 3" SLUMP MAN

4.) MOIST CURE FOR TORYS

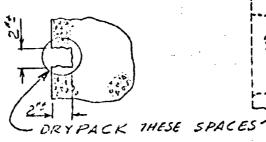

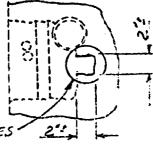

SECTION C.C.

SECTION 8-B

I) WET CONTACT SURFACES & FILL WITH PORTLAND CEMENT & SAND DRYPACK

FLORIDA POWER CORPORATIO

106 205 (5)

INTER-OFFICE CORRESPONDENCE

Generation Construction

SUBJECT

DATE Jamuary 10, 1973

To General Foremen & Foremen PTL QC

ATTENTION OF

Pour #528 R.B. buttress 3 to 4, @ el. 98, contained a "lens" type void, approximately 6' long x 2" thick x about 12" deep.

This "lens" was caused by failure to remove sand blast sand from the depression into which it accumulated, prior to concreting. Similar condition occurred in pour #644 R.B.

To avoid recurrence, it is vital that a final thorough cleanliness inspection be made immediately before actual placement of concrete.

C. Pachos

E. P. Shows

CP/ES/rc

J. J. Copy

FLORIDA POWER CORPORATION

CRYSTAL RIVER UNIT #3

REQUEST FOR WAIVER

THE UNDERSIGNED REQUESTS TO PERFORM THE FOLLOWING ACTIVITY

WITH/ON POUR #528 - BETWEEN BUTTRESS#3

ITEM

AND #4 (EL. 98') I.E. EINTER OF EDUP. HARM

TO BUTTRESS # 4.

ACTIVITY IS SCORE WITH A SKILLSAW

I DEEP ON EACH SIDE OF CONSTRUCTION

JOINT. REMOVE SCORED CONGRETE

BY CHIPPING AND INSPECT THE CONSTRUCTION

JOINT.

MAINER TAG# 633 NCR# 0215

D T

FPC - POWER CONSTRUCTION ASSUMES RESPONSIBILITY FOR ANY AND ALL CONSEQUENCES OF THIS ACTION AND UNDERSTANDS THAT, EXCEPT FOR THE ABOVE ACTIVITY, SUBJECT ITEM REMAINS IN A "H O L D" STATUS UNTIL SUCH TIME AS A "R E L E A S E" TAG REPLACES THE "H O L D" AND "W A I V E R" TAGS.

RESPONSIBILITY: C. Packo 2/ DEC 72 FPC/PC
APPROVED: D. Rodrick, D. 2/ Dec 72 FPC/QP

DISTRIBUTION:

White Original FPC SITE QUALITY ENGINEER FPC CONSTRUCTION SUPT. Geldenrod FPC MGR. - QUALITY PROGRAMS

NO

243

FORM NO. Q -010 3/18/71