

REGULATORY INFORMATION DISTRIBUTION SYSTEM (RIDS)
DISTRIBUTION FOR INCOMING MATERIAL

50-438/439

TO: OREILLY J P
NRC

ORG: GILLELAND J E
TN VALLEY AUTH

DOCDATE: 02/06/78
DATE RCVD: 02/13/78

OBJECT: LETTER NOTARIZED: NO

COPIES RECEIVED
LTR 0 ENCL 1

SUBJECT:
FORWARDING FIRST INTERIM WITH CORRECTIVE ACTIONS RE HANGER PLATES
ON CABLE TRAYS HAD BEEN ALTERED BY BEING CUT IN HALF LENGTHWISE.

PLANT NAME: BELLEFONTE - UNIT 1
BELLEFONTE - UNIT 2

REVIEWER INITIAL: XJM
DISTRIBUTER INITIAL:

***** DISTRIBUTION OF THIS MATERIAL IS AS FOLLOWS *****

CONSTRUCTION DEFICIENCY REPORT (10CFR50.55(E)).
(DISTRIBUTION CODE B004)

FOR ACTION: ASST DIR VASSALLO**LTR ONLY
PROJ MGR PIKE**LTR ONLY

BRANCH CHIEF PARR**LTR ONLY
LIC ASST RUSHBROOK**LTR ONLY

INTERNAL: REG FILE**W/ENCL
~~I & E**W/2 ENCL~~
GOSSICK & STAFF**LTR ONLY
BOYD**LTR ONLY
HELTEMES**W/ENCL
KNIGHT**LTR ONLY
TEDESCO**LTR ONLY
STANDARDS DEV. **W/ENCL

NRC PDR**W/ENCL
OELD**LTR ONLY
MIPC**W/ENCL
DEYOUNG**W/ENCL
R. MATTSON**LTR ONLY
ROSS**LTR ONLY
EISENHUT**LTR ONLY
K SEYFRIT/IE**W/ENCL

EXTERNAL: LPDR'S
SCOTTSBORO, AL**W/ENCL
TIC**W/ENCL
NSIC**W/ENCL
ACRS CAT B**W/16 LTRS


DISTRIBUTION: LTR 40 ENCL 28
SIZE: 1P+1P

CONTROL NBR: 780450052

***** THE END *****

TENNESSEE VALLEY REGULATORY DOCKET FILE COPY
CHATTANOOGA, TENNESSEE 37401

FEB 6 1978

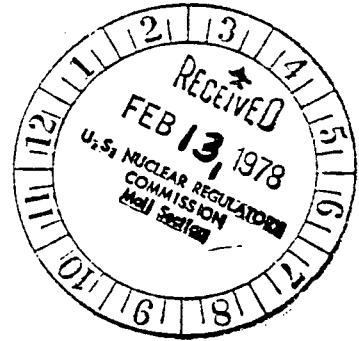

Mr. James P. O'Reilly, Director
Office of Inspection and Enforcement
U.S. Nuclear Regulatory Commission
Region II - Suite 1217
230 Peachtree Street, NW.
Atlanta, Georgia 30303

50-438
439

Dear Mr. O'Reilly:

BELLEFONTAINE NUCLEAR PLANT UNITS 1 AND 2 - HANGER PLATES FOR CABLE TRAYS
BOLTED WITH ALTERED BOLTS - NCR 753

On January 5, 1978, R. Wright, NRC-OIE Region II, was informed that the
subject nonconformance was determined to be reportable in accordance
with 10 CFR 50.55(e). Enclosed is the first interim report. We expect
to submit our next report by March 22, 1978.

Very truly yours,

J. H. Gilleland
Assistant Manager of Power

Enclosure

cc: Dr. Ernst Volgenau, Director (Enclosure) ✓
Office of Inspection and Enforcement
U.S. Nuclear Regulatory Commission
Washington, DC 20555

780450052

B004/S *

o/i

ENCLOSURE

BELLEFONTE NUCLEAR PLANT UNITS 1 AND 2 INTERIM REPORT NCR NO. 753 HANGER PLATES FOR CABLE TRAYS BOLTED WITH ALTERED BOLTS

Description of Condition

Inspection of seismic cable tray and walkway hangers DRV-EHNG-125/46 and ORV-EHNG-122/46, located at column lines A2 and Q1 elevation 610.0 of the Auxiliary Building revealed that in each of the two support plates one bolt had been altered by being cut in half lengthwise. While the nonconforming hangers were installed by a single crew, the possibility existed that other hangers installed in Bellefonte could have similar deficiencies.

Corrective Action

In order to evaluate the extent of the deficiency, a 100-percent inspection of the bolts installed by the involved crew was performed. A 10-percent random inspection was performed on those bolts installed by other crews. The 100-percent inspection revealed a total of 28 bolts that had been altered. The random 10-percent inspection revealed no altered bolts. Investigation is continuing in order to determine corrective action for the 28 nonconforming bolts.