

50-305

## NRC DISTRIBUTION FOR PART 50 DOCKET MATERIAL

FILE NUMBER

INCIDENT REPORT

TO:

Mr. J. G. Keppler

FROM:

Wisconsin Public Svc. Corp.  
Green Bay, Wisconsin  
E. W. James

DATE OF DOCUMENT

11/23/77

DATE RECEIVED

12/08/77

☒ LETTER☐ NOTORIZED

PROF

INPUT FORM

NUMBER OF COPIES RECEIVED

☒ ORIGINAL☒ UNCLASSIFIED☐ COPY

1516MED

DESCRIPTION

ENCLOSURE

PLANT NAME: Kewaunee  
RJL 12/9/77

(1-P)

Licensee Event Report (RO 50-305/77-29) on  
10/25/77 concerning failure of the diesel  
generator 1A to remain running and a Start  
Failure Alarm being received....(RO 50-305/77-30) on 10/24/77 concerning  
a containment spray pump failing to start  
during scheduled testing....

(1-P)+(1-P)

NOTE: IF PERSONNEL EXPOSURE IS INVOLVED  
SEND DIRECTLY TO KREGER/J. COLLINS

1 ENCL.

## FOR ACTION/INFORMATION

BRANCH CHIEF: (4)  
~~W/ 3 CYS FOR ACTION~~  
~~LIC ASST.~~

## INTERNAL DISTRIBUTION

REG FILE  
NRC PDR  
I S F (4)  
MIPC  
SCHROEDER/IPPOLITO  
HOUSTON  
NOVAK/CHECK  
GRIMES  
KNIGHT  
BUTLER  
HANAUER  
TEDESCO  
EISENHUT  
BAER  
SHAO  
VOLLMER/RUNCH  
KREGER/ J. COLLINS  
ROSA  
L CRACKER

## EXTERNAL DISTRIBUTION

LPDR: Kewaunee WB:  
TIC:  
NSIC:  
ACRS (16) SENT AS CAT, B

CONTROL NUMBER

773430053

*D. Latham*

REGULATORY DOCKET FILE COPY


WISCONSIN PUBLIC SERVICE CORPORATION



P.O. Box 1200, Green Bay, Wisconsin 54305

November 23, 1977

Mr. J. G. Keppler, Regional Director  
Office of Inspection & Enforcement  
Region III  
U. S. Nuclear Regulatory Commission  
799 Roosevelt Rd  
Glen Ellyn, IL 60137

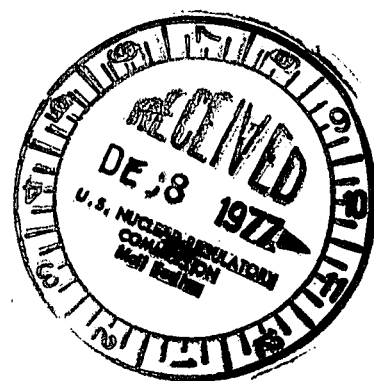

Dear Mr. Keppler:

SUBJECT: Docket 50-305  
Operating License DPR-43  
Reportable Occurrences RO 77-29 and 77-30

In accordance with the requirements of Technical Specifications, Section 6.9, the attached Licensee Event Reports for reportable occurrences RO 77-29 and 77-30 are being submitted.

Very truly yours,

A handwritten signature in cursive script.

E. W. James  
Senior Vice President  
Power Supply & Engineering

EWJ:sna

Attach.

cc - Dir, Office of Inspection & Enforcement  
US NRC, Washington, D. C. 20555  
Dir, Office of Mgt Info & Program Control  
US NRC, Washington, D. C. 20555

773430053

NOV 28 1977

# LICENSEE EVENT REPORT

CONTROL BLOCK:

(PLEASE PRINT OR TYPE REQUIRED INFORMATION)

0 1 W I K N P 1 2 0 0 - 0 0 0 0 0 0 - 0 0 3 4 1 1 1 1 4 5  
7 8 9 14 15 25 26 30 57 CAT 58  
 LICENSEE CODE LICENSE NUMBER LICENSE TYPE

CON'T

0 1 REPORT SOURCE L 6 0 5 0 0 0 3 0 5 7 1 0 2 5 7 7 8 1 1 2 3 7 7 9  
7 8 60 61 DOCKET NUMBER 68 69 EVENT DATE 74 75 REPORT DATE 80

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

0 2 During steady full power operation D/G 1A was tested to assure operability prior  
 0 3 to performing maintenance on D/G 1B. D/G 1A started and was at approximately 70 RPM  
 0 4 when it stopped and a Start Failure Alarm was received placing the facility under  
 0 5 LCO TS 3.7.b.2. The D/G system was checked out with no determination as to the  
 0 6 cause of the failure. D/G 1A started on the second attempt and during subsequent  
 0 7 scheduled testing. D/G 1B and off-site power remained available, therefore, there  
 0 8 was no effect on plant operation or public safety.  
7 8 9 80

0 9 SYSTEM CODE CAUSE CODE CAUSE SUBCODE COMPONENT CODE COMP. SUBCODE VALVE SUBCODE  
7 8 9 10 11 12 13 14 15 16  
 E E X Z ENGINE Z Z  
 17 LER/RO REPORT NUMBER EVENT YEAR SEQUENTIAL REPORT NO. OCCURRENCE CODE REPORT TYPE REVISION NO.  
7 8 21 22 23 24 26 27 28 29 30 31 32  
 7 7 0 3 0 0 3 L 0  
 ACTION TAKEN FUTURE ACTION EFFECT ON PLANT SHUTDOWN METHOD HOURS ATTACHMENT SUBMITTED NPRD-4 FORM SUB. PRIME COMP. SUPPLIER COMPONENT MANUFACTURER  
33 34 35 36 37 40 41 42 43 44 47  
 X Z Z Z 0 0 0 0 N Y A W 0 9 7  
 CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 Investigation into the failure of D/G 1A to remain running did not discover a cause  
 1 1 for this start failure. D/G 1A started and operated satisfactorily upon a second  
 1 2 start attempt and during all subsequent scheduled testing and the monthly SPs for  
 1 3 logic test and 4 hour loaded run. This is considered an isolated incident  
 1 4 and no further action is planned at this time.  
7 8 9 80

1 5 FACILITY STATUS % POWER OTHER STATUS METHOD OF DISCOVERY DISCOVERY DESCRIPTION  
7 8 9 10 12 13 44 45 46 80  
 E 1 0 0 NA C Pre-maintenance Operational Test  
 1 6 ACTIVITY CONTENT RELEASED OF RELEASE AMOUNT OF ACTIVITY LOCATION OF RELEASE  
7 8 9 10 11 44 45 80  
 Z Z NA NA  
 1 7 PERSONNEL EXPOSURES NUMBER TYPE DESCRIPTION  
7 8 9 11 12 13 80  
 0 0 0 Z NA  
 1 8 PERSONNEL INJURIES NUMBER DESCRIPTION  
7 8 9 11 12 80  
 0 0 0 NA  
 1 9 LOSS OF OR DAMAGE TO FACILITY TYPE DESCRIPTION  
7 8 9 10 80  
 Z NA  
 2 0 PUBLICITY ISSUED DESCRIPTION  
7 8 9 10 80  
 N NA  
 NRC USE ONLY  
68 69 80

NAME OF PREPARER G. H. Ruiter

PHONE: (414) 432-3311

# LICENSEE EVENT REPORT

CONTROL BLOCK:

(PLEASE PRINT OR TYPE REQUIRED INFORMATION)

0	1	W	I	K	N	P	1	2	0	0	-	0	0	0	0	0	0	3	4	1	1	1	1	4	5																																																																																																																												
LICENSEE CODE								LICENSE NUMBER								LICENSE TYPE								CAT		58																																																																																																																											
CON'T																																																																																																																																																					
0	1	L	6	0	5	0	0	0	3	0	5	7	1	0	2	4	7	7	8	1	1	2	3	7	7	9																																																																																																																											
REPORT SOURCE		DOCKET NUMBER										EVENT DATE						REPORT DATE																																																																																																																																			
EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)																																																																																																																																																					
During steady full power operation a containment spray pump failed to start during																																																																																																																																																					
scheduled testing; an overcurrent trip annunciator for the associated control																																																																																																																																																					
breaker was received. This placed the facility under LCO TS 3.3.b.2.B. This same																																																																																																																																																					
pump failed again on 11-7-77 during surveillance testing. In both cases the pump st																																																																																																																																																					
normally upon a second attempt and there was no effect on plant operation or public																																																																																																																																																					
safety. A similar failure recently occurred to the other ICS pump as reported by																																																																																																																																																					
LER 77-027/03L-0.																																																																																																																																																					
<table border="0"> <tr> <td colspan="4">SYSTEM CODE</td> <td colspan="2">CAUSE CODE</td> <td colspan="2">CAUSE SUBCODE</td> <td colspan="6">COMPONENT CODE</td> <td colspan="2">COMP. SUBCODE</td> <td colspan="2">VALVE SUBCODE</td> </tr> <tr> <td>0</td><td>9</td><td>S</td><td>B</td><td>11</td><td>X</td><td>12</td><td>Z</td><td>13</td><td>P</td><td>U</td><td>M</td><td>P</td><td>X</td><td>X</td><td>14</td><td>B</td><td>15</td><td>Z</td><td>16</td> </tr> <tr> <td colspan="4">EVENT YEAR</td> <td colspan="2">SEQUENTIAL REPORT NO.</td> <td colspan="2">OCCURRENCE CODE</td> <td colspan="2">REPORT TYPE</td> <td colspan="2">REVISION NO.</td> </tr> <tr> <td>7</td><td>7</td><td>21</td><td>22</td><td>0</td><td>2</td><td>9</td><td>24</td><td>0</td><td>3</td><td>28</td><td>29</td><td>L</td><td>30</td><td>0</td><td>32</td> </tr> <tr> <td colspan="2">ACTION TAKEN</td> <td colspan="2">FUTURE ACTION</td> <td colspan="2">EFFECT ON PLANT</td> <td colspan="2">SHUTDOWN METHOD</td> <td colspan="2">HOURS</td> <td colspan="2">ATTACHMENT SUBMITTED</td> <td colspan="2">NPRD-4 FORM SUB.</td> <td colspan="2">PRIME COMP. SUPPLIER</td> <td colspan="2">COMPONENT MANUFACTUR</td> </tr> <tr> <td>X</td><td>18</td><td>F</td><td>19</td><td>Z</td><td>20</td><td>Z</td><td>21</td><td>0</td><td>0</td><td>0</td><td>0</td><td>N</td><td>23</td><td>Y</td><td>24</td><td>A</td><td>25</td><td>I</td><td>0</td><td>7</td><td>44</td> </tr> </table>																												SYSTEM CODE				CAUSE CODE		CAUSE SUBCODE		COMPONENT CODE						COMP. SUBCODE		VALVE SUBCODE		0	9	S	B	11	X	12	Z	13	P	U	M	P	X	X	14	B	15	Z	16	EVENT YEAR				SEQUENTIAL REPORT NO.		OCCURRENCE CODE		REPORT TYPE		REVISION NO.		7	7	21	22	0	2	9	24	0	3	28	29	L	30	0	32	ACTION TAKEN		FUTURE ACTION		EFFECT ON PLANT		SHUTDOWN METHOD		HOURS		ATTACHMENT SUBMITTED		NPRD-4 FORM SUB.		PRIME COMP. SUPPLIER		COMPONENT MANUFACTUR		X	18	F	19	Z	20	Z	21	0	0	0	0	N	23	Y	24	A	25	I	0	7	44																
SYSTEM CODE				CAUSE CODE		CAUSE SUBCODE		COMPONENT CODE						COMP. SUBCODE		VALVE SUBCODE																																																																																																																																					
0	9	S	B	11	X	12	Z	13	P	U	M	P	X	X	14	B	15	Z	16																																																																																																																																		
EVENT YEAR				SEQUENTIAL REPORT NO.		OCCURRENCE CODE		REPORT TYPE		REVISION NO.																																																																																																																																											
7	7	21	22	0	2	9	24	0	3	28	29	L	30	0	32																																																																																																																																						
ACTION TAKEN		FUTURE ACTION		EFFECT ON PLANT		SHUTDOWN METHOD		HOURS		ATTACHMENT SUBMITTED		NPRD-4 FORM SUB.		PRIME COMP. SUPPLIER		COMPONENT MANUFACTUR																																																																																																																																					
X	18	F	19	Z	20	Z	21	0	0	0	0	N	23	Y	24	A	25	I	0	7	44																																																																																																																																
CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)																																																																																																																																																					
The cause of these failures is not known at this time and investigation is continu																																																																																																																																																					
The DCR to increase overcurrent trip setpoints, corrective action from LER 77-027/																																																																																																																																																					
03L-0, will be completed as soon as possible to provide additional margin to the																																																																																																																																																					
trip setpoint and increase the probability of successful ICS pump starts. Final																																																																																																																																																					
investigation results and corrective actions will be submitted at a later date.																																																																																																																																																					
<table border="0"> <tr> <td colspan="4">FACILITY STATUS</td> <td colspan="4">% POWER</td> <td colspan="4">OTHER STATUS</td> <td colspan="4">METHOD OF DISCOVERY</td> <td colspan="4">DISCOVERY DESCRIPTION</td> </tr> <tr> <td>1</td><td>5</td><td>E</td><td>28</td><td>1</td><td>0</td><td>0</td><td>29</td><td>NA</td><td>30</td><td>B</td><td>31</td><td>Surveillance Procedure</td><td>32</td> </tr> <tr> <td colspan="4">ACTIVITY RELEASED</td> <td colspan="4">CONTENT RELEASED</td> <td colspan="4">AMOUNT OF ACTIVITY</td> <td colspan="4">LOCATION OF RELEASE</td> </tr> <tr> <td>1</td><td>6</td><td>Z</td><td>33</td><td>Z</td><td>34</td><td>NA</td><td>35</td><td>NA</td><td>36</td> </tr> <tr> <td colspan="4">PERSONNEL EXPOSURES</td> <td colspan="4">DESCRIPTION</td> </tr> <tr> <td>1</td><td>7</td><td>0</td><td>0</td><td>0</td><td>37</td><td>Z</td><td>38</td><td>NA</td><td>39</td> </tr> <tr> <td colspan="4">PERSONNEL INJURIES</td> <td colspan="4">DESCRIPTION</td> </tr> <tr> <td>1</td><td>8</td><td>0</td><td>0</td><td>0</td><td>40</td><td>NA</td><td>41</td> </tr> <tr> <td colspan="4">LOSS OF OR DAMAGE TO FACILITY</td> <td colspan="4">DESCRIPTION</td> </tr> <tr> <td>1</td><td>9</td><td>Z</td><td>42</td><td>NA</td><td>43</td> </tr> <tr> <td colspan="4">PUBLICITY ISSUED</td> <td colspan="4">DESCRIPTION</td> </tr> <tr> <td>2</td><td>0</td><td>N</td><td>44</td><td>NA</td><td>45</td> </tr> </table>																												FACILITY STATUS				% POWER				OTHER STATUS				METHOD OF DISCOVERY				DISCOVERY DESCRIPTION				1	5	E	28	1	0	0	29	NA	30	B	31	Surveillance Procedure	32	ACTIVITY RELEASED				CONTENT RELEASED				AMOUNT OF ACTIVITY				LOCATION OF RELEASE				1	6	Z	33	Z	34	NA	35	NA	36	PERSONNEL EXPOSURES				DESCRIPTION				1	7	0	0	0	37	Z	38	NA	39	PERSONNEL INJURIES				DESCRIPTION				1	8	0	0	0	40	NA	41	LOSS OF OR DAMAGE TO FACILITY				DESCRIPTION				1	9	Z	42	NA	43	PUBLICITY ISSUED				DESCRIPTION				2	0	N	44	NA	45
FACILITY STATUS				% POWER				OTHER STATUS				METHOD OF DISCOVERY				DISCOVERY DESCRIPTION																																																																																																																																					
1	5	E	28	1	0	0	29	NA	30	B	31	Surveillance Procedure	32																																																																																																																																								
ACTIVITY RELEASED				CONTENT RELEASED				AMOUNT OF ACTIVITY				LOCATION OF RELEASE																																																																																																																																									
1	6	Z	33	Z	34	NA	35	NA	36																																																																																																																																												
PERSONNEL EXPOSURES				DESCRIPTION																																																																																																																																																	
1	7	0	0	0	37	Z	38	NA	39																																																																																																																																												
PERSONNEL INJURIES				DESCRIPTION																																																																																																																																																	
1	8	0	0	0	40	NA	41																																																																																																																																														
LOSS OF OR DAMAGE TO FACILITY				DESCRIPTION																																																																																																																																																	
1	9	Z	42	NA	43																																																																																																																																																
PUBLICITY ISSUED				DESCRIPTION																																																																																																																																																	
2	0	N	44	NA	45																																																																																																																																																
NRC USE ONLY																																																																																																																																																					

NAME OF PREPARER G. H. Ruiter

PHONE: (414) 432-3311