

AEC DISTRIBUTION FOR PART 50 DOCKET MATERIAL
(TEMPORARY FORM)

CONTROL NO: 67

FILE: INCIDENT REPORT

FROM: Iowa Electric & Power Co. Cedar Rapids, Iowa G.G. Hunt		DATE OF DOC 12-20-74	DATE REC'D 1-3-75	LTR xxx	TWX	RPT	OTHER
TO: Mr. James G. Keppler		ORIG 1-signed	CC	OTHER	SENT AEC PDR <u>xxxxxxx</u> SENT LOCAL PDR <u>xxxxxxx</u>		
CLASS	UNCLASS <u>xxxxxxx</u>	PROP INFO	INPUT	NO CYS REC'D 1	DOCKET NO: 50-331		

DESCRIPTION:

Ltr trans the Following:

**ACKNOWLEDGED
DO NOT REMOVE**

PLANT NAME: Duane Arnold Unit #1

ENCLOSURES:

Abnormal Occurrence (Supplemental Report)
#74-46A on sept 15 and 22, 1974 concerning
core spray pump start timer setting.....

FOR ACTION/INFORMATION

1-6-75 JGB

BUTLER (S) W/ Copies	SCHWENCER (S) W/ Copies	ZIEMANN (S) W/ Copies	REGAN (E) W/ Copies
CLARK (S) W/ Copies	STOLZ (S) W/ Copies	DICKER (E) W/ Copies	LEAR (S) W/ 4 Copies
PARR (S) W/ Copies	VASSALLO (S) W/ Copies	KNIGHTON (E) W/ Copies	SPEIS (S) W/ Copies
KNIEL (S) W/ Copies	PURPLE (S) W/ Copies	YOUNGBLOOD (E) W/ Copies	

INTERNAL DISTRIBUTION

<u>REG FILE</u> AEC PDR OGC, ROOM P-506-A MUNTZING/STAFF CASE GIAMBUSSO BOYD MOORE (S) (BWR) DEYOUNG (S) (PWR) SKOVHOLT (S) GOLLER (S) P. COLLINS DENISE REG OPR FILE & REGION T.R. WILSON	TECH REVIEW SCHROEDER MACCARRY KNIGHT PAWLICKI SHAO STELLO HOUSTON NOVAK ROSS IPPOLITO TEDESCO LONG LAINAS BENAROYA VOLIMER	DENTON GRIMES GAMMILL KASTNER BALLARD SPANGLER ENVIRO MULLER DICKER KNIGHTON YOUNGBLOOD REGAN PROJECT LDR <i>Dushey</i> HARLESS	LIC. ASST. DIGGS (S) GEARIN (S) GOULBOURNE (S) KREUTZER (E) LEE (S) MAIGRET (S) REED (E) SERVICE (S) SHEPPARD (S) SLATER (E) SMITH (S) TEETS (S) WILLIAMS (E) WILSON (S) INGRAM (S)	A/T IND BRAITMAN SALTZMAN B. HURT PLANS MCDONALD CHAPMAN DUBE w/input E. COUPE D. THOMPSON (2) KLECKER F. WILLIAMS
---	--	---	--	---

EXTERNAL DISTRIBUTION

1-LOCAL PDR Cedar Rapids, Iowa	(1) (2) (10) -NATIONAL LABS	1-PDR SAN/LA/NY
1-TIC (ABERNATHY)	1-W. PENNINGTON, RM E-201 G.T.	1-BROOKHAVEN NAT LAB
1-NSIC (BUCHANAN)	1-CONSULTANTS	1-G. ULRIKSON, ORNL
1-ASLB	NEWMARK/BLUME/AEBABIAN	1-ACMED (RUTH GUSSMAN) RM B-127 G.T.
1-NEWTON ANDERSON		1-J. RUNKLES, RM E-201 G.T.
1-ACRS SENT TO LIC. ASST. <i>TEETS</i>		

Regulatory

File Cye

IOWA ELECTRIC LIGHT AND POWER COMPANY

General Office


CEDAR RAPIDS, IOWA

DUANE ARNOLD ENERGY CENTER

PALO, IOWA

DECEMBER 20, 1974

DAEC - 74 - 424

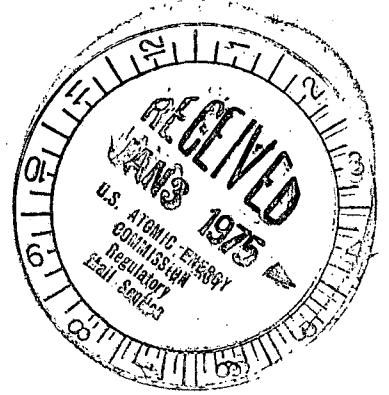

Mr. James G. Keppler, Director
Regulatory Operations Regional Office
U. S. Atomic Energy Commission
799 Roosevelt Road
Glen Ellyn, Illinois 60137

SUBJECT: Abnormal Occurrence No. 46A
FILE: A-110
A-118a

Dear Mr. Keppler:


In accordance with Appendix A to the Operating License DPR-49, Technical Specifications and Bases for Duane Arnold Energy Center, please find enclosed a Supplemental Report on the subject abnormal occurrence.

Very truly yours,

G. G. Hunt ELH
G. G. Hunt
Chief Engineer
Duane Arnold Energy Center

DLW:GGH:pd
Enclosure

- CC: ✓ E. G. Case
C. W. Sandford
J. A. Wallace
E. L. Hammond
B. R. York
R. R. Rinderman
L. D. Root
H. W. Rehrauer - Chairman, Safety Committee
G. A. Cook
D. L. Wilson
J. R. Newman
B. L. Hopkins

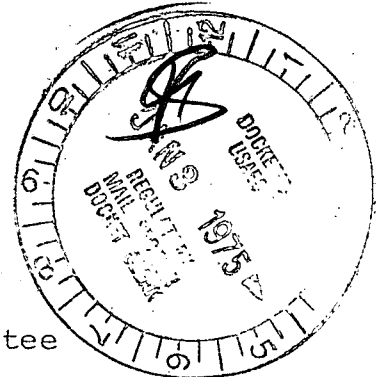

IOWA ELECTRIC LIGHT AND POWER COMPANY

General Office

CEDAR RAPIDS, IOWA

Subject: Abnormal Occurrence (Supplemental Report)
Report Number: AO 50-331/74-46A
Report Date: December 18, 1974
Occurrence Dates: September 15 and 22, 1974
Facility: Duane Arnold Energy Center, Unit #1, Palo, Iowa

The following information is intended to be a complete report and supplements information presented in the preliminary report.

Identification of Occurrences

Core Spray pump start timer setting, reportable in accordance with Appendix A to Operating License DPR-49, Specification 1.0.4.a and Table 3.2-B.

Description of Occurrences

During the performance of Surveillance Test Procedure 42B010 - Core Spray Trip System Logic Functional Test and Calibration, it was determined that the setting of Core Spray Timer E21-K16A was 5.6 seconds. Considering an instrument tolerance of 0.5 seconds, the Technical Specification limit for the Core Spray Timers is $5 \pm .5$ seconds.

NOTE: At the time of the occurrences, the allowable instrument tolerance for the timers was not specified in plant documentation. Since they did not meet the Technical Specification Limit of 5 seconds during the Surveillance Test, the Preliminary Report to the USAEC indicated that both Core Spray Timers (E21-K16A and E21-K16B) were out-of-specification. However, subsequent to submittal of the Preliminary Report, it has been determined that the allowable instrument tolerance for the timers is $\pm .5$ seconds. Since the setpoint for E21-K-16B was determined to be 5.4 seconds during the surveillance test, E21-K16B was not out-of-specification as previously reported.

Designation of Apparent Cause of Occurrences

The apparent cause of each occurrence was instrument drift.

Analysis of Occurrences

It has been determined that the occurrences did not present an unsafe plant condition.

Corrective Action

Timers E21-K16A and E21-K16B were recalibrated and retested.

Conclusion

This report was reviewed and approved by the DAEC Operations Committee on December 6, 1974. The Committee had previously concluded that the occurrences did not present a hazard to the health and safety of the public.



G. G. Hunt
Chief Engineer
Duane Arnold Energy Center

DLW:GGH:bh