

LICENSEE EVENT REPORT

CONTROL BLOCK: [ ] [ ] [ ] [ ] [ ] [ ] [ ] [ ] [ ] [ ] (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

01 | I | A | D | A | C | 1 | 2 | 0 | 0 | - | 0 | 0 | 0 | 0 | 0 | 0 | - | 0 | 0 | 3 | 4 | 1 | 1 | 1 | 1 | 1 | 1 | 4 | 5

CON'T REPORT SOURCE: 01 | L | 6 | 0 | 15 | 10 | 10 | 0 | 3 | 3 | 1 | 7 | 0 | 8 | 2 | 4 | 8 | 0 | 9 | 0 | 9 | 2 | 3 | 8 | 0 | 9

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)
02 | During power ascension, the "B" Rod Block Monitor (RBM) began indicating
03 | downscale for any rod selected causing a continuous rod withdrawal block.
04 | Rod withdrawals were continued with the "A" RBM operable and the "B" RBM
05 | bypassed. Tech. Spec. Table 3.2-C allows operation with one RBM bypassed
06 | for up to 7 days. In accordance with T.S.3.3.B.5 rod withdrawal was bloc
07 | ked when a limiting control rod pattern reached with one RBM channel ino
08 | operable. There have been two previous occurrences (RO 80-36, 79-28).

09 | SYSTEM CODE: I B 11 | CAUSE CODE: E 12 | CAUSE SUBCODE: A 13 | COMPONENT CODE: I N S T R U 14 | COMP. SUBCODE: F 15 | VALVE SUBCODE: Z 16
17 | LER/RO REPORT NUMBER: 8 0 | EVENT YEAR: 8 0 | SEQUENTIAL REPORT NO.: 0 4 4 | OCCURRENCE CODE: 0 3 | REPORT TYPE: | REVISION NO.: 0
ACTION TAKEN: B 18 | FUTURE ACTION: A 19 | EFFECT ON PLANT: Z 20 | SHUTDOWN METHOD: Z 21 | HOURS: 0 0 0 0 | ATTACHMENT SUBMITTED: N 22 | NPRO-4 FORM SUB.: N 24 | PRIME COMP. SUPPLIER: N 25 | COMPONENT MANUFACTURER: G O 8 1 0 25

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)
110 | Cause was an improperly seated pin connector at Rod Select Matrix Panel.
111 | Pin is believed to have vibrated loose over period of time. Pin connecto
112 | rs were seated and panel tested satisfactorily. Channel B RBM was return
113 | led to service within the hour. GE components. New locking connectors hav
114 | e been ordered and will be installed when received.

15 | FACILITY STATUS: F 28 | % POWER: 0 7 4 29 | OTHER STATUS: NA 30 | METHOD OF DISCOVERY: A 31 | DISCOVERY DESCRIPTION: Operator Observation 32

16 | ACTIVITY CONTENT RELEASED OF RELEASE: Z 33 | Z 34 | AMOUNT OF ACTIVITY: NA 35 | LOCATION OF RELEASE: NA 36

17 | PERSONNEL EXPOSURES NUMBER: 0 0 0 37 | TYPE: Z 38 | DESCRIPTION: NA 39

18 | PERSONNEL INJURIES NUMBER: 0 0 0 40 | DESCRIPTION: NA 41

19 | LOSS OF OR DAMAGE TO FACILITY TYPE: Z 42 | DESCRIPTION: NA 43

20 | PUBLICITY ISSUED DESCRIPTION: N 44 | DESCRIPTION: NA 45

8009300501 NRC USE ONLY