

Entergy Nuclear South Entergy Operations, Inc. 17265 River Road Killona, LA 70057-3093 Tel 504-739-6660 Fax 504-739-6678 djacob2@entergy.com

Donna Jacobs Vice President - Operations Waterford 3

10 CFR 50.73

W3F1-2012-0044

June 4, 2012

U.S. Nuclear Regulatory Commission Attn: Document Control Desk 11555 Rockville Pike Rockville, MD 20852

Subject:

Licensee Event Report 2012-003-00 Waterford Steam Electric Station, Unit 3 (Waterford 3) Docket No. 50-382 License No. NPF-38

Dear Sir or Madam:

Entergy is hereby submitting Licensee Event Report (LER) 2012-003-00 for Waterford Steam Electric Station Unit 3. This report provides details associated with a cracked instrument line which affects the Fire Protection Program analysis.

Based on plant evaluation, it was determined that this condition is reportable under 10 CFR 50.73(a)(2)(ii) requirements.

This report contains no new commitments. Please contact Michael Mason, Licensing Manager (acting), at (504) 739-6673 if you have questions regarding this information.

Sincerely,

FOR D. JACOBS.

DJ/WH

Attachment: Licensee Event Report 2012-003-00

IE22 NRR

W3F1-2012-0044 Page 2

cc: Mr. Elmo E. Collins, Jr. Regional Administrator U. S. Nuclear Regulatory Commission Region IV 1600 E. Lamar Blvd. Arlington, TX 76011-4511

> NRC Senior Resident Inspector Waterford Steam Electric Station Unit 3 P.O. Box 822 Killona, LA 70066-0751

U. S. Nuclear Regulatory Commission Attn: Mr. N. Kalyanam Mail Stop O-07D1 Washington, DC 20555-0001 Marlone.Davis@nrc.gov Dean.Overland@nrc.gov

RidsRgn4MailCenter@nrc.gov

Kaly.Kalyanam@nrc.gov

INPO Records Center

lerevents@inpo.org

Attachment to

W3F1-2012-0044

Licensee Event Report 2012-003-00

LICENSEE EV (See revers) digits/char 1. FACILITY NAME Waterford 3 Steam Ele 4. TITLE Cracked Instrument Lir 5. EVENT DATE MONTH DAY YEA 04 04 201 9. OPERATING MODE 1 10. POWER LEVEL 100	VENT REPORT (LER)         e for required number of racters for each block)         ectric Station         ne Affects Fire Protection S         6. LER NUMBER         8. YEAR         SEQUENTIAL         NUMBER         12         2012         20.2201(b)         20.2201(b)         20.2203(a)(1)         20.2203(a)(2)(i)         20.2203(a)(2)(ii)	Estimated bun request: 80 ho and fed back tr Section (T-5 F or by internet Information and Budget, Washi does not displ sponsor, and a 2. DOCKET 05 afe Shutdown . REPORT DATE ITH DAY YEAR 6 04 2012 IITTED PURSUANT T 203(a)(3)(i) 203(a)(3)(ii) 203(a)(4) 6(c)(1)(i)(A)	den per response to comply urs. Reported lessons learned o industry. Send comments reg 53), U.S. Nuclear Regulatory (e- e-mail to infocollects.resource(c d Regulatory Affairs, NEOB-102 ington, DC 20503. If a mean ay a currently valid OMB con person is not required to respon <b>NUMBER</b> 000 382 Analysis <b>8. OTHER</b> FACILITY NAME FACILITY NAME FACILITY NAME FACILITY NAME	with this mand are incorporati arding burden i Commission, W Prrc.gov, and t 202 (3150-0104 s used to impor trol number, th ind to, the infor <b>3. PAGE</b> <b>BOCKET N</b> 0500 DOCKET N 0500 <b>10 CFR §:</b> (1 50.73	datory inform ed into the lic estimate to the lashington, D o the Desk C ), Office of M se an inform e NRC may mation collect 1 OF INVOLVED IUMBER 00	ation collection rensing process e FOIA/Privacy C 20555-0001, Mificer, Office of anagement and ation collection not conduct or ion.
1. FACILITY NAME Waterford 3 Steam Ele 4. TITLE Cracked Instrument Lir 5. EVENT DATE MONTH DAY YEA 04 04 201 9. OPERATING MODE 1 10. POWER LEVEL 100	ectric Station         ne Affects Fire Protection S         6. LER NUMBER         G.       SEQUENTIAL       REV       MOI         I2       2012       -       003       -       00       01         I2       20.2201(b)       I2       20.2       I2       I2 <thi2< th="">       I2       <thi2< td="" th<=""><td>2. DOCKET 05 afe Shutdown . REPORT DATE JTH DAY YEAR 0 04 2012 IITTED PURSUANT T 203(a)(3)(i) 203(a)(3)(ii) 203(a)(4) 6(c)(1)(i)(A)</td><td>NUMBER           000         382           Analysis         8. OTHER           FACILITY NAME         8. OTHER           FACILITY NAME         9. OTHER           FO THE REQUIREMENTS OF         9. So.73(a)(2)(i)(C)           50.73(a)(2)(i)(A)         50.73(a)(2)(i)(A)</td><td>3. PAGE FACILITIES DOCKET N 0500 DOCKET N 0500 10 CFR §: (1 50.73</td><td>1 of INVOLVED IUMBER DO IUMBER DO</td><td>3</td></thi2<></thi2<>	2. DOCKET 05 afe Shutdown . REPORT DATE JTH DAY YEAR 0 04 2012 IITTED PURSUANT T 203(a)(3)(i) 203(a)(3)(ii) 203(a)(4) 6(c)(1)(i)(A)	NUMBER           000         382           Analysis         8. OTHER           FACILITY NAME         8. OTHER           FACILITY NAME         9. OTHER           FO THE REQUIREMENTS OF         9. So.73(a)(2)(i)(C)           50.73(a)(2)(i)(A)         50.73(a)(2)(i)(A)	3. PAGE FACILITIES DOCKET N 0500 DOCKET N 0500 10 CFR §: (1 50.73	1 of INVOLVED IUMBER DO IUMBER DO	3
Waterford 3 Steam Ele 4. TITLE Cracked Instrument Lir 5. EVENT DATE MONTH DAY YEA 04 04 201 9. OPERATING MODE 1 10. POWER LEVEL 100	ectric Station         ne Affects Fire Protection S         6. LER NUMBER         G. LER NUMBER       G         JR       YEAR       SEQUENTIAL NUMBER       REV NO       MOI         12       2012       -       003       -       00       0         11. THIS REPORT IS SUBBI       _       20.2201(b)       _       20.22       _       20.2         _       20.2201(d)       _       20.2       _       _       _       _       _         _       20.2203(a)(1)       _       _       20.2       _       <	afe         Shutdown           . REPORT DATE	000 382 Analysis FACILITY NAME FACILITY NAME FACILITY NAME FACILITY NAME FACILITY NAME FACILITY NAME FACILITY NAME FACILITY NAME	E FACILITIES DOCKET № 0500 DOCKET № 0500 10 CFR §: (0 50.73	1 OF	3
4. TITLE Cracked Instrument Lir 5. EVENT DATE MONTH DAY YEA 04 04 201 9. OPERATING MODE 1 10. POWER LEVEL 100	Affects Fire Protection S         6. LER NUMBER         G. LER NUMBER       G         R       YEAR       SEQUENTIAL NUMBER       REV NO       MOI         12       2012       -       003       -       00       0         11. THIS REPORT IS SUBI	afe         Shutdown           . REPORT DATE	Analysis         8. отнев           FACILITY NAME         FACILITY NAME           FACILITY NAME         50.73(a)(2)(i)(C)           50.73(a)(2)(i)(A)         50.73(a)(2)(i)(A)	E FACILITIES DOCKET № 0500 DOCKET № 0500 10 CFR §: (1 50.73	INVOLVED IUMBER )0 IUMBER )0	
Cracked Instrument Lir 5. EVENT DATE MONTH DAY YEA 04 04 201 9. OPERATING MODE 1 10. POWER LEVEL 100	Affects Fire Protection S           6. LER NUMBER         7           Image: Rest of the state of the s	afe         Shutdown           . REPORT DATE	Analysis 8. OTHEF FACILITY NAME FACILITY NAME FACILITY NAME O THE REQUIREMENTS OF 50.73(a)(2)(i)(C) 50.73(a)(2)(ii)(A)	E FACILITIES DOCKET № 0500 DOCKET № 0500 F 10 CFR §: (° 50.73	INVOLVED IUMBER DO IUMBER DO	
5. EVENT DATE       MONTH     DAY     YEA       04     04     201       9. OPERATING MODE     1       10. POWER LEVEL     100	6. LER NUMBER         R       YEAR       SEQUENTIAL NUMBER       REV NO       MOI         12       2012       -       003       -       00       0         11. THIS REPORT IS SUBI       20.2201(b)       20.22       20.22       20.22       20.22       20.22         20.2203(a)(1)       20.22	C. REPORT DATE           JTH         DAY         YEAR           6         04         2012           IITTED PURSUANT T         203(a)(3)(i)         203(a)(3)(ii)           203(a)(3)(ii)         203(a)(4)         6(c)(1)(i)(A)	8. OTHER FACILITY NAME FACILITY NAME TO THE REQUIREMENTS OI 50.73(a)(2)(i)(C) 50.73(a)(2)(ii)(A)	FACILITIES           DOCKET N           0500           DOCKET N           05000           To CFR §: (°           50.73	IUMBER JO IUMBER JO	
MONTH DAY YEA 04 04 201 9. OPERATING MODE 1 10. POWER LEVEL 100	IR         YEAR         SEQUENTIAL NUMBER         REV NO         MOI           12         2012         -         003         -         00         0           11.         THIS REPORT IS SUBH	JTH         DAY         YEAR           6         04         2012           11TTED PURSUANT 1         203(a)(3)(i)         203(a)(3)(ii)           203(a)(3)(ii)         203(a)(3)(ii)           203(a)(4)         6(c)(1)(i)(A)	FACILITY NAME FACILITY NAME TO THE REQUIREMENTS OF 50.73(a)(2)(i)(C) 50.73(a)(2)(ii)(A)	050( 050)) 050( 050)	DO IUMBER DO	
04 04 201 9. OPERATING MODE 1 10. POWER LEVEL 100	12       2012 - 003 - 00       0         11. THIS REPORT IS SUBI       20.2201(b)       20.2         20.2201(d)       20.2         20.2203(a)(1)       20.2         20.2203(a)(2)(i)       50.3         20.2203(a)(2)(i)       50.3	6 04 2012 MITTED PURSUANT T 203(a)(3)(i) 203(a)(3)(ii) 203(a)(3)(ii) 203(a)(4) 6(c)(1)(i)(A)	FACILITY NAME TO THE REQUIREMENTS OI 50.73(a)(2)(i)(C) 50.73(a)(2)(ii)(A)	DOCKET N 0500 10 CFR §: (1 50.73	iumber )0	
9. OPERATING MODE 1 10. POWER LEVEL 100	11. THIS REPORT IS SUBR         20.2201(b)       20.2         20.2201(d)       20.2         20.2203(a)(1)       20.2         20.2203(a)(2)(i)       50.3         20.2203(a)(2)(ii)       50.3	AITTED PURSUANT 1 203(a)(3)(i) 203(a)(3)(ii) 203(a)(4) 6(c)(1)(i)(A)	TO THE REQUIREMENTS OF 50.73(a)(2)(i)(C) 50.73(a)(2)(ii)(A)	<b>10 CFR §:</b> (		
1 10. power level 100	20.2201(b)       20.2         20.2201(d)       20.2         20.2203(a)(1)       20.2         20.2203(a)(2)(i)       50.3         20.2203(a)(2)(ii)       50.3	203(a)(3)(i) 203(a)(3)(ii) 203(a)(4) 6(c)(1)(i)(A)	☐ 50.73(a)(2)(i)(C) ☐ 50.73(a)(2)(ii)(A)	50.73	Check all tha	t apply)
100 100	20.2203(a)(2)(II) _ 50.3	O(+)(4)(:)(A)	<ul> <li>☐ 50.73(a)(2)(ii)(B)</li> <li>☐ 50.73(a)(2)(iii)</li> <li>☐ 50.73(a)(2)(iii)</li> </ul>	50.73 50.73 50.73	(a)(2)(vii) (a)(2)(viii)(/ (a)(2)(viii)({ (a)(2)(ix)(A (a)(2)(ix)(A	4) 3)
	$\begin{array}{ c c c c c c c c c c c c c c c c c c c$	6(c)(2) 6(c)(2) 6(a)(3)(ii) 3(a)(2)(i)(A)	$ \begin{array}{c c} 50.73(a)(2)(1V)(A) \\ \hline 50.73(a)(2)(V)(A) \\ \hline 50.73(a)(2)(V)(B) \\ \hline 50.73(a)(2)(V)(C) \\ \end{array} $	0.73 73.71	(a)(2)(x) (a)(4) (a)(5) R	
	$\square 20.2203(a)(2)(vi) \square 50.7$	3(a)(2)(i)(B)	50.73(a)(2)(v)(D)	— Speci NRC	fy in Abstra Form 366A	ict below or in
	12. LICENSE	CONTACT FOR	THIS LER			
FACILITY NAME	atria Station Michael Mae	~~		Clude Area Co	ide) 670	
13. C	COMPLETE ONE LINE FOR EACH (	OMPONENT FAIL		S REPORT	075	
CAUSE SYSTEM (	COMPONENT MANU- FACTURER TO EPI	BLE CAUSE	SYSTEM COMP	ONENT F	MANU- ACTURER	REPORTABLE TO EPIX
14. SUPI	PLEMENTAL REPORT EXPECTED	<u></u> .	15. EXPECTED	MONTH	DAY	YEAR
YES (If yes, complete 1	5. EXPECTED SUBMISSION DATE	NO 🛛	DATE			
ABSTRACT (Limit to 1400 spa On 04/04/2012, dur instrument line asso Investigation detern normally open instru Engineering evalua function. Due to the actions could be aff	aces, i.e., approximately 15 single-sp ing the conduct of a sched ociated with the steam supp nined the leakage source a ument root valve. The leak tion has determined that E e steam leak in the EFW P fected which requires this to	aced typewritten line oly to Emerger s a crack in the age was isolat FW Pump AB area, o be reported u	es) ce, steam leakage ncy Feedwater (EF e instrument line d ted by closing the i remained capable the fire protection s under 10CFR50.73	was obse W) Pump ownstrea nstrumer of perforr safe shute (a)(2)(ii).	erved fro AB. m of the t root va ning its down ma	om an Ilve. safety anual

1

NRC FORM 366A (10-2010)	A LICENSEE EVENT REPORT (LER) U.S. NUCLEAR REGULATORY COMMISSION CONTINUATION SHEET							
1. FACILITY NAME		2. DOCKET	6. LER NUMBER			3. PAGE		
Waterford 3 Steam E	eam Electric Station	05000382	YEAR	SEQUENTIAL NUMBER	REV NO.	2 OF 3		
			2012	- 003 -	00	2 01 0		

### NARRATIVE

## REPORTABLE OCCURRENCE

On 04/04/2012, during the conduct of a scheduled surveillance, steam leakage was observed from an instrument line associated with the steam supply to Emergency Feedwater (EFW) [BA] Pump AB [P]. Investigation determined the leakage source as a crack in the instrument line downstream of the normally open instrument root valve. The leakage was isolated by closing the instrument root valve.

Engineering evaluation has determined that EFW Pump AB remained capable of performing its safety function. Due to the steam leak in the EFW Pump AB area, the fire protection safe shutdown manual actions could be affected which requires this to be reported under 10CFR50.73(a)(2)(ii)..

## **INITIAL CONDITIONS**

During this time period, Waterford Steam Electric Station Unit 3 (Waterford 3) was operating in Mode 1, stable at or near 100% power. The Emergency Feedwater (EFW) system was aligned for normal operations with no plant protection system actuation signals present.

# **EVENT DESCRIPTION**

While Operations personnel were performing the procedure for the EFW Pump AB operability test as a scheduled surveillance, personnel at the pump discovered that a small steam leak previously thought to be coming from the packing of manual isolation valve MS-414 (EFW Pump AB Turbine Steam Supply MS IPT8340 Root) [P] was actually emanating from a crack in the instrument line connected downstream of MS-414. The condition was reported to Control Room personnel and the decision was made to stop the surveillance. In stopping the pump and returning to standby, the EFW Pump AB turbine steam supply is isolated from Main Steam (MS) system pressure, which resulted in stopping the steam leakage.

Closer examination confirmed that the source of the steam leakage was a crack in the instrument line just downstream of valve MS-414. After consultation with Engineering, Operations supervision directed isolating the cracked instrument line by closing valve MS-414.

Operations and Engineering evaluated the status of EFW Pump AB and determined that, with the instrument line isolated, the pump was capable of performing its safety function and was operable.

The steam leak was originally identified as a packing leak on 9/6/2011.

A subsequent Engineering evaluation which considered the as-found steam leakage and location determined that personnel access to EFW Pump AB area was not assured prior to identifying the cracked instrument line.

This reported condition is entered into the site corrective action program as CR-WF3-2012-1669.

# SYSTEM DESIGN

The EFW system consists of three pumps which take a common suction from the Condensate Storage Pool, discharge to a common header, and supply water to either of two Steam Generators (SGs) [HX] through redundant flow control and isolation valves. EFW Pumps A and B are 50% capacity motor driven pumps. EFW Pump AB is a 100% capacity steam turbine driven pump. EFW system controls are located both in the Control Room and in the Remote Shutdown Room. All three EFW pumps

NRC FORM 366A (10-2010) LICENSEE EVENT REPORT (LER) U.S. NUCLEAR REGULATORY COMMISSION CONTINUATION SHEET								
1. FACILITY NAME	2. DOCKET	6	6. LER NUMBER	3. PAGE				
Waterford 3 Steam Electric Station	05000382	YEAR	SEQUENTIAL NUMBER	REV NO.	3 OF 3			
		2012	- 003 -	00				

#### NARRATIVE

automatically start on Emergency Feedwater Actuation Signal (EFAS) and act, along with flow control and isolation valves, to automatically maintain water level in the non-faulted steam generators [HX] to provide an adequate heat sink for residual heat removal post-trip. The system remains in standby unless actuated in response to a loss of Main Feedwater [SJ] to the SGs.

# CAUSAL FACTORS

The cause of the instrument line crack is not currently known. The crack location is immediately downstream of the closed manual isolation valve MS-414. Due to the close proximity of the isolating valve and the risk of performing the line removal near the operable EFW Pump AB, the instrument line has not yet been removed for further evaluation.

# CORRECTIVE ACTIONS

The following corrective actions are in place:

- EFW Pump AB was evaluated as operable with a compensatory measure. The compensatory measure is to maintain isolation valve MS-414 closed.
- The condition will remain open within the corrective action program until resolved.

# SAFETY SIGNIFICANCE

There is minimal safety significance for this condition because, in evaluating past operability, there was minimal adverse affect to mitigating system functions.

Engineering evaluation has determined that the identified crack at its current size would not have resulted in there being insufficient steam available for EFW Pump AB for the evaluated time to establish shutdown cooling. It also would not have resulted in a harsh environment in the Reactor Auxiliary Building (RAB) -35 ft. el. hallway or exceeding the previously analyzed offsite dose release. Therefore, if there had been an accident, the identified crack would not have resulted in any unacceptable consequences.

As the current evaluation cannot rule out crack growth, further engineering evaluation does conclude that EFW Pump AB maintains sufficient steam supply to perform its safety function for the evaluated time to establish shutdown cooling assuming the instrument line were to part at the crack. Control Room dose and offsite dose release are minimally affected. This condition could result in limiting personnel access to the RAB -35 ft. el. hallway, but would not affect operation of EFW Pump AB.

## SIMILAR EVENTS

Corrective action program data for the past three years was searched for similar failures. None were found.

## ADDITIONAL INFORMATION

Energy industry identification system (EIIS) codes are identified in the text within brackets [].