

ENCLOSURE 1

NOTICE OF VIOLATION

Carolina Power and Light Company
H. B. Robinson Unit 2

Docket No.: 50-261
License No.: DPR-23

During the NRC inspection conducted on December 12, 1992, - January 8, 1993, two violations of NRC requirements were identified. In accordance with the "General Statement of Policy and Procedure For NRC Enforcement Actions," 10 CFR Part 2, Appendix C (1992), the violations are listed below:

- A. Technical Specification 6.5.1.1.1.a requires that procedures be implemented for activities referenced in Appendix A of Regulatory Guide 1.33, Revision 2, February 1978. Appendix A item 8.a requires written procedures for calibration of safety-related instrumentation. Data sheet TIC-651 of Appendix B to the Calibration Program, MMM-006, specifies a three-point calibration of TIC-651. TIC-651 is used to ensure compliance with Technical Specification requirements on Spent Fuel Pit temperature.

Contrary to the above, on December 12, 1992, MMM-006, Appendix B, Calibration Data Sheet TIC-651 was not implemented in that TIC-651 was calibrated at a single point instead of the specified three points.

This is a Severity Level IV violation (Supplement I).

- B. Technical Specification 6.5.1.1.1.a requires that procedures be established for activities referenced in Appendix A of Regulatory Guide 1.33, Revision 2, February 1978. Appendix A item 6.a requires procedures be established for combating a loss of coolant event. EPP-9 was established for the transition between the injection phase and recirculation phase of a loss of coolant event.

Contrary to the above, EPP-9 was not adequately established in that the procedure provided instructions for operation above the shutoff head of the Residual Heat Removal (RHR) pump without a time limitation to preclude damage to the RHR pump.

This is a Severity Level IV violation (Supplement I).

Pursuant to the provisions of 10 CFR 2.201, Carolina Power and Light Company is hereby required to submit a written statement or explanation to the U. S. Nuclear Regulatory Commission, ATTN: Document Control Desk, Washington, DC 20555, with a copy to the Regional Administrator, Region II, and a copy to the NRC Resident Inspector, within 30 days of the date of the letter transmitting this Notice of Violation (Notice). This reply should be clearly marked as a "Reply to a Notice of Violation" and should include for each violation: (1) the reason for the violation, or, if contested, the basis for disputing the violation, (2) the corrective steps that have been taken and the results achieved, (3) the corrective steps that will be taken to avoid further

Carolina Power and Light Company
H. B. Robinson Unit 2

2

Docket No.: 50-261
License No.: DPR-23

violations, and (4) the date when full compliance will be achieved. If an adequate reply is not received within the time specified in this Notice, an order may be issued to show cause why the license should not be modified, suspended, or revoked, or why such other action as may be proper should not be taken. Where good cause is shown, consideration will be given to extending the response time.

Dated at Atlanta, Georgia
this 25th day of January 1993