

**NRC DISTRIBUTION FOR PART 50 DOCKET MATERIAL
(TEMPORARY FORM)**

CONTROL NO: 3685

FILE: INCIDENT REPORT FILE

FROM: Duke Power Co. Charlotte, N.C. 28201 A.C. Thies			DATE OF DOC 4/2/75	DATE REC'D 4/4/75	LTR XX	TWX	RPT	OTHER
TO: N.C. Moseley			ORIG	CC xx	OTHER	SENT AEC PDR <u>xxx</u> SENT LOCAL PDR <u>xxx</u>		
CLASS	UNCLASS xxx	PROP INFO	INPUT	NO CYS REC'D 1		DOCKET NO: 50-269		

DESCRIPTION:
Ltr trans the following:

PLANT NAME: Oconee 1

ENCLOSURES:
Abnormal Occurrence Rpt. A0-269/75-2
occurring 3/20/75 re: reactor coolant
pressure transmitter out of calibration

ACKNOWLEDGED
DO NOT REMOVE

FOR ACTION/INFORMATION LDM 4/7/75

BUTLER (L) W/ Copies	SCHWENCER (L) W/ Copies	ZIEMANN (L) W/ Copies	REGAN (E) W/ Copies
CLARK (L) W/ Copies	STOLZ (L) W/ Copies	DICKER (E) W/ Copies	LEAR (L) W/ Copies
PARR (L) W/ Copies	VASSALLO (L) W/ Copies	KNIGHTON (E) W/ Copies	SPELS W/ Copies
KNIEL (L) W/ Copies	✓ PURPLE (L) W/ Copies	YOUNGBLOOD (E) W/ Copies	W/ Copies

INTERNAL DISTRIBUTION

- | | | | | |
|---|--|--|---|--|
| REG FILE
NRC PDR
OGC, ROOM P-506A
GOSSICK/STAFF
CASE
GIAMBUSSO
BOYD
MOORE (L)
DEYOUNG (L)
SKOVHOLT (L)
GOLLER (L) (Ltr)
P. COLLINS
DENISE
REG OPR
FILE & REGION (2)
T.R. WILSON (3)
STEELE | TECH REVIEW
SCHROEDER
MACCARY
KNIGHT
PAWLICKI
SHAO
**STELLO
**HOUSTON
**NOVAK
ROSS
IPPOLITO
TEDESCO
LONG
LAINAS
BENAROYA
VOLLMER | DENTON
**GRIMES
GAMMILL
KASTNER
BALLARD
SPANGLER

ENVIRO
MULLER
DICKER
KNIGHTON
YOUNGBLOOD
REGAN
PROJECT LDR

HARLESS | LIC ASST
R. DIGGS (L)
H. GEARIN (L)
E. GOULBOURNE (L)
P. KREUTZER (E)
J. LEE (L)
M. MAIGRET (L)
S. REED (E)
M. SERVICE (L)
✓ S. SHEPPARD (L)
M. SLATER (E)
H. SMITH (L)
S. TEETS (L)
G. WILLIAMS (E)
V. WILSON (L)
R. INGRAM (L) | A/T IND.
BRAITMAN
SALTZMAN
MELTZ

PLANS
MCDONALD
CHAPMAN
DUBE (Ltr)
E. COUPE
PETERSON
HARTFIELD (2)
KLECKER
EISENHUT
WIGGINTON

F. WILLIAMS
HANAUER |
|---|--|--|---|--|

EXTERNAL DISTRIBUTION

- | | | |
|-----------------------------------|--------------------------------|---|
| 1 - LOCAL PDR <u>Walhalla, SC</u> | 1 - NATIONAL LABS | 1 - PDR-SAN/LA/NY |
| 1 - TIC (ABERNATHY) (1)(2)(10) | 1 - W. PENNINGTON, Rm E-201 GT | 1 - BROOKHAVEN NAT LAB |
| 1 - NSIC (BUCHANAN) | 1 - CONSULTANTS | 1 - G. ULRIKSON, ORNL |
| 1 - ASLB | NEWMARK/BLUME/AGBABIAN | 1 - AGMED (RUTH GUSSMAN)
Rm B-127 GT |
| 1 - Newton Anderson | | 1 - J. D. RUNKLES, Rm E-201
GT |
| ✓ 5 - ACRS SENT TO LIC ASST | | |
| ** SEND ONLY TEN DAY REPORTS | | |

DUKE POWER COMPANY
POWER BUILDING
422 SOUTH CHURCH STREET, CHARLOTTE, N. C. 28201

A. C. THIES
SENIOR VICE PRESIDENT
PRODUCTION AND TRANSMISSION

P. O. Box 2178

April 2, 1975


Mr. Norman C. Moseley, Director
U. S. Nuclear Regulatory Commission
Suite 818
230 Peachtree Street, Northwest
Atlanta, Georgia 30303

Re: Oconee Unit 1
Docket No. 50-269

Dear Mr. Moseley:

Pursuant to Sections 6.2 and 6.6.2 of the Oconee Nuclear Station
Technical Specifications, please find attached Abnormal Occurrence
Report AO-269/75-2.


Very truly yours,

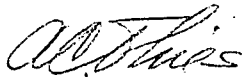

A. C. Thies

ACT:vr
Attachment

cc: Mr. Angelo Giambusso

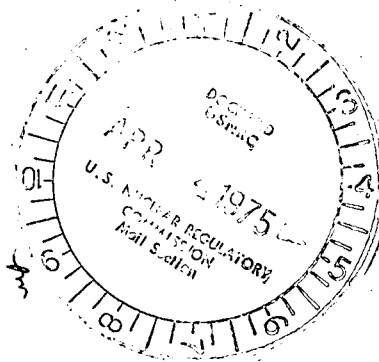

3685

Regulatory

File C72

DUKE POWER COMPANY
OCONEE UNIT 2

Report No.: AO-269/75-2

Report Date: April 2, 1975

Occurrence Date: March 20, 1975

Facility: Oconee Unit 1, Seneca, South Carolina

Identification of Occurrence: Reactor coolant pressure transmitter out of calibration

Conditions Prior to Occurrence: Unit at 75 percent full power

Description of Occurrence:

On March 20, 1975, the calibration of the Oconee Unit 1 reactor coolant pressure transmitters was checked. The Channel "D" pressure transmitter was found to be out of calibration by -2.7 percent. The full scale error measured as a result of transmitter drift was -21.6 psi. The pressure transmitters for Channels A, B and C were within the required 2-percent limit. These transmitters provide reactor coolant pressure information to the Reactor Protective System (RPS).

Designation of Apparent Cause of Occurrence:

The apparent cause of this occurrence is the excessive drift associated with changing ambient temperature for this pressure transmitter. This transmitter was calibrated on February 19, 1975 when the unit was in a cold shutdown condition. After heating up, the instrument drifted in the negative direction by -2.7 percent.

Analysis of Occurrence:

The Reactor Protective System (RPS) high and low pressure trips are actuated by signals from these pressure transmitters. The RPS logic produces a trip when two out of four channels trip. Due to the redundancy present in the RPS, the calibration of one pressure transmitter did not affect the safe operation of the unit.

For the affected transmitter, the low pressure trip setpoint drifted in a conservative direction, and the high pressure trip setpoint exceeded the maximum RPS trip setting (2355) by 15.6 psi. However, the high pressure trip setpoint had been set at 2349 psig to allow for instrument drift and a total reactor coolant pressure measurement error of -30 psi had been assumed in the safety analysis. Therefore, the pressure transmitter drift would not have resulted in a high pressure trip at a pressure higher than that assumed in the safety analysis. Furthermore, the safety limit of 2790 psig was not approached. It is concluded that the health and safety of the public was not affected.

Corrective Action:

The pressure transmitter was recalibrated to the required specifications. A test of this and several possible replacement transmitters, calibrated to the same specifications, has been completed with the recommendation that the narrow range pressure transmitters be replaced. Procurement of new transmitters is in progress, and it is estimated that they will be available for installation in early 1976. In the interim, the transmitters are being calibrated monthly and only at the elevated operating temperatures so as to minimize transmitter drift.

Failure Data:

.The pressure transmitter is a Motorola Type 56 PH, ID #1224-0301.