




Commonwealth Edison

Dresden Nuclear Power Station

R.R. #1

Morris, Illinois 60450

Telephone 815/942-2920

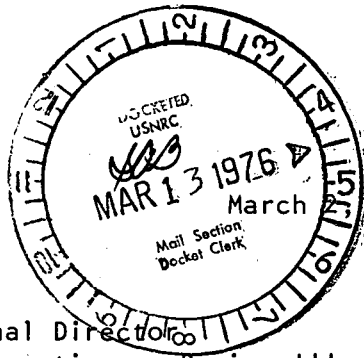


Regulatory

File Cy.

BBS Ltr. #195-76

Mr. James G. Keppler, Regional Director
Directorate of Regulatory Operations - Region III
U. S. Nuclear Regulatory Commission
799 Roosevelt Road
Glen Ellyn, Illinois 60137

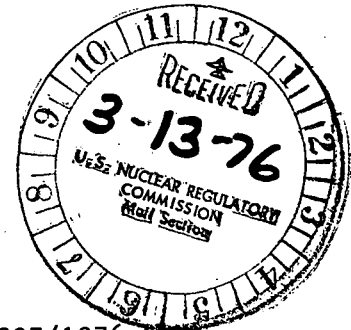

Enclosed please find Reportable Occurrence number 50-237/1976-5.
This report is being submitted to your office in accordance with the
Dresden Nuclear Power Station Technical Specifications, Section 6.6.B.

Arthur M Roberts
for
B. B. Stephenson
Station Superintendent
Dresden Station

BBS:smp

Enclosure

CC: Director of Inspection & Enforcement
Director of Management Information & Program Control
File/NRC



MAR

1976

2501

11

LICENSEE EVENT REPORT

CONTROL BLOCK:

(PLEASE PRINT ALL REQUIRED INFORMATION)

01	LICENSEE NAME ILDRS2	LICENSE NUMBER 00-000000-00	LICENSE TYPE 411111	EVENT TYPE 03		
7 8 9	14	15	25 26	30 31 32		
01	CATEGORY CONT	REPORT TYPE L	REPORT SOURCE L	DOCKET NUMBER 050-0237	EVENT DATE 021776	REPORT DATE 022776
7 8	57 58	59	60	61 68	69 74	75 80

EVENT DESCRIPTION

02	DURING THE MONTHLY SURVEILLANCE FOR ISOLATION CONDENSER CON-					
7 8 9	80					
03	DENSATE HIGH FLOW, DPIS 1349B WAS FOUND TO ACTUATE AT 33.0					
7 8 9	80					
04	INCHES DP INCREASING. TECHNICAL SPECIFICATIONS REQUIRE DP TO BE					
7 8 9	80					
05	LESS THAN OR EQUAL TO 32 INCHES. FOR THIS SWITCH. DPIS 1349A, THE					
7 8 9	80					
06	REDUNDANT SWITCH, WAS FOUND TO BE FULLY OPERABLE AND WITHIN LIMITS.					
7 8 9	80					

(CONT.)

07	SYSTEM CODE CE	CAUSE CODE E	COMPONENT CODE INSTRU	PRIME COMPONENT SUPPLIER W	COMPONENT MANUFACTURER B080	VIOLATION Y
7 8 9	10	11	12 17	43	44 47	48

CAUSE DESCRIPTION

08	THE EVENT WAS CAUSED BY INSTRUMENT SETPOINT DRIFT. DPIS 1349B					
7 8 9	80					
09	IS A BARTON MODEL 288-42364 PRESSURE SENSOR, WITH ACCURACY TO					
7 8 9	80					
10	PLUS OR MINUS .5% ON A RANGE OF 0-100 INCHES DP.					
7 8 9	80					

11	FACILITY STATUS E	% POWER 094	OTHER STATUS NA	METHOD OF DISCOVERY B	DISCOVERY DESCRIPTION NA
7 8 9	10	12 13	44	45	46 80

12	FORM OF ACTIVITY RELEASED 2	CONTENT OF RELEASE 2	AMOUNT OF ACTIVITY NA	LOCATION OF RELEASE NA
7 8 9	10	11	44	45 80

PERSONNEL EXPOSURES

13	NUMBER 000	TYPE 2	DESCRIPTION NA
7 8 9	11	12	13 80

PERSONNEL INJURIES

14	NUMBER 000	DESCRIPTION NA
7 8 9	11	12 80

OFFSITE CONSEQUENCES

15	NA			
7 8 9	80			

LOSS OR DAMAGE TO FACILITY

16	TYPE 2	DESCRIPTION NA
7 8 9	10	80

PUBLICITY

17	NA			
7 8 9	80			

ADDITIONAL FACTORS EVENT DESCRIPTION (CONT.)

18	THIS IS THE FIRST EVENT OF THIS TYPE ON UNIT-2, ALTHOUGH SIMILAR FAILURES HAVE OCCURRED						
7 8 9	80						

19	ON UNIT-3, THE SWITCH WAS RESET TO 29.5 INCHES DP INCREASING (050-237/76-5)						
7 8 9	80						

NAME: GERRY ROMBA

PHONE: EXT. 265

12