

LICENSEE EVENT REPORT

CONTROL BLOCK: L I I I I I I I I

PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION

011 | F | L | S | L | S | 1 | ③ | 0 | 0 | - | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | ③ | 4 | 1 | 1 | 1 | 1 | 1 | ④ | 1 | 1 | 5 |
7- 3 9 LICENSED CDS 14 15 . LICENSE NUMBER 25 26 LICENSE TYPE 30 31 32

CONT
011 REPEAT SOURCE T, ⑤ 0 15.1010 1013 1315 ⑦ 0 19 10 1318 10 ⑧ 111010 1218 10 ⑨
50 61 COCKET NUMBER 53 59 EVENT DATE 74 75 REPORT DATE 80

012 During normal full power operation the "A" diesel generator failed to pick up load during a surveillance test. The diesel was secured and then re-started at which time it loaded properly. During the subsequent load run, the 16 cylinder engine overheated due to a loss of coolant through a leaking expansion tank relief valve. The valve was replaced and the load run was completed satisfactorily. During the above events both the "B" diesel and offsite power were verified available per Tech. Spec. 3.8.1.1.

SYSTEM CAUSE CAUSE COMP. VALVE

CODE 019	CODE E	SUSC008 E1	COMPONENT CODE B	SUSC008 VALVEX	SUSC008 F	SUSC008 B
7	9	10	11	12	13	14
17	REPORT NUMBER 170	EVENT YEAR 810	SEQUENTIAL REPORT NO. 0515		OCCURRENCE CODE 03	REPORT TYPE L
31	32	33	24	25	26	27
ACTION TAKEN TAKEN ACTION	EFFECT ON PLANT CN PLANT	SHUTDOWN METHOD Z	HOURS 00100	ATTACHMENT SUBMITTED N	VPRO-4 FORM SUB. N	PRIME COMP. SUPPLIER X
Z18	Z19	Z20	Z21	N22	N23	X25
22	23	24	25	26	27	28
CHANGES DESCRIPTION AND CORRECTING ACTIONS						

The apparent cause for the Diesel Generator failure to fully load on the first start was operator unfamiliarity with D/G control system response.

The operator has since been upgraded in this area. The relief valve which began leaking was a texsteam 55RD:3/4" relief. It was replaced and the load run was completed. This is the first Diesel LER of this type.

FACILITY STATUS	IN PARTNER	OTHER STATUS	20	METHOD OF DISCOVERY	DISCOVERY DESCRIPTION	22
1 1 5 1	1 1 0 1 0 1	NA		B	Operator observation	
7 3 2	10 12 13	44	45 46		LOCATION OF RELEASE	36
ACTIVITY CONTENT	RELEASED OR RELEASE	AMOUNT OF ACTIVITY	15		NA	
1 1 5 1	1 2 33 2 23	NA	44	45		
7 3 5	10 11					
PERSONNEL EXPOSURES	NUMBER	TYPE	DESCRIPTION	33		
1 1 7	1 1 1 1 1 1	7 23	NA			
7 3 6	11 12					
PERSONNEL INJURIES	NUMBER	DESCRIPTION	41			
1 1 5	1 0 1 0 1 0	NA				
7 3 5	11 12					
LOSS OF OR DAMAGE TO FACILITY	DESCRIPTION	43				
1 1 5	1 2 23	D/C automatic start was not adversely affected.				

NAME: P. L. Pace PHONE: (305) 552-3801

સાહિત્ય = પરીક્ષાપત્ર - P.L. Pace

Call No.: (305) 552-3801