

# ACCELERATED DISTRIBUTION DEMONSTRATION SYSTEM

## REGULATORY INFORMATION DISTRIBUTION SYSTEM (RIDS)

ACCESSION NBR: 8902070153      DOC. DATE: 89/02/01      NOTARIZED: NO      DOCKET #  
 FACIL: 50-315 Donald C. Cook Nuclear Power Plant, Unit 1, Indiana & 05000315  
 AUTH. NAME                      AUTHOR AFFILIATION  
 BAKER, K.R.                      Indiana Michigan Power Co. (formerly Indiana & Michigan Ele  
 SMITH, W.G.                      Indiana Michigan Power Co. (formerly Indiana & Michigan Ele  
 RECIP. NAME                      RECIPIENT AFFILIATION

SUBJECT: LER 88-008-01: on 880907, hydrogen skimming dampers  
mispositioned for unknown reasons.

DISTRIBUTION CODE: IE22D      COPIES RECEIVED: LTR 1 ENCL 1 SIZE: 4  
 TITLE: 50.73 Licensee Event Report (LER), Incident Rpt, etc.

NOTES:

	RECIPIENT ID CODE/NAME	COPIES LTR ENCL	RECIPIENT ID CODE/NAME	COPIES LTR ENCL	
	PD3-1 LA	1 1	PD3-1 PD	1 1	
	STANG, J	1 1			
INTERNAL:	ACRS MICHELSON	1 1	ACRS MOELLER	2 2	
	ACRS WYLIE	1 1	AEOD/DOA	1 1	
	AEOD/DSP/TPAB	1 1	AEOD/ROAB/DSP	2 2	
	ARM/DCTS/DAB	1 1	DEDRO	1 1	
	NRR/DEST/ADE 8H	1 1	NRR/DEST/ADS 7E	1 0	
	NRR/DEST/CEB 8H	1 1	NRR/DEST/ESB 8D	1 1	
	NRR/DEST/ICSB 7	1 1	NRR/DEST/MEB 9H	1 1	
	NRR/DEST/MTB 9H	1 1	NRR/DEST/PSB 8D	1 1	
	NRR/DEST/RSB 8E	1 1	NRR/DEST/SGB 8D	1 1	
	NRR/DLPQ/HFB 10	1 1	NRR/DLPQ/QAB 10	1 1	
	NRR/DOEA/EAB 11	1 1	NRR/DREP/RAB 10	1 1	
	NRR/DREP/RPB 10	2 2	NRR/DRIS/SIB 9A	1 1	
	NUDOCS-ABSTRACT	1 1	<del>REG-FILE</del> 02	1 1	
	RES/DSIR/EIB	1 1	RES/DSR/PRAB	1 1	
	RGN3 FILE 01	1 1			
EXTERNAL:	EG&G WILLIAMS, S	4 4	FORD BLDG HOY, A	1 1	
	H ST LOBBY WARD	1 1	LPDR	1 1	
	NRC PDR	1 1	NSIC HARRIS, J	1 1	
	NSIC MAYS, G	1 1			

NOTE TO ALL "RIDS" RECIPIENTS:

PLEASE HELP US TO REDUCE WASTE!      CONTACT THE DOCUMENT CONTROL DESK,  
 ROOM P1-37 (EXT. 20079) TO ELIMINATE YOUR NAME FROM DISTRIBUTION  
 LISTS FOR DOCUMENTS YOU DON'T NEED!

TOTAL NUMBER OF COPIES REQUIRED: LTR 45 ENCL 44

LICENSEE EVENT REPORT (LER)

FACILITY NAME (1) <b>D. C. Cook Nuclear Plant - Unit One</b>	DOCKET NUMBER (2) <b>0 5 0 0 0 3 1 5 1</b>	PAGE (3) <b>1 OF 0 3</b>
---	---	-----------------------------

TITLE (4) **Hydrogen Skimming Dampers Mispositioned for Unknown Reasons Presenting the Potential for Restricting the Systems Ability to Mitigate the Consequences of an Accident**

EVENT DATE (5)			LER NUMBER (6)			REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)	
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAMES	DOCKET NUMBER(S)
0 9	0 7	8 8	8 8	0 0 8	0 1	0 2	0 1	8 9		0 5 0 0 0

OPERATING MODE (9) <b>3</b>	THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR §: (Check one or more of the following) (11)				
POWER LEVEL (10) <b>0 1 0 0</b>	20.402(b)	20.405(c)	50.73(a)(2)(iv)	73.71(b)	OTHER (Specify in Abstract below and in Text, NRC Form 366A)
	20.405(a)(1)(i)	50.36(c)(1)	X 50.73(a)(2)(v)	73.71(c)	
	20.405(a)(1)(ii)	50.36(c)(2)	50.73(a)(2)(vii)		
	20.405(a)(1)(iii)	50.73(a)(2)(i)	50.73(a)(2)(viii)(A)		
	20.405(a)(1)(iv)	50.73(a)(2)(ii)	50.73(a)(2)(viii)(B)		
	20.405(a)(1)(v)	50.73(a)(2)(iii)	50.73(a)(2)(x)		

LICENSEE CONTACT FOR THIS LER (12)		TELEPHONE NUMBER	
NAME	AREA CODE		
<b>K. R. Baker, Operations Superintendent</b>	<b>6 1 1 6</b>	<b>4 1 6 1 5 1</b>	<b>- 5 1 9 1 0 1 1</b>

COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)										
CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPRDS	CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPRDS	

SUPPLEMENTAL REPORT EXPECTED (14)		EXPECTED SUBMISSION DATE (15)	MONTH	DAY	YEAR
<input type="checkbox"/> YES (If yes, complete EXPECTED SUBMISSION DATE)	<input checked="" type="checkbox"/> NO				

ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single-space typewritten lines) (16)

This revision is being submitted to update cause/preventive action of original LER.

Four containment air recirculation (CEQ) fan hydrogen skimming dampers (EIIS/BB-dmp) were found to be mispositioned such that flow would have been less than required. Analysis has shown that at no time was the flow reduced to a point where hydrogen buildup would exceed the 4 percent limit specified in Regulatory Guide 1.7. This condition did not constitute a significant safety problem nor inoperability of the system. The condition did create a potential for inoperability, therefore the event is considered reportable under the provisions of 10 CFR 50.73.

On September 7, 1988, at approximately 1130 hours, with Unit One in Mode 3 (hot standby) and cooling down, it was identified that three hydrogen skimming dampers were mispositioned. At 2300 hours September 7, 1988, while conducting a damper lineup and verification a fourth damper was identified as mispositioned. All four dampers were found to be one or two notches (on a 10 notch position plate) more closed than required. The previous lineup verification of this system had been conducted August 27, 1987, and showed all dampers correctly positioned.

All dampers were returned to their correct position and verified. Administrative controls have been implemented to prevent recurrence of this event. This event was caused by personnel error compounded by equipment design and location.

DE? 2  
1/1

8902070153 890201  
PDR ADDCK 05000315  
S PDC

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME (1)  D. C. Cook Nuclear Plant - Unit One	DOCKET NUMBER (2)  0 5   0   0   0   3   1   5	LER NUMBER (8)			PAGE (3)		
		YEAR 8   8	SEQUENTIAL NUMBER -   0   0   8	REVISION NUMBER -   0   1			
0 2 OF 0 3							

TEXT (If more space is required, use additional NRC Form 366A's) (17)

This revision is being submitted to update cause/preventive action of original LER.

Conditions Prior to Occurrence

Unit One was in Mode 3 (hot standby) with cooldown in progress toward Mode 4 (hot shutdown).

Description of Event

At approximately 1130 hours, September 7, 1988, while conducting a cooldown of Unit One three containment air recirculation (CEQ) fan hydrogen skimming dampers (EIIS/BB-dmp) were found to be mispositioned. Upon discovery plant personnel began a damper lineup and verification of the CEQ System. At 2300 hours a fourth damper (EIIS/BB-dmp) was identified as being out of position during this lineup verification. The last previous lineup verification had been conducted August 27, 1987, and showed that all dampers were correctly positioned.

All four dampers were found in a position one or two notches more closed than required by the damper lineup sheet. The required damper positions were established based on flow rate tests conducted in 1985 to ensure adequate flow to prevent excessive hydrogen buildup in containment subcompartments following a loss of coolant accident. The two dampers, in the line from the containment dome to the suction of the CEQ fans were in notch five rather than notch four (10 notches from full open to full closed). The other two dampers, which were in the lines from the #2 steam generator enclosure and the west containment ventilation fan room, were in notch nine rather than notch seven. This resulted in less flow from the affected areas than assumed during an accident and may have resulted in a higher than predicted hydrogen buildup in those areas.

There were no systems or components inoperable at the beginning of this event which contributed to the event.

No manual or automatic actuations of the safety systems occurred.

Cause of Event

The cause of this event was personnel error in that the involved non-licensed personnel did not properly verify the position of these dampers when conducting the lineup on August 27, 1987. This error was induced by the ambiguous position indicator on the dampers and their difficult location. In addition the procedure did not contain provisions for independent verification.

LI...JSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME (1)  D. C. Cook Nuclear Plant - Unit One	DOCKET NUMBER (2)  0   5   0   0   0   3   1   5	LER NUMBER (6)			PAGE (3)		
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER			
		8   8	-   0   0   8	-   0   1	0   3	OF	0   3

TEXT (If more space is required, use additional NRC Form 366A's) (17)

Analysis of Event

A sensitivity analysis was conducted using skimmer flow rates corrected for this "as found" damper positions. This analysis showed that the hydrogen concentrations remained at or below the 4 percent limit for each affected area. Since the concentration did not exceed the limit specified in Regulatory Guide 1.7 this condition did not constitute a significant safety problem nor inoperability of the system. However, since the condition created a potential for inoperability of the Hydrogen Skimmer System, the event is considered reportable under the provisions of 10 CFR 50.73.

Corrective Action

The dampers were repositioned to their correct position and verified. The CEQ System lineup procedures for both Unit One and Unit Two have been rewritten to include independent verification of each valve/damper position. Additionally, a valve lineup of the CEQ System valves/dampers including an independent verification has been added to the containment closeout inspection procedures. This will provide position verification each time the containments are closed following entry where integrity is broken.

Plant personnel have developed a device to fix the dampers in position and also indicate if the damper has been moved since the previous position check. This device will be installed in Unit Two prior to proceeding to Mode 4. The device will be installed in Unit One while conducting the CEQ System lineup following refueling.

Failed Component Identification

There were no failed components.

Previous Similar Events

None

Indiana Michigan  
Power Company  
Cook Nuclear Plant  
P.O. Box 458  
Bridgman, MI 49106  
616 465 5901



January 27, 1989

United States Nuclear Regulatory Commission  
Document Control Desk  
Washington, D.C. 20555

 
Operating License DPR-58  
Docket No. 50-315

Document Control Manager:

In accordance with the criteria established by 10 CFR 50.73  
entitled Licensee Event Reporting System, the following  
report is being submitted:

88-008-01

Sincerely,

  
W. G. Smith, Jr.  
Plant Manager

WGS:clw

Attachment

cc: D. H. Williams, Jr.  
A. B. Davis, Region III  
M. P. Alexich  
P. A. Barrett  
J. E. Borggren  
R. F. Kroeger  
NRC Resident Inspector  
Wayne Scott, NRC  
R. C. Callen  
G. Charnoff, Esq.  
Dottie Sherman, ANI Library  
D. Hahn  
INPO  
PNSRC  
A. A. Blind  
S. J. Brewer/B. P. Lauzau

JE22  
11