

LICENSEE EVENT REPORT

CONTROL BLOCK: (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

LICENSEE CODE: MIDCC1; LICENSE NUMBER: 00000000000000000000; LICENSE TYPE: 411111; CAT 58: 4

REPORT SOURCE: L; DOCKET NUMBER: 05000315; EVENT DATE: 111179; REPORT DATE: 121179

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES: DURING THE START UP OF UNIT 1, NUMBER 4 STEAM GENERATOR STEAM FLOW CHANNEL I WAS FOUND TO BE INDICATING APPROXIMATELY 21 PER CENT LOWER THAN THE REDUNDANT CHANNEL. THIS CONDITION WAS NON CONSERVATIVE WITH RESPECT TO T.S. TABLE 3.3-1 ITEM 15 AND TABLE 3.3-3 ITEMS 1f AND 4d.

SYSTEM CODE: IA; CAUSE CODE: E; CAUSE SUBCODE: E; COMPONENT CODE: INSTRU; COMP. SUBCODE: T; VALVE SUBCODE: Z; LER/RO REPORT NUMBER: 79; EVENT YEAR: 79; SEQUENTIAL REPORT NO.: 061; OCCURRENCE CODE: 03; REPORT TYPE: L; REVISION NO.: 0; ACTION TAKEN: C; FUTURE ACTION: D; EFFECT ON PLANT: Z; SHUTDOWN METHOD: Z; HOURS: 0000; ATTACHMENT SUBMITTED: N; NPRD-4 FORM SUB.: Y; PRIME COMP. SUPPLIER: A; COMPONENT MANUFACTURER: B080

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS: UPON INSPECTION OF THE TRANSMITTER (MFC 140) IT WAS FOUND THAT OIL HAD APPARENTLY LEAKED FROM THE BELLOWS, INSIDE THE TRANSMITTER BODY, CAUSING IT TO DRIFT OUT OF SPECIFICATION. THE TRANSMITTER WAS REPLACED AND WAS SENT TO ITT BARTON FOR REPAIR AND EVALUATION OF THIS PROBLEM. THE ACTION ITEM REQUIREMENTS FOR T.S. TABLES 3.3-1 AND 3.3-3 WERE FULFILLED.

FACILITY STATUS: C; % POWER: 026; OTHER STATUS: NA; METHOD OF DISCOVERY: A; DISCOVERY DESCRIPTION: OPERATOR OBSERVATION

ACTIVITY CONTENT RELEASED OF RELEASE: Z; AMOUNT OF ACTIVITY: NA; LOCATION OF RELEASE: NA

PERSONNEL EXPOSURES NUMBER: 000; TYPE: Z; DESCRIPTION: NA

PERSONNEL INJURIES NUMBER: 000; DESCRIPTION: NA

LOSS OF OR DAMAGE TO FACILITY TYPE: Z; DESCRIPTION: NA

PUBLICITY ISSUED DESCRIPTION: N

NAME OF PREPARER: S. D. DeLong

PHONE: 616-465-5901

7912/70252