

ENCLOSURE 1

NOTICE OF VIOLATION

Florida Power and Light Company  
Turkey Point, Units 3 and 4

Docket Nos. 50-250, 50-251  
License Nos. DPR-31, DPR-41

During an NRC inspection conducted on July 24 through August 20, 1993, a violation of NRC requirements was identified. In accordance with the "General Statement of Policy and Procedure for NRC Enforcement Actions," 10 CFR Part 2, Appendix C, the violation is listed below:

Technical Specification 6.8.1 requires that written procedures be established, implemented, and maintained covering the activities recommended in Appendix A of Regulatory Guide 1.33, Revision 2, February 1978.

Item 1.d of Regulatory Guide 1.33, Revision 2, February, 1978, Appendix A, recommends the use of administrative procedures for procedure adherence, and item 3.k of this Appendix recommends the use of procedures for activities involving the energizing, filling, venting, draining, startup, shutdown, and changing modes of operation of the feedwater system (feedwater pumps to steam generator).

Section 5.1 of Administrative Procedure O-ADM-201, Operations Procedure Usage, requires operating procedures to be performed in a step by step manner with each step being completed prior to the performance of the next step unless exception is allowed by the procedure.

Sections 7.8 and 7.9 of Operating Procedure 4-OP-081.1, Feedwater Heaters, Extraction Steam, Vents, and Drains Valve Alignment, require that the 6A and 6B feedwater heater tube side outlet valves, 4-30-123 and 4-30-223, respectively, be opened prior to positioning the 6A and 6B feedwater tube side normal/bypass valves, 4-20-121 and 4-20-221, respectively, to the normal position.

Contrary to the above, on August 16, 1993, 6A and 6B feedwater heater tube side normal/bypass valves 4-20-121 and 4-20-221 (located between the feedwater pumps and the steam generator) were taken to the normal position without having 6A and 6B feedwater heater tube side outlet valves 4-30-123 and 4-30-223 fully open. This caused a perturbation in the feedwater system which eventually resulted in a reactor trip.

This is a Severity Level IV violation (Supplement 1).

Pursuant to the provisions of 10 CFR 2.201, Florida Power and Light Company is hereby required to submit a written statement or explanation to the U.S.

Florida Power and Light Company  
Turkey Point, Units 3 and 4

2

Docket Nos. 50-250, 50-251  
License Nos. DPR-31, DPR-41

Nuclear Regulatory Commission, ATTN: Document Control Desk, Washington, D.C. 20555, with a copy to the Regional Administrator, Region II, and a copy to the NRC Resident Inspector at the facility that is the subject of this notice, within 30 days of the date of the letter transmitting this Notice of Violation (Notice). This reply should be clearly marked as a "Reply to a Notice of Violation" and should include for each violation: (1) the reason for the violation, or, if contested, the basis for disputing the violation, (2) the corrective steps that have been taken and the results achieved, (3) the corrective steps that will be taken to avoid further violations, and (4) the date when full compliance will be achieved. If an adequate reply is not received within the time specified in this Notice, an order or demand for information may be issued as to why the license should not be modified, suspended, or revoked, or why such other action as may be proper should not be taken. Where good cause is shown, consideration will be given to extending the response time.

Dated at Atlanta, Georgia  
this *17th* day of September 1993

