

ACCELERATED DISTRIBUTION DEMONSTRATION SYSTEM
 REGULATORY INFORMATION DISTRIBUTION SYSTEM (RIDS)

ACCESSION NBR: 8903220424 DOC. DATE: 89/03/14 NOTARIZED: NO DOCKET #
 FACIL: 50-412 Beaver Valley Power Station, Unit 2, Duquesne Light C 05000412
 AUTH. NAME AUTHOR AFFILIATION
 NOONAN, T.P. Duquesne Light Co.
 RECIP. NAME RECIPIENT AFFILIATION

SUBJECT: LER 89-003-00: on 890212, reactor tripped due to main
 feedwater regulating valve failure. W/890314 ltr.
W/8 ltr.

DISTRIBUTION CODE: IE22D COPIES RECEIVED: LTR 1 ENCL 1 SIZE: 6
 TITLE: 50.73 Licensee Event Report (LER), Incident Rpt, etc.

NOTES: LPDR 2cys Transcripts. LPDR 2cys PDR Documents. 05000412
 Application for permit renewal filed.

	RECIPIENT	COPIES	RECIPIENT	COPIES
	ID CODE/NAME	LTR ENCL	ID CODE/NAME	LTR ENCL
	PD1-4 LA	1 1	PD1-4 PD	1 1
	TAM, P	1 1		
INTERNAL:	ACRS MICHELSON	1 1	ACRS MOELLER	2 2
	ACRS WYLIE	1 1	AEOD/DOA	1 1
	AEOD/DSP/TPAB	1 1	AEOD/ROAB/DSP	2 2
	ARM/DCTS/DAB	1 1	DEDRO	1 1
	NRR/DEST/ADE 8H	1 1	NRR/DEST/ADS 7E	1 0
	NRR/DEST/CEB 8H	1 1	NRR/DEST/ESB 8D	1 1
	NRR/DEST/ICSB 7	1 1	NRR/DEST/MEB 9H	1 1
	NRR/DEST/MTB 9H	1 1	NRR/DEST/PSB 8D	1 1
	NRR/DEST/RSB 8E	1 1	NRR/DEST/SGB 8D	1 1
	NRR/DLPQ/HFB 10	1 1	NRR/DLPQ/QAB 10	1 1
	NRR/DOEA/EAB 11	1 1	NRR/DREP/RAB 10	1 1
	NRR/DREP/RPB 10	2 2	NRR/DRIS/SIB 9A	1 1
	NUDOCS-ABSTRACT	1 1	<u>REG FILE</u> 02	1 1
	RES/DSIR/EIB	1 1	RES/DSR/PRAB	1 1
	RGN1 FILE 01	1 1		
EXTERNAL:	EG&G WILLIAMS, S	4 4	FORD BLDG HOY, A	1 1
	H ST LOBBY WARD	1 1	LPDR	1 1
	NRC PDR	1 1	NSIC MAYS, G	1 1
	NSIC MURPHY, G.A	1 1		
NOTES:		2 2		

NOTE TO ALL "RIDS" RECIPIENTS:

PLEASE HELP US TO REDUCE WASTE! CONTACT THE DOCUMENT CONTROL DESK,
 ROOM P1-37 (EXT. 20079) TO ELIMINATE YOUR NAME FROM DISTRIBUTION
 LISTS FOR DOCUMENTS YOU DON'T NEED!

TOTAL NUMBER OF COPIES REQUIRED: LTR 47 ENCL 46

Handwritten: 1/04/89



LICENSEE EVENT REPORT (LER)

FACILITY NAME (1) Beaver Valley Power Station, Unit 2	DOCKET NUMBER (2) 0 5 0 0 0 4 1 1 2	PAGE (3) 1 OF 0 4
---	---	-----------------------------

TITLE (4)
Reactor Trip Due to Main Feedwater Regulating Valve Failure

EVENT DATE (5)			LER NUMBER (6)			REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)		
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAMES		
									N/A		
0	2	12	8	9	—	0	0	3	N/A		
									DOCKET NUMBER(S)		
									0 5 0 0 0		

OPERATING MODE (9) 1	THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR §: (Check one or more of the following) (11)											
POWER LEVEL (10) 0, 5, 5	20.402(b)			20.405(c)			<input checked="" type="checkbox"/> 50.73(a)(2)(iv)			73.71(b)		
	20.405(a)(1)(i)			50.38(c)(1)			<input type="checkbox"/> 50.73(a)(2)(v)			73.71(c)		
	20.405(a)(1)(ii)			50.38(c)(2)			<input type="checkbox"/> 50.73(a)(2)(vii)			OTHER (Specify in Abstract below and in Text, NRC Form 366A)		
	20.405(a)(1)(iii)			50.73(a)(2)(i)			<input type="checkbox"/> 50.73(a)(2)(viii)(A)					
	20.405(a)(1)(iv)			50.73(a)(2)(ii)			<input type="checkbox"/> 50.73(a)(2)(viii)(B)					
20.405(a)(1)(v)			50.73(a)(2)(iii)			<input type="checkbox"/> 50.73(a)(2)(ix)						

LICENSEE CONTACT FOR THIS LER (12)									
NAME Mr. Thomas P. Noonan, Plant Manager							TELEPHONE NUMBER		
							AREA CODE		
							4 1 2 6 4 3 - 1 2 5 8		

COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)										
CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPRDS		CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPRDS
X	J, B	F, C, V	C, 6, 3, 5	Y						

SUPPLEMENTAL REPORT EXPECTED (14)				EXPECTED SUBMISSION DATE (15)	MONTH	DAY	YEAR
<input type="checkbox"/> YES (If yes, complete EXPECTED SUBMISSION DATE)							

ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single-space typewritten lines) (16)

On 2/12/89, with the Unit in Power Operation, a power reduction from 90% reactor power to 50% reactor power was in progress as part of End of Core Life programs. At 0048 hours, operators noticed erratic operation of the "C" Main Feedwater Regulating Valve (MFRV). The operators placed the "C" MFRV in manual to control steam generator level. At 0108 hours at approximately 55% reactor power, the "A" Main Feedwater Pump was shutdown to reduce the pressure differential across the valve allowing easier valve movement and control. At 0120 hours, a turbine trip/reactor trip occurred due to a high water level in the "C" steam generator. The operators stabilized the plant in Hot Shutdown utilizing the Emergency Operating Procedures. The "C" MFRV was found to have sheared anti-rotation pins and the stem detached from the valve plug. The cause for the valve failure was attributed to hydraulic forces and vibration acting over time. The MFRVs were all disassembled, inspected and repaired as necessary. This event was reported to the Nuclear Regulatory Commission at 0300 hours, in accordance with 10CFR50.72.b.2.ii. There were no safety implications to the public as a result of this event. This type of event has previously been analyzed as stated in the Updated Final Safety Analysis Report, Section 15.1.2, "Feedwater System Malfunctions Causing an Increase In Feedwater Flow".

8903220424 890314
PDR ADOCK 05000412
S PNU

222
11



LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME (1) Beaver Valley Power Station, Unit 2	DOCKET NUMBER (2) 0 5 0 0 0 4 1 2	LER NUMBER (6)			PAGE (3)	
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER		
		8 9	- 0 0 3	- 0 0	0 2	OF 0 4

 
TEXT (If more space is required, use additional NRC Form 366A's) (17)

DESCRIPTION

On 2/12/89, with the Unit in Power Operation (Operating Mode 1), Operations personnel were reducing reactor power from 90% to 50% as part of End of Core Life programs. Prior to the Operating crew assuming the shift at 2300 hours on 2/11/89, the "B" Main Feedwater Regulating Valve (MFRV) had previously exhibited erratic valve control for steam generator water level. The "B" MFRV was in the automatic mode, however, the valve was not controlling smoothly. At 0048 hours, operators noticed erratic operation of the "C" MFRV. At 0108 hours, at approximately 55% power, the "A" Main Feedwater Pump was shutdown. At 0120 hours, the water level in the "C" steam generator increased to the high-high level setpoint (75%) causing a turbine trip and feedwater isolation signal. The turbine trip caused a reactor trip, since reactor power was above the trip permissive of 49%. The feedwater isolation signal caused the following actions to occur: 1) trip of the running main feedwater pump, 2) auto-start of the auxiliary feedwater pumps, and 3) closure of the main feedwater regulating valves and bypass valves. Following the reactor trip, the operators utilized the Emergency Operating Procedures (E-0 "Reactor Trip or Safety Injection" and ES-0.1 "Reactor Trip Response") to stabilize the plant in Hot Standby (Operating Mode 3).

APPARENT CAUSE OF THE EVENT

The cause for this event was attributed to the failure of the "C" Main Feedwater Regulating Valve (2FWS*FCV498). This valve is a Copes-Vulcan, Model No. D-100-160, Part No. 16-FA37RG. The valve failure was attributed to the hydraulic forces and vibration, which over time, mechanically excite the valve, damaging the anti-rotation cage slots, plug guides, retaining pins and valve stem. The "B" Main Feedwater Regulating Valve was found to have damaged anti-rotation pins.



FACILITY NAME (1) Beaver Valley Power Station, Unit 2	DOCKET NUMBER (2) 0 5 0 0 0 4 1 2	LER NUMBER (6)			PAGE (3)	
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER		
		8 9	0 0 3	0 0	0 3	OF 0 4

TEXT (If more space is required, use additional NRC Form 366A's) (17)

CORRECTIVE ACTIONS

The following corrective actions were taken as a result of this event:

Immediate:

- 1). Operations personnel utilized the Emergency Operating Procedures to stabilize the plant in Hot Standby.
- 2). The main feedwater regulating valves were disassembled and inspected. The anti-rotation pins were replaced on all main feedwater regulating valves.

 
Long-term:

- 1). An Engineering Memorandum has been generated requesting Engineering to identify an actuator and valve design which will eliminate the main feedwater regulating valve problems due to the hydraulic forces and vibration which over time, progressively damage the valves.
- 2). All three steam generators will be inspected during the First Refueling Outage for potential loose objects.

SAFETY IMPLICATIONS

There were no safety implications to the public as a result of this event. This type of event has previously been analyzed as stated in the Updated Final Safety Analysis Report (UFSAR), Section 15.1.2, "Feedwater System Malfunctions Causing an Increase in Feedwater Flow". Additionally, all the required Engineered Safety Features (ESF) system components actuated as follows as a result of the steam generator high-high water level condition:

- 1). Turbine trip, causing a reactor trip because reactor power was greater than the P-9 trip permissive,
- 2). Feedwater Isolation (FWI) signal, causing the following:
 - A). Trip of the running main feedwater pump,
 - B). Automatic start of the auxiliary feedwater pumps (2FWE*P22, 23A and 23B),
 - C). Closure of the main feedwater regulating valves and bypass valves.



LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME (1) Beaver Valley Power Station, Unit 2	DOCKET NUMBER (2) 0 5 0 0 0 4 1 2	LER NUMBER (6)			PAGE (3)	
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER		
		8 9	— 0 0 3	— 0 0	0 4	OF 0 4

TEXT (If more space is required, use additional NRC Form 366A's) (17)

In addition, the Nuclear Steam System Supplier (NSSS) has evaluated the utility's engineering interpretation of the Steam Generator Parametric Loose Object Licensing Report (WCAP-12101), which addressed the safety significance of the potential loose part (anti-rotation pin from 2FWS*FCV498) which could be trapped in the "C" steam generator tubesheet annulus. It was concluded that the estimated time required for the loose object to wear into a tube to the minimum allowable wall thickness, is 2.4 years. The NSSS concurred with this safety evaluation justifying continued operation of the remaining operating cycle.

REPORTABILITY

This event was reported to the Nuclear Regulatory Commission at 0300 hours in accordance with 10CFR50.72.b.2.ii. This written report is being provided in accordance with 10CFR50.73.a.2.iv, as an event involving a reactor protection system (RPS) or engineered safety features (ESF) system actuation.

PREVIOUS OCCURRENCES

There have been no previous Licensee Event Reports issued on this type of event/equipment failure at Beaver Valley Power Station Unit 2.





Nuclear Group
P.O. Box 4
Shippingport, PA 15077-0004

Telephone (412) 393-6000

March 14, 1989
ND3SPM:0422

Beaver Valley Power Station, Unit No. 2
Docket No. 50-412, License No. NPF-73
LER 89-003-00

United States Nuclear Regulatory Commission
Document Control Desk
Washington, DC 20555

Gentlemen:

In accordance with Appendix A, Beaver Valley Technical Specifications, the following Licensee Event Report is submitted:

LER 89-003-00, 10 CFR 50.73 a.2.iv, "Reactor Trip Due to Main Feedwater Regulating Valve Failure".

Very truly yours,

T. P. Noonan
Plant Manager

vhy

Attachment

IE22
||



March 14, 1989
ND3SPM:0422
Page two

cc: Mr. William T. Russell
Regional Administrator
United States Nuclear Regulatory Commission
Region 1
475 Allendale Rd.
King of Prussia, PA 19406

C. A. Roteck, Ohio Edison

Mr. Peter Tam, BVPS Licensing Project Manager
United States Nuclear Regulatory Commission
Washington, DC 20555
J. Beall, Nuclear Regulatory Commission,
BVPS Senior Resident Inspector

Mr. Alex Timme, CAPCO Nuclear Projects Coordinator
Toledo Edison

INPO Records Center
Suite 1500
1100 Circle 75 Parkway
Atlanta, GA 30339

G. E. Muckle, Factory Mutual Engineering, Pittsburgh

Mr. J. N. Steinmetz, Operating Plant Projects Manager
Mid Atlantic Area
Westinghouse Electric Corporation
Energy Systems Service Division
Box 355
Pittsburgh, PA 15230

American Nuclear Insurers
c/o Dottie Sherman, ANI Library
The Exchange Suite 245
270 Farmington Avenue
Farmington, CT 06032

Mr. Richard Janati
Department of Environmental Resources
P. O. Box 2063
16th Floor, Fulton Building
Harrisburg, PA 17120

Director, Safety Evaluation & Control
Virginia Electric & Power Co.
P.O. Box 26666
One James River Plaza
Richmond, VA 23261



1
2
3
4