



Consumers
Power
Company

General Offices: 212 West Michigan Avenue, Jackson, Michigan 49201 • (517) 788-0550

September 26, 1980

Mr James G Keppler
Office of Inspection and Enforcement
Region III
U S Nuclear Regulatory Commission
799 Roosevelt Road
Glen Ellyn, IL 60137

DOCKET 50-255 - LICENSE DPR-20 - PALISADES
PLANT - LICENSEE EVENT REPORT 80-034 -
INADEQUATE SURVEILLANCE PROCEDURE

On the reverse side is Licensee Event Report 80-034 which is reportable under
Technical Specification 6.9.2.B(3).

David P Hoffman
Nuclear Licensing Administrator

CC Director, Office of Nuclear Reactor Regulation
Director, Office of Inspection and Enforcement
NRC Resident Inspector, Palisades Plant

A002
S
1/1

8009300492

5

SEP 29 1980

LICENSEE EVENT REPORT

CONTROL BLOCK: (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

01 MITPAL 00-000000000000 411111

01 REPORT SOURCE L 05000255 082680 09 092680

02 With the plant in hot shutdown, preparations were being made to conduct
03 check valve ISI surveillance per procedure 00-8. During pre-test review
04 of the procedure it was determined that one portion of the procedure
05 required closing and reopening the SIRW tank outlet valves. (One at a time)
06 Performance of the procedure would have resulted in ESF equipment being
07 made inoperable (redundant equipment would not have been simultaneously
08 affected by the test). Reportable per TS 6.9.2.B3.

09 SF D Z Z Z Z Z Z Z Z Z Z Z Z Z Z
17 8 1 034 03 L 0
18 19 Z 20 Z 21 000000 N 23 N 24 Z 25 Z 1999

10 Procedure did not adequately address plant conditions required for per-
11 formance of test. Procedure has been revised to require plant to be in
12 cold shutdown prior to performing the portion necessitating stroking
13 SIRW tank outlet valves. The portion of the test in question will be
14 incorporated into a separate procedure having proper initial conditions.

15 G 000 Hot Shutdown A Review of procedure prior to use

16 Z Z NA NA

17 000 Z NA

18 000 NA

19 Z NA

20 N NA