

NRC DISTRIBUTION FOR PART 50 DOCKET MATERIAL

FILE NUMBER
INCIDENT REPORT

TO:
MR. JAMES P. O'REILLY

FROM:
ROCHESTER GAS & ELECTRIC CORP.
ROCHESTER, NEW YORK
L. D. WHITE, JR.

DATE OF DOCUMENT
5/11/76

DATE RECEIVED
5/14/76

LETTER
 ORIGINAL
 COPY

NOTORIZED
 UNCLASSIFIED

PROP

INPUT FORM

NUMBER OF COPIES RECEIVED
ONE SIGNED

DESCRIPTION

LTR. TRANS THE FOLLOWING:

PLANT NAME:
GINNA #1

ENCLOSURE

LICENSEE EVENT RPT. (RO-50-244/76-13) ON 4/16/76
CONCERNING TURBINE RUNBACK OCCURING DURING
POWER ESCALATION: B. BANK GROUP 2 RCC'S G5
& G9 DROPPED.

ACKNOWLEDGED

DO NOT REMOVE

NOTE: IF PERSONNEL EXPOSURE IS INVOLVED
SEND DIRECTLY TO KREGER/J. COLLINS

| SAFETY | FOR ACTION/INFORMATION | ENVIRO | 5/17/76 | RJL |
|---|------------------------|--------|---------|-----|
| <input checked="" type="checkbox"/> BRANCH CHIEF: | PURPLE | | | |
| <input type="checkbox"/> W/3 CYS FOR ACTION | | | | |
| <input checked="" type="checkbox"/> LIC. ASST: | SHEPPARD | | | |
| <input type="checkbox"/> W/1 CYS | | | | |
| <input type="checkbox"/> ACRS 16 CYS HOLDING/SENT TO LA | | | | |

| INTERNAL DISTRIBUTION | | | | |
|---|--|--|--|--|
| <input checked="" type="checkbox"/> REG FILE | | | | |
| <input checked="" type="checkbox"/> NRC PDR | | | | |
| <input checked="" type="checkbox"/> I & E (2) | | | | |
| <input checked="" type="checkbox"/> MPC (3) | | | | |
| <input checked="" type="checkbox"/> SCHROEDER/IPPOLITO | | | | |
| <input checked="" type="checkbox"/> HOUSTON | | | | |
| <input checked="" type="checkbox"/> NOVAK/CHECK | | | | |
| <input checked="" type="checkbox"/> GRIMES/SCHWENCER (1) EA | | | | |
| <input checked="" type="checkbox"/> CASE | | | | |
| <input checked="" type="checkbox"/> WILLIAMS | | | | |
| <input checked="" type="checkbox"/> HANAUER | | | | |
| <input checked="" type="checkbox"/> TEDESCO/MACCARY | | | | |
| <input checked="" type="checkbox"/> EISENHUT | | | | |
| <input checked="" type="checkbox"/> BAER | | | | |
| <input checked="" type="checkbox"/> SHAO | | | | |
| <input checked="" type="checkbox"/> VOLLMER/BUNCH | | | | |
| <input checked="" type="checkbox"/> KREGER/J. COLLINS | | | | |

| EXTERNAL DISTRIBUTION | CONTROL NUMBER |
|--|----------------|
| <input checked="" type="checkbox"/> LPDR: LYONS, N. Y! | 4910 |
| <input checked="" type="checkbox"/> TIC | |
| <input checked="" type="checkbox"/> NSIC | |

SECRET
SECRET

CONFIDENTIAL

CONFIDENTIAL

CONFIDENTIAL

CONFIDENTIAL

 
SECRET

SECRET




ROCHESTER GAS AND ELECTRIC CORPORATION • 89 EAST AVENUE, ROCHESTER, N.Y. 14649

LEON D. WHITE, JR.
VICE PRESIDENT



May 11, 1976

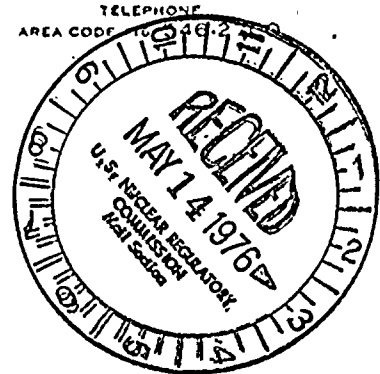

Mr. James P. O'Reilly, Director
U. S. Nuclear Regulatory Commission
Office of Inspection and Enforcement
Region I
631 Park Avenue
King of Prussia, Pennsylvania 19406

Subject: Reportable Occurrence 76-13 (30-day report), Drop of two control rods
R. E. Ginna Nuclear Power Plant, Unit No. 1
Docket No. 50-244

Dear Mr. O'Reilly:


In accordance with Technical Specifications, Article 6.9.2b, the attached report of Reportable Occurrence 76-13, 30-day, is hereby submitted. Two additional copies of this letter and the attachment are enclosed.

Very truly yours,

L. D. White, Jr.
L. D. White, Jr.

Attachment

cc: Dr. Ernst Volgenau (30)
Mr. William G. McDonald (3)

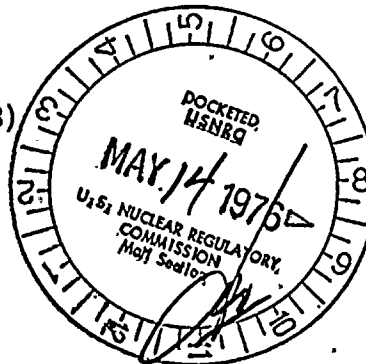

Regulatory Docket File

4910

1000

LICENSEE EVENT REPORT

CONTROL BLOCK:

| | | | | | |
|--|--|--|--|--|--|
| | | | | | |
|--|--|--|--|--|--|

(PLEASE PRINT ALL REQUIRED INFORMATION)

| | | | | | | | | | | | | | | | | | | | | | | | | | |
|---------------|---|---|---|---|---|----------------|----|---|---|---|---|--------------|---|---|---|------------|---|----|----|---|---|---|----|----|----|
| LICENSEE NAME | | | | | | LICENSE NUMBER | | | | | | LICENSE TYPE | | | | EVENT TYPE | | | | | | | | | |
| 01 | N | Y | R | E | G | 1 | 0 | 0 | - | 0 | 0 | 0 | 0 | 0 | - | 0 | 0 | 4 | 1 | 1 | 1 | 1 | 0 | 3 | |
| 7 | 8 | 9 | | | | 14 | 15 | | | | | | | | | | | 25 | 26 | | | | 30 | 31 | 32 |

| | | | | | | | | | | | | | | | | | | | | | | | |
|----------|------|-------------|---------------|---------------|----|----|---|------------|---|---|----|-------------|---|---|---|---|----|----|---|---|---|---|----|
| CATEGORY | | REPORT TYPE | REPORT SOURCE | DOCKET NUMBER | | | | EVENT DATE | | | | REPORT DATE | | | | | | | | | | | |
| 01 | CONT | | L | 0 | 5 | 0 | - | 0 | 2 | 4 | 4 | 0 | 4 | 1 | 6 | 7 | 6 | 0 | 5 | 1 | 1 | 7 | 6 |
| 7 | 8 | 57 | 58 | 59 | 60 | 61 | | | | | 68 | 69 | | | | | 74 | 75 | | | | | 80 |

EVENT DESCRIPTION

02 During power escalation turbine runback occurred; B bank group 2 rcc's G5 and G9 had
 03 dropped. G5 and G9 had dropped on 2 previous occasions involving water leaks over
 04 cabinet. With unit at hot shutdown, alarm card detector lamp indicated stationary "A"
 05 regulation failure which in turn indicates 4 p.c. cards as possible cause. Urgent failure
 06 alarm was reset to operate control rods to find cause; (cont'd. under Additional Factors)

| | | | | | | | | | | | | | | | |
|-------------|------------|----------------|----|----|----|--------------------------|------------------------|-----------|----|----|----|---|---|----|----|
| SYSTEM CODE | CAUSE CODE | COMPONENT CODE | | | | PRIME COMPONENT SUPPLIER | COMPONENT MANUFACTURER | VIOLATION | | | | | | | |
| 07 | R | B | E | C | O | N | R | O | D | N | W | 1 | 2 | 0 | N |
| 7 | 8 | 9 | 10 | 11 | 12 | | | | 17 | 43 | 44 | | | 47 | 48 |

CAUSE DESCRIPTION

08 NA. The 4 p.c. cards will be returned to Westinghouse for
 09 investigation.
 10

| | | | | | | | | | | |
|-----------------|---------|--------------|---------------------|-----------------------|----|----|------------------|----|----|----|
| FACILITY STATUS | % POWER | OTHER STATUS | METHOD OF DISCOVERY | DISCOVERY DESCRIPTION | | | | | | |
| 11 | E | 0 | 7 | 0 | NA | a | Rod Bottom Alarm | | | |
| 7 | 8 | 9 | 10 | 11 | 12 | 13 | 44 | 45 | 46 | 80 |

| | | | | | | | |
|---------------------------|--------------------|--------------------|---------------------|----|----|----|----|
| FORM OF ACTIVITY RELEASED | CONTENT OF RELEASE | AMOUNT OF ACTIVITY | LOCATION OF RELEASE | | | | |
| 12 | Z | Z | NA | | | | |
| 7 | 8 | 9 | 10 | 11 | 44 | 45 | 80 |

PERSONNEL EXPOSURES

| | | | | | | |
|--------|------|-------------|----|----|----|----|
| NUMBER | TYPE | DESCRIPTION | | | | |
| 13 | 0 | 0 | 0 | Z | NA | |
| 7 | 8 | 9 | 11 | 12 | 13 | 80 |

PERSONNEL INJURIES

| | | | | | |
|--------|-------------|---|----|----|----|
| NUMBER | DESCRIPTION | | | | |
| 14 | 0 | 0 | 0 | NA | |
| 7 | 8 | 9 | 11 | 12 | 80 |

OFFSITE CONSEQUENCES

15 NA

LOSS OR DAMAGE TO FACILITY

| | | | | |
|------|-------------|----|----|----|
| TYPE | DESCRIPTION | | | |
| 16 | Z | NA | | |
| 7 | 8 | 9 | 10 | 80 |

PUBLICITY

17 NA

ADDITIONAL FACTORS

18 (cont'd. from Event Description) alarm stayed cleared. The four p.c. cards were
 19 replaced. B bank was exercised 0-5 steps three times verifying operability.

NAME: E. Clair Edgar PHONE: 716-546-2700, ext. 291-223