

**NRC DISTRIBUTION FOR PART 50 DOCKET MATERIAL
(TEMPORARY FORM)**

CONTROL 12736
FILE: INCIDENT REPORT FILE

1

FROM: Florida Power & Light Co. Miami, Florida A.D. Schmidt		DATE OF DOC 10-31-75	DATE REC'D 11-5-75	LTR XXX	TWX	RPT	OTHER
TO: Mr. Norman Moseley		ORIG None	CC 40	OTHER	SENT AEC PDR SENT LOCAL PDR		XXX XXX
CLASS	UNCLASS XXX	PROP INFO	INPUT	NO CYS REC'D 40	DOCKET NO: 50-251		

DESCRIPTION:
Abnormal Occurrence # 75-10, on 10-21-75;
Concerning an Unplanned Release of Radioactive
Liquid.....

(40 Copies Received)

PLANT NAME: Turkey Point # 4

ENCLOSURES:

FOR ACTION/INFORMATION SAB 11-6-75

- | | | | |
|-------------------------|----------------------------|-----------------------------|------------------------|
| BUTLER (L)
W/ Copies | SCHWENCER (L)
W/ Copies | ZIEMANN (L)
W/ Copies | REGAN (E)
W/ Copies |
| CLARK (L)
W/ Copies | STOLZ (L)
W/ Copies | DICKER (E)
W/ Copies | LEAR (L)
W/ Copies |
| PARR (L)
W/ Copies | VASSALLO (L)
W/ Copies | KNIGHTON (E)
W/ Copies | SPELS
W/ Copies |
| KNIEL (L)
W/ Copies | PURPLE (L)
W/ Copies | YOUNGBLOOD (E)
W/ Copies | REID
W/ Copies |

ACKNOWLEDGED

DO NOT REMOVE

INTERNAL DISTRIBUTION

- | | | | | |
|---|--|--|---|---|
| REG FILE
NRC PDR
OGC, ROOM P-506A
GOSSICK/STAFF
CASE
GIAMBUSSO
BOYD
MOORE (L)
DEYOUNG (L)
SKOVHOLT (L)
GOLLER (L) (Ltr)
P. COLLINS
DENISE
REG OPR
FILE & REGION (2)
MIPC/PE (3)
STEELE | TECH REVIEW
SCHROEDER
MACCARY
KNIGHT
PAWLICKI
SHAO
**STELLO
**HOUSTON
**NOVAK
ROSS
IPPOLITO
TEDESCO
J. COLLINS
LAINAS
BENAROYA
VOLLMER | DENTON
**GRIMES
GAMMILL
KASTNER
BALLARD
SPANGLER

ENVIRO
MULLER
DICKER
KNIGHTON
YOUNGBLOOD
REGAN
PROJECT LDR
HARLESS | LIC ASST
R. DIGGS (L)
H. GEARIN (L)
E. GOULBOURNE (L)
P. KREUTZER (E)
J. LEE (L)
M. RUSHBROOK (L)
S. REED (E)
M. SERVICE (L)
S. SHEPPARD (L)
M. SLATER (E)
H. SMITH (L)
S. TEETS (L)
G. WILLIAMS (E)
V. WILSON (L)
R. INGRAM (L)
M. DUNCAN (R) | A/T IND.
BRAITMAN
SALTZMAN
MELTZ

PLANS
MCDONALD
CHAPMAN
DUBE (Ltr)
E. COUPE
PETERSON
HARTFIELD (2)
KLECKER
EISENHUT
WIGGINTON
F. WILLIAMS
HANAUER |
|---|--|--|---|---|

EXTERNAL DISTRIBUTION

- | | | |
|--------------------------------|--------------------------------|---|
| 1 - LOCAL PDR Miami, Florida | 1 - NATIONAL LABS | 1 - PDR-SAN/LA/NY |
| 1 - TIC (ABERNATHY) (1)(2)(10) | 1 - W. PENNINGTON, Rm E-201 GT | 1 - BROOKHAVEN NAT LAB |
| 1 - NSIC (BUCHANAN) | 1 - CONSULTANTS | 1 - G. ULRIKSON, ORNL |
| 1 - ASLB | NEWMARK/BLUME/AGBABIAN | 1 - AGMED (RUTH GUSSMAN)
Rm B-127 GT |
| 1 - Newton Anderson | | 1 - J. D. RUNKLES, Rm E-201
GT |
| 1 - ACRS SENT TO LIC ASST | | |
| ** SEND ONLY TEN DAY REPORTS | R. Ingram | |

[Handwritten Signature]


... ..
... ..
... ..

... ..
... ..
... ..

... ..


... ..

... ..

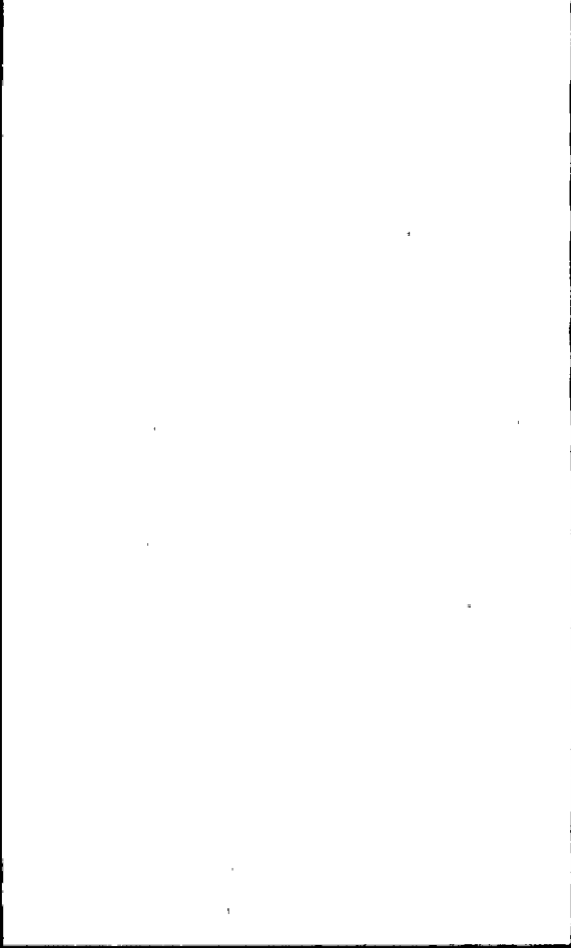

Regulatory

File Copy

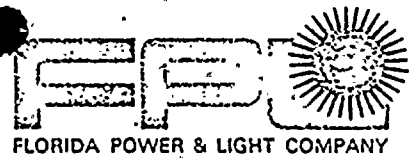

October 31, 1975


Mr. Norman C. Moseley, Director, Region II
Office of Inspection and Enforcement
U. S. Nuclear Regulatory Commission
230 Peachtree Street, N.W., Suite 818
Atlanta, Georgia 30303

Dear Mr. Moseley: **50-251**

ABNORMAL OCCURRENCE, 251-75-10
TURKEY POINT UNIT 4

DATE OF OCCURRENCE: OCTOBER 21, 1975

UNPLANNED RELEASE OF RADIOACTIVE LIQUID

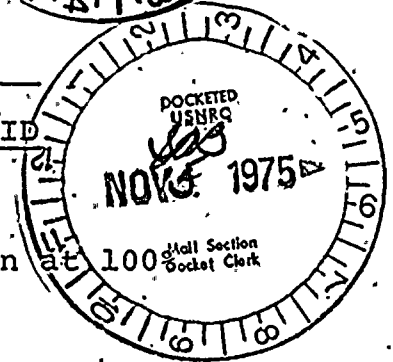

A. CONDITIONS PRIOR TO OCCURRENCE

The reactor was in steady state power operation at 100% rated power.

B. DESCRIPTION OF OCCURRENCE

The Waste Holdup Tank (WHT), which is shared by Units 3 and 4, was recently cleaned to remove sludge deposits. The cleaning process produced a sludge-water mixture which was pumped to several 55-gallon drums for temporary storage. Most of the sludge settled to the bottom of the drums but some of it remained suspended in the water. It was planned to return the water from each drum to the WHT via the appropriate floor drain in the Unit 4 spent fuel cask wash area. The remaining sludge was then to be treated as waste and eventually shipped off-site for disposal.

From about 4:00 AM to 7:00 AM on October 21, 1975, maintenance personnel pumped the water from twenty drums into the Unit 4 cask wash area floor drain which connects to a storm drain and discharges into an underground drywell south of the plant. The inadvertent use of the wrong floor drain resulted in an unplanned release of about 880 gallons of radioactive liquid to an underground area outside the plant's radiation controlled boundary.

C. DESIGNATION OF APPARENT CAUSE OF OCCURRENCE

Personnel error resulted in the pumping of radioactive liquid into the wrong floor drain. The floor drains in the Unit 4 spent fuel cask wash area are not labeled and there was uncertainty as to which drain connected to the WHT. The personnel involved did not make a positive identification of the WHT floor drain.

12736

Handwritten scribbles or marks at the top right corner.

00741

Mr. Norman C. Moseley
October 31, 1975
Page Two

D. ANALYSIS OF OCCURRENCE

Sludge and water samples were taken from some of the remaining full drums and subjected to an isotopic activity analysis. Dose rate measurements from the full drums were then compared with dose rate measurements from the twenty empty drums. The isotopic activity and dose rate data were used to estimate the activity of the water which had been pumped to the storm drain. Analytical results indicate that approximately 2.1 Curies of primarily Cobalt-58 and Cobalt-60 were released.

The drywell termination of the storm drain is located underground about 150 feet southeast of the new Radwaste Building. There are no potable water sources in this vicinity. The water table beneath the drywell is a salt water stratum and does not represent a source of potable water. In addition, natural filtration by the soil can be expected to remove much of the insoluble activity before it reaches the water table. The isolated location of the drywell which is surrounded by the closed canal system provides reasonable assurance that the health and safety of the public will not be adversely affected by this occurrence.

E. CORRECTIVE ACTION

The floor drains in the Unit 4 spent fuel cask wash area will be labeled to differentiate between the WHT and storm drains. The floor drains in the Unit 3 spent fuel cask wash area will also be labeled.

Plant personnel will be instructed to request guidance from knowledgeable personnel whenever any uncertainty arises regarding the handling of radioactive material. A copy of this report will be routed to the personnel involved for their instruction.

Very truly yours,



A. D. Schmidt
Vice President
Power Resources

MAS/jar

cc: Jack R. Newman, Esquire
Director, Office of Inspection and Enforcement (40)
Director, Office of Management Information and
Program Control (3)



Handwritten scribbles or marks in the top right corner.