

NEC DISTRIBUTION FOR PART 50 DOCKET MATERIAL
(TEMPORARY FORM)

CONTROL NO: 9066

FILE: INCIDENT REPORT FILE

FROM: Florida Power & Light Co. Miami, Florida A.D. Schmidt		DATE OF DOC 8-18-75	DATE REC'D 8-26-75	LTR	TWX	RPT XX	OTHER
TO: NRC		ORIG 1 Signed	CC	OTHER	SENT AEC PDR <u>XXX</u>		SENT LOCAL PDR <u>XXX</u>
CLASS	UNCLASS XXX	PROP INFO	INPUT	NO CYS REC'D 1	DOCKET NO: 50-250/251		

DESCRIPTION:
Letter trans the following.....

PLANT NAME: Turkey Point # 3 & 4

ENCLOSURES:
Unusual Event # 75-2, on 5-12-75, Concerning Malfunction of Spent Fuel Pit Cooling Pump.....

(1 Copy Enclosure Received)

FOR ACTION/INFORMATION

SAB 8-28-75

- | | | | |
|-------------------------|----------------------------|-----------------------------|------------------------|
| BUTLER (L)
W/ Copies | SCHWENCER (L)
W/ Copies | ZIEMANN (L)
W/ Copies | REGAN (E)
W/ Copies |
| CLARK (L)
W/ Copies | STOLZ (L)
W/ Copies | DICKER (E)
W/ Copies | LEAR (L)
W/ Copies |
| PARR (L)
W/ Copies | VASSALLO (L)
W/ Copies | KNIGHTON (E)
W/ Copies | SPELS
W/ Copies |
| KNIEL (L)
W/ Copies | PURPLE (L)
W/ Copies | YOUNGBLOOD (E)
W/ Copies | W/ Copies |

ACKNOWLEDGED
DO NOT REMOVE

INTERNAL DISTRIBUTION

- | | | | | |
|---|--|--|---|--|
| <u>REG FILE</u>
NRC PDR
OGC, ROOM P-506A
GOSSICK/STAFF
CASE
GIAMBUSSO
BOYD
MOORE (L)
DEYOUNG (L)
SKOVHOLT (L)
GOLLER (L) (Ltr)
P. COLLINS
DENISE
REG OPR
FILE & REGION (2)
MIPC/PE (3)
STEELE | <u>TECH REVIEW</u>
SCHROEDER
MACCARY
KNIGHT
PAWLICKI
SHAO
**STELLO
**HOUSTON
**NOVAK
ROSS
IPPOLITO
TEDESCO
J. COLLINS
LAINAS
BENAROYA
VOLLMER | <u>DENTON</u>
**GRIMES
GAMMILL
KASTNER
BALLARD
SPANGLER

<u>ENVIRO</u>
MULLER
DICKER
KNIGHTON
YOUNGBLOOD
REGAN
PROJECT LDR

 
HARLESS | <u>LIC ASST</u>
R. DIGGS (L)
H. GEARIN (L)
E. GOULBOURNE (L)
P. KREUTZER (E)
J. LEE (L)
M. RUSHBROOK (L)
S. REED (E)
M. SERVICE (L)
S. SHEPPARD (L)
M. SLATER (E)
H. SMITH (L)
S. TEETS (L)
G. WILLIAMS (E)
V. WILSON (L)
R. INGRAM (L)
M. DUNCAN (E) | <u>A/T IND.</u>
BRAITMAN
SALTZMAN
MELTZ


<u>PLANS</u>
MCDONALD
CHAPMAN
DUBE (Ltr)
E. COUPE
PETERSON
HARTFIELD (2)
KLECKER
EISENHUT
WIGGINTON

F. WILLIAMS
HANAUER |
|---|--|--|---|--|

EXTERNAL DISTRIBUTION

- | | | |
|-------------------------------------|--------------------------------|---|
| 1 - LOCAL PDR <u>Miami, Florida</u> | 1 - NATIONAL LABS | 1 - PDR-SAN/LA/NY |
| 1 - TIC (ABERNATHY) (1)(2)(10) | 1 - W. PENNINGTON, Rm E-201 GT | 1 - BROOKHAVEN NAT LAB |
| 1 - NSIC (BUCHANAN) | 1 - CONSULTANTS | 1 - G. ULRIKSON, ORNL |
| 1 - ASLB | NEWMARK/BLUME/AGBABIAN | 1 - AGMED (RUTH GUSSMAN)
Rm B-127 GT |
| 1 - Newton Anderson | R. Ingram | 1 - J. D. RUNKLES, Rm E-201
GT |
| 5 - ACRS SENT TO LIC ASST | | |
| ** SEND ONLY TEN DAY REPORTS | | |



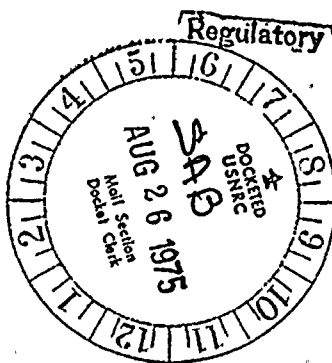

File Cv.



August 18, 1975

Mr. Benard C. Rusche, Director
 Office of Nuclear Reactor Regulation
 U. S. Nuclear Regulatory Commission
 Washington, D. C. 20555

Dear Mr. Rusche:


UNUSUAL EVENT NOS. 250-75-2 AND 251-75-2
TURKEY POINT UNIT NOS. 3 AND 4
MALFUNCTION OF SPENT FUEL PIT COOLING PUMPS

A. DESCRIPTION OF EVENTS

During the past four months, the Unit 3 Spent Fuel Pit (SFP) Cooling Pump has malfunctioned twice and the Unit 4 SFP Cooling Pump has malfunctioned three times. The pumps are Ingersoll-Rand Type LP pumps which have a discharge flow rate of 2300 gpm and a discharge head of 125 feet at the design speed of 1780 rpm. A brief description of each event follows:

1. On April 12, 1975, the radial bearings seized on the Unit 4 pump. The pump was dismantled and found to have overheated radial bearings, an overheated and extensively damaged mechanical seal, and a sheared pump shaft. The pump was repaired and tested satisfactorily.
2. On April 29, the thrust bearings seized on the Unit 4 pump. The pump was dismantled and found to have overheated thrust bearings and a galled thrust bearing housing. The bearing and housing were replaced and the pump tested satisfactorily.
3. On May 17, the Unit 4 pump radial bearings seized again. The pump shaft was also broken at the threaded end. The pump was repaired and tested satisfactorily.
4. On July 3, the Unit 3 pump malfunctioned. The pump was dismantled and the shaft was found to be broken at the keyway. The pump was repaired and tested satisfactorily.

9066

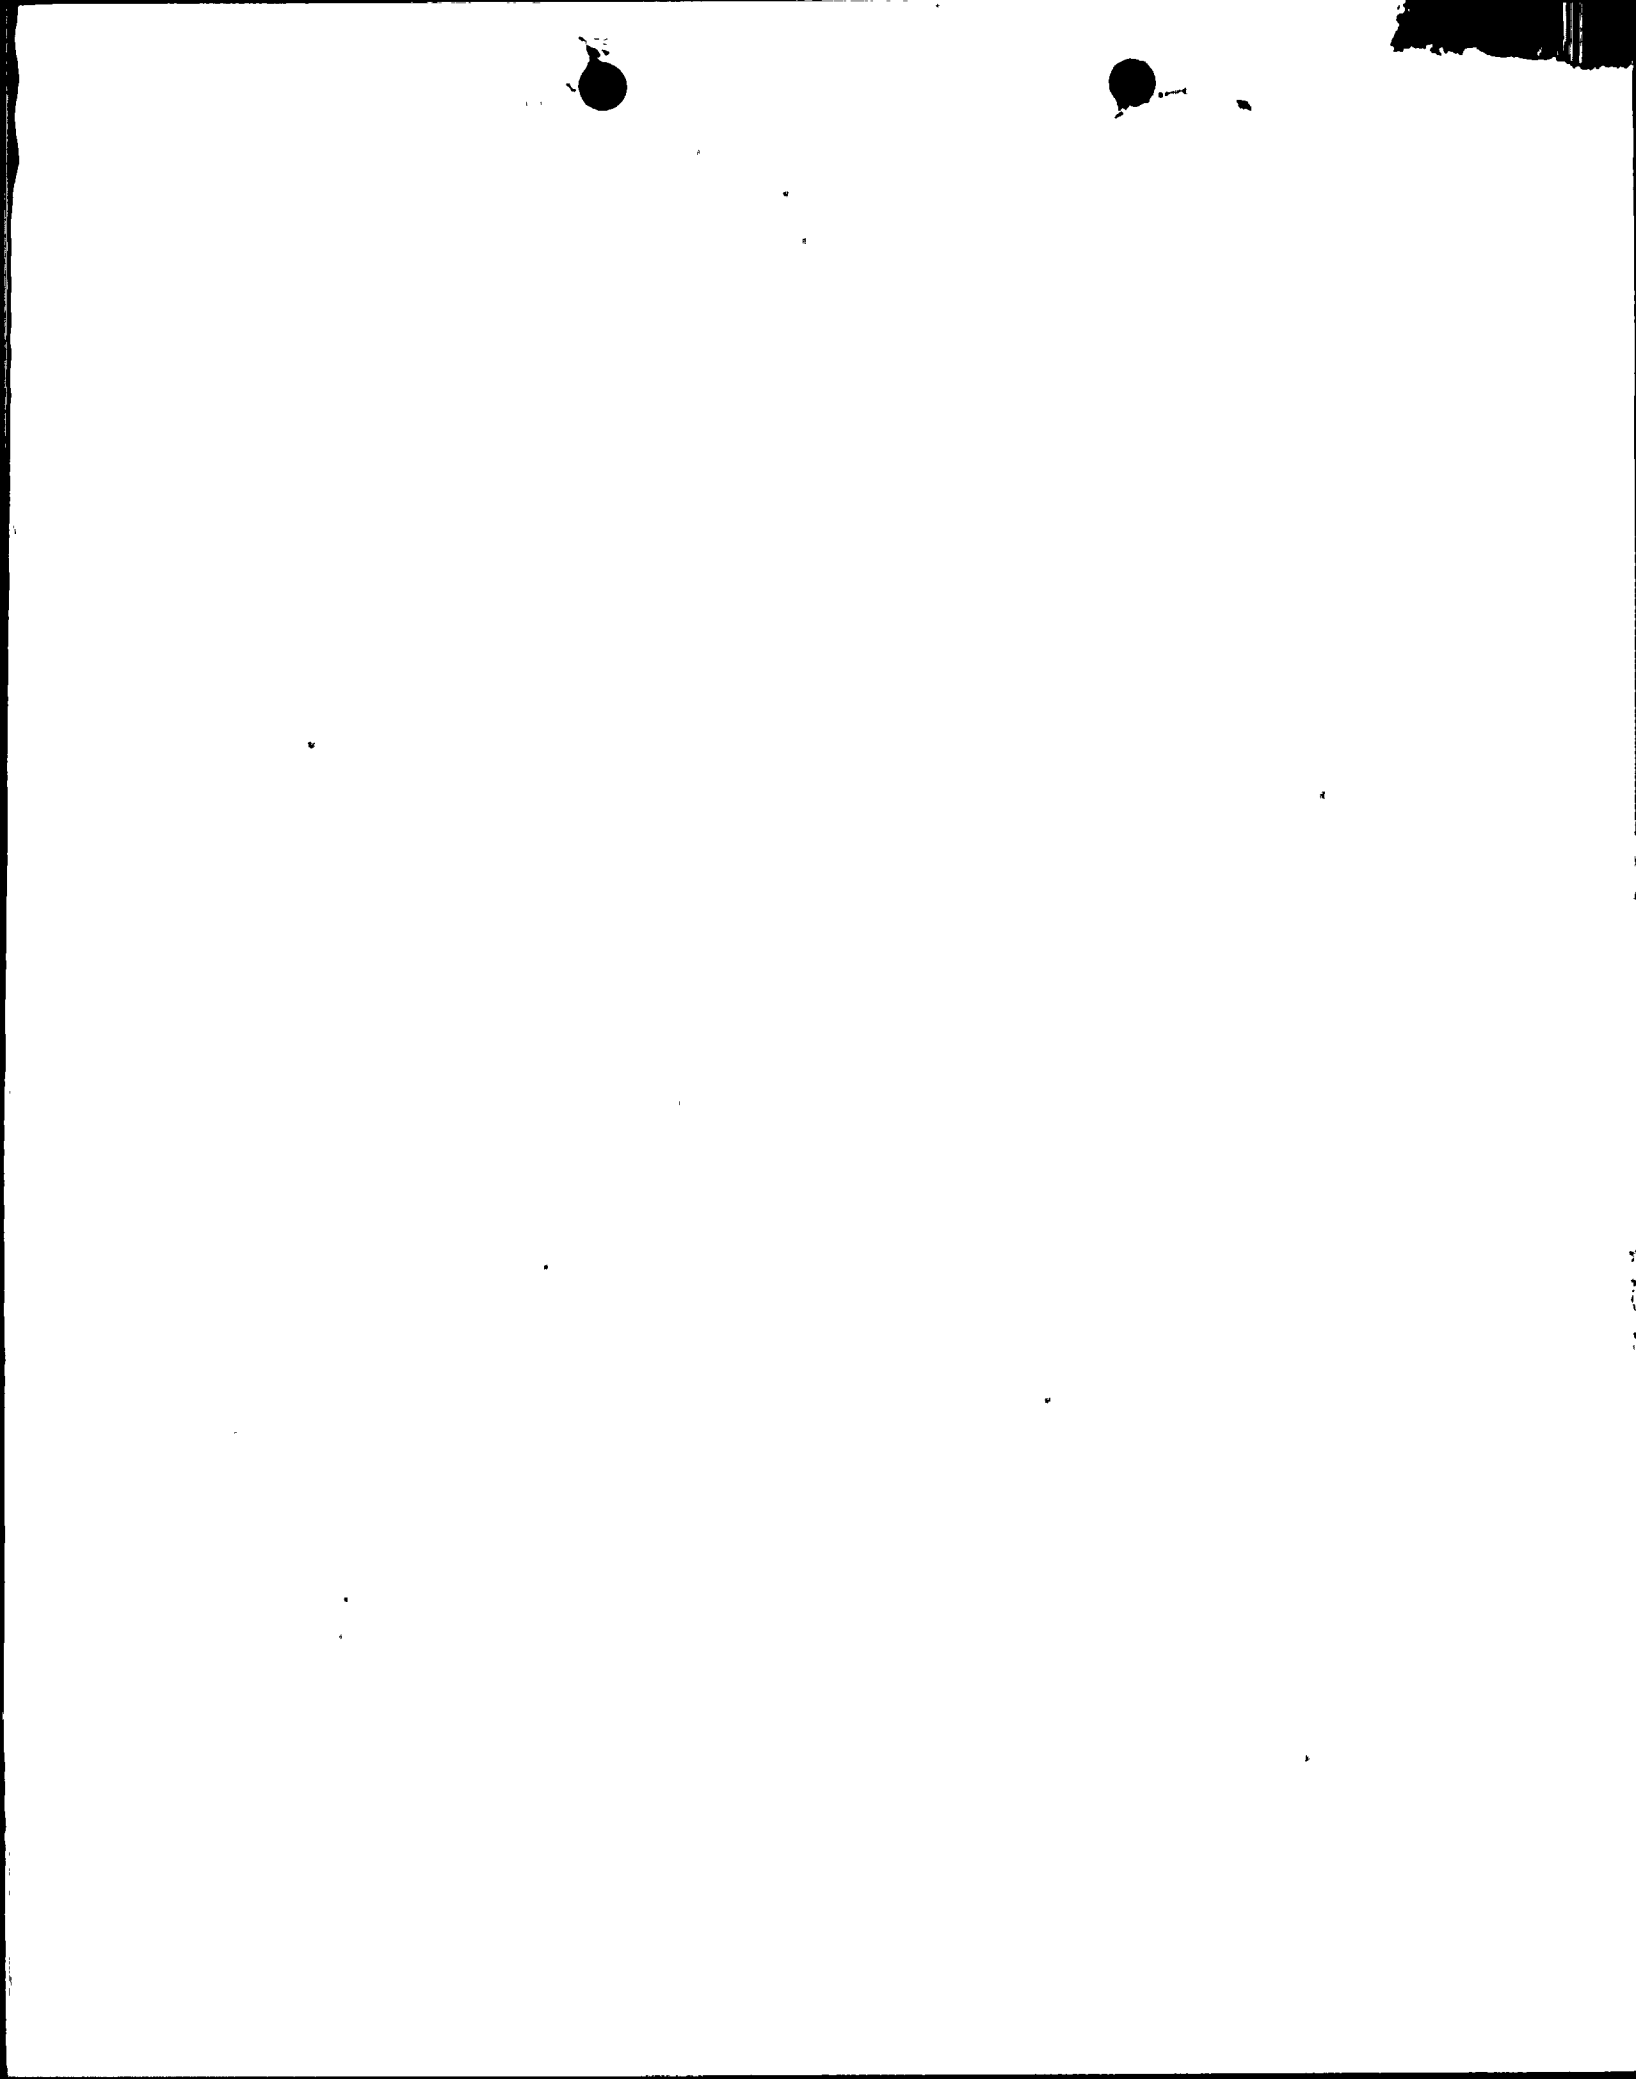

Mr. Benard C. Rusche, Director
Page Two
August 18, 1975

5. On July 27, the thrust bearings seized on the Unit 3 pump. The pump was dismantled and found to have overheated thrust bearings. The bearings were replaced and the pump tested satisfactorily.

B. APPARENT CAUSE AND ANALYSIS OF EVENT

The exact cause of the SFP Cooling Pump shaft and bearing failures has not been determined. However, it is suspected that they may have resulted from excessive internal stress created by pump cavitation.

The SFP cooling system is shown in FSAR figure 9.3-3. Valve number 820, located at the SFP heat exchanger outlet, is called the "system discharge line control valve". Operating personnel have verified that pump operation is very noisy, indicating cavitation, whenever this valve is more than 50% open. Therefore, we have conducted an evaluation of system performance to determine the optimum position of the system discharge line control valve. Evaluation results indicate that we can avoid cavitation and still provide cooling system flow to meet the current SFP heat transfer demand by administratively limiting the valve position to about 25% of fully open.


C. CORRECTIVE ACTION

For each event, the immediate corrective action was to implement Off-Normal Operating Procedure 3508.1, entitled "SFP COOLING SYSTEM, Failure of SFP Cooling Pump". This procedure provides instructions for cooling the spent fuel pool when the normal SFP Cooling Pump is inoperable.

Operators have been instructed to maintain the system discharge line control valve 25% open. Such action should preclude cavitation and reduce the probability of further SFP Cooling Pump failure.

In addition, we are proceeding with the engineering work necessary to procure and install a redundant cooling pump in each SFP cooling system.

Very truly yours,


A. D. Schmidt
Vice President
Power Resources

MAS/cpc

cc: Mr. Norman C. Moseley
Jack R. Newman, Esquire

