



UNITED STATES
NUCLEAR REGULATORY COMMISSION
REGION I
631 PARK AVENUE
KING OF PRUSSIA, PENNSYLVANIA 19406

TJH

AUG 15 1979

Docket No. 50-293

Boston Edison Company M/C Nuclear
ATTN: Mr. G. Carl Andognini, Manager
Nuclear Operations Department
800 Boylston Street
Boston, Massachusetts 02199

Gentlemen:

The enclosed supplement to Bulletin 79-14 is forwarded to you to provide added guidance on the intent of the Bulletin. If you desire additional information regarding this matter, please contact this office.

Sincerely,

B. W. McLaughlin
for **Boyce H. Grier**
Director

Enclosures:

1. Supplement IE Bulletin 79-14
2. Listing of IE Bulletins Issued
in the Last 6 Months

cc w/encls:

P. J. McGuire, Pilgrim Station Manager
A. Z. Roisman, Natural Resources Defense Council

852 110

7908300094.1

ENCLOSURE 1

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON, D.C. 20555

Supplement IE Bulletin No. 79-14
Date: August 15, 1979
Page 1 of 2

SEISMIC ANALYSIS FOR AS-BUILT SAFETY-RELATED PIPING SYSTEMS

Description of Circumstances:

IE Bulletin No. 79-14 was issued on July 2, 1979 and revised on July 18, 1979. The bulletin requested licensees to take certain actions to verify that seismic analyses are applicable to as-built plants. This supplement to the bulletin provides additional guidance and definition of Action Items 2, 3, and 4.

To comply with the requests in IE Bulletin 79-14, it will be necessary for licensees to do the following:

2. Inspect Part of the Accessible Piping

For each system selected by the licensee in accordance with Item 2 of the Bulletin, the licensee is expected to verify by physical inspection, to the extent practicable, that the inspection elements meet the acceptance criteria. In performing these inspections, the licensee is expected to use measuring techniques of sufficient accuracy to demonstrate that acceptance criteria are met. Where inspection elements important to the seismic analysis cannot be viewed because of thermal insulation or location of the piping, the licensee is expected to remove thermal insulation or provide access. Where physical inspection is not practicable, e.g., for valve weights and materials of construction, the licensee is expected to verify conformance by inspection of quality assurance records. If a nonconformance is found, the licensee is expected in accordance with Item 4 of the Bulletin to perform an evaluation of the significance of the nonconformance as rapidly as possible to determine whether or not the operability of the system might be jeopardized during a safe shutdown earthquake as defined in the Regulations. This evaluation is expected to be done in two phases involving an initial engineering judgement (within 2 days), followed by an analytical engineering evaluation (within 30 days). Where either phase of the evaluation shows that system operability is in jeopardy, the licensee is expected to meet the applicable technical specification action statement and complete the inspections required by Item 2 and 3 of the Bulletin as soon as possible. The licensee must report the results of these inspections in accordance with the requirements for content and schedule.

852 111

DUPLICATE DOCUMENT

Entire document previously entered
into system under:

ANO

7908080360

No. of pages: 1