



UNITED STATES
NUCLEAR REGULATORY COMMISSION
REGION I
631 PARK AVENUE
KING OF PRUSSIA, PENNSYLVANIA 19406

Docket No. 50-334

SEP 10 1979

Duquesne Light Company
ATTN: Mr. C. N. Dunn
Vice President
Operations Division
435 Sixth Avenue
Pittsburgh, Pennsylvania 15219

Gentlemen:

The enclosed Circular No. 79-18 is forwarded to you for information. No written response is required. Should you have any questions related to your understanding of the recommendations on this matter, please contact this office.

Sincerely,


Boyce H. Grier
Director

Enclosures:

1. IE Circular No. 79-18
2. List of IE Circulars Issued in Last Six Months

cc w/encls:

F. Bissert, Technical Assistant Nuclear
R. Washabaugh, QA Manager
J. Werling, Station Superintendent
G. Moore, General Superintendent, Power Stations Department
J. J. Carey, Nuclear Technical Assistant

974 230

7909190374 Q

ENCLOSURE 1

Accession No: 7908200385
SSINS No. 6830

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON, D.C. 20555

IE Circular No. 79-18
Date: September 10, 1979
Page 1 of 2

PROPER INSTALLATION OF TARGET ROCK SAFETY-RELIEF VALVES

Description of Circumstances:

As a result of NRC monitoring of operating experiences involving the Target Rock safety-relief valve, two potential problems have been identified. One potential problem is that the performance of the valve has been found to be impaired by either excessive or insufficient insulation around the valve body when installed in its service environment. The other potential problem is that improper assembly of the modified valve can result in inoperability of the remote air actuator.

The Target Rock safety-relief valve is a dual purpose valve in that overpressure response is provided by pilot valve action and automatic depressurization (ADS) is provided by a remote air actuator. Valve operation has been found to be affected by the amount of insulation placed around the valve body. A previous IE Bulletin No. 76-06 was issued on July 21, 1976 as a result of operating experiences where excessive insulation was installed on the valve. The excessive insulation caused excessive heat to be retained producing a higher temperature environment for the elastomeric diaphragm which resulted in accelerated deterioration of the elastomer. Failure of the elastomeric diaphragm, makes the valve inoperable in the power-operation mode (i.e. manual and ADS). Subsequently, a silicone-nomex diaphragm was developed by the manufacturer to provide a longer life in high temperature environments. In addition, the IE Bulletin explicitly required that insulation be installed in accordance with the manufacturer's recommendations.

A recent licensee event report from the Monticello facility identified a potential problem resulting from insufficient insulation (i.e. just opposite of the condition addressed by IE Bulletin 76-06). During the performance of special testing of the response to safety-relief valve operation, a valve was discovered to be exceeding its design delay time for opening. Subsequent inspection and testing of the valve revealed that insufficient insulation may cause condensation to accumulate in the pipe and results in delaying the opening of the main valve.

DUPLICATE DOCUMENT

Entire document previously entered
into system under:

ANO 7908200385

No. of pages: _____

97A 231