THE



UNITED STATES NUCLEAR REGULATORY COMMISSION REGION I 631 PARK AVENUE KING OF PRUSSIA, PENNSYLVANIA 19406

September 7, 1979

Docket No. 50-334

Duquesne Light Company ATTN: Mr. C. N. Dunn Vice President Operations Division 435 Sixth Avenue Pittsburgh, Pennsylvania 15219

Gentlemen:

The enclosed supplement to Bulletin No. 79-14 is forwarded to you to provide added guidance on the intent of the Bulletin. If you desire additional information regarding this matter, please concact this office.

Sincerely,

allon H. Grier Director

Enclosures:

- Supplement 2 to IE Bulletin No. 79-14
- List of IE Bulletins Issued in Last Six Months
- cc w/encls:
- F. Bissert, Technical Assistant Nuclear
- R. Washabaugh, QA Manager
- J. Werling, Station Superintendent
- G. Moore, General Superintendent, Power Stations Department
- J. J. Carey, Nuclear Technical Assistant

380223

79092102101

ENCLOSURE 1

SSINS: 6820 Accession No.: 7908220109

UNITED STATES NUCLEAR REGULATORY COMMISSION OFFICE OF INSPECTION AND ENFORCEMENT WASHINGTON, D.C. 20555

IE Bulletin No. 79-14 Supplement 2 Date: September 7, 1979 Page 1 of 2

SEISMIC ANALYSIS FOR AS-BUILT SAFETY-RELATED PIPING SYSTEMS

Description of Circumstances:

IE Bulletin No. 79-14 was issued on July 2, revised on July 18, and first supplemented on August 15, 1979. The bulletin requested licensees to take certain actions to verify that seismic analyses are applicable to as-built plants. Supplement 2 provides the following additional guidance with regard to implementation of the bulletin requirements:

Nonconformances

One way of satisfying the requirements of the bulletin is to inspect safetyrelated piping systems against the specific revisions of drawings which were used as input to the seismic analysis. Some architect-engineers (A-E) however, are recommending that their customers inspect these systems against the latest revisions of the drawings and mark them as necessary to define the as-built configuration of the systems. These drawings are then returned to the AE's offices for comparison by the analyst to the seismic analysis input. For licensees taking this approach, the seismic analyst will be the person who will identify nonconformances.

The first supplement to the bulletin provided guidance with regard to evaluation of nonconformances. That guidance is appropriate for licensees inspecting against later drawings. The licensee should assure that he is promptly notified when the AE identifies a nonconformance, that the initial engineering judgment is completed in two days and that the analytical engineering evaluation is completed in 30 days. If either the engineering judgement or the analytical engineering evaluation indicates that system operability is in jeopardy, the licensee is expected to meet the applicable technical specification action statement.

Visual Approximations

| Some licensees are visually estimating pip elements, and have not documented which da Visual estimation of dimensions is not enc where visual estimates are used, the accur ance requirements. Further, in documentin ically identify those data that were visua | DURLICATE DOCUMENT |
|---|--------------------|
| | 383664 |
| | No. of pages: |