っついこ



UNITED STATES NUCLEAR REGULATORY COMMISSION REGION V 1990 N. CALIFORNIA BOULEVARD SUITE 202, WALNUT CREEK PLAZA WALNUT CREEK, CALIFORNIA 94596

November 16, 1979

Docket No. 50-133 50-275 50-323

Pacific Gas and Electric Company 77 Beale Street San Francisco, California 94106

Attention: Mr. Philip A. Crane, Jr. Assistant General Counsel

Gentlemen:

The enclosed IE Information Notice provides information with regard to the sequence of events that followed incidents involving steam generator tube ruptures at two PWR units.

Sincerely,

A.E. Book

Director

Enclosures:

- IE Information Notice 79-27
  Recently Issued IE
  - Information Notices

cc w/enclosures: W. Barr, PG&E W. Raymond, PG&E R. Ramsay, PG&E, Diablo Canyon E. Weeks, PG&E, Humboldt Bay J. Worthington, PG&E

## 1435 345

79112801021

SSINS No.: 6870 Accession No.: 7910250488

## UNITED STATES NUCLEAR REGULATORY COMMISSION OFFICE OF INSPECTION AND ENFORCEMENT WASHINGTON D.C. 20555

## November 16, 1979

IE Information Notice No. 79-27

STEAM GENERATOR TUBE RUPTURES AT TWO PWR PLANTS

Description of Circumstances:

In recent months two incidents involving steam generator tube ruptures have occurred. In both instances, the units were cooled down and placed in the residual heat removal mode with existing procedures.

Event of June 25, 1979 at the Doel 2 Nuclear Power Plant in Belgium

The first event occurred on June 25, 1979, at the Doel 2 nuclear power plant in Belgium. The Doel unit is a 390 Mwe Westinghouse two-loop reactor. The event consisted of a rupture of several tubes in the loop B steam generator. The resultant leakage between the primary and secondary systems was estimated to be 125 gpm. The event started when the plant was heated up after a shutdown caused by a malfunction of the main steam isolation valve. At the time of the incident the primary coolant pressure was: 2233 psi and the temperature: 491 F. The reactor remained subcritical throughout the event.

The first indication of abnormal behavior was a rapid decrease of the orimary system pressure (approximately: 28 psi/min.). This was followed by the sequence of events listed below:

Time, min.

1.	Increase of charging flow demand, requiring startup of a second	1.8
2.	charging pump. Automatic isolation of the CVCS letdown line.	2.4
3.	Shut off of the pressurizer heaters due to low liquid level in the pressurizer.	2.4

	-			
PLICATE	E DOCUM	ENT		
tire de	cument	1435 previo	546 usly	-
-11	110 sy	5 ALL	der:	
	des:	JUTI	50	
	tire do tered i	tire document tered into sy	10 <u>79102504</u>	1435 346 tire document previously tered into system under: 0 7910250488