



UNITED STATES
NUCLEAR REGULATORY COMMISSION
REGION I
631 PARK AVENUE
KING OF PRUSSIA, PENNSYLVANIA 19406

TH

Docket No. 50-213

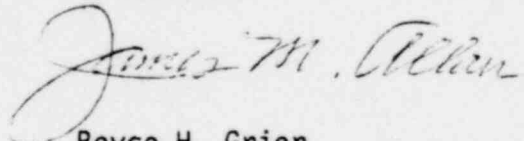
NOV 16 1979

Connecticut Yankee Atomic Power Company
ATTN: Mr. W. G. Council
Vice President - Nuclear
Engineering and Operations
P. O. Box 270
Hartford, Connecticut 06101

Gentlemen:

The enclosed IE Information Notice No. 79-27 provides information with regard to the sequence of events that followed incidents involving steam generator tube ruptures at two PWR units. If you have any questions regarding this matter, please contact this office.

Sincerely,


Boyce H. Grier
Director

Enclosures:

1. IE Information Notice No. 79-27
2. List of Recently Issued Information Notices

CONTACT: W. H. Baunack
(215-337-5334)

cc w/encls:

R. Graves, Plant Superintendent
D. G. Diedrick, Manager of Quality Assurance
J. R. Himmelwright, Licensing Safeguards Engineer

1500 130

7912050 239 Q

ENCLOSURE 1

SSINS No.: 6870
Accession No.:
7910250488

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON D.C. 20555

IE Information Notice No. 79-27
Date: November 16, 1979
Page 1 of 9

STEAM GENERATOR TUBE RUPTURES AT TWO PWR PLANTS

Description of Circumstances:

In recent months two incidents involving steam generator tube ruptures have occurred. In both instances, the units were cooled down and placed in the residual heat removal mode with existing procedures.

Event of June 25, 1979 at the Doel 2 Nuclear Power Plant in Belgium

The first event occurred on June 25, 1979, at the Doel 2 nuclear power plant in Belgium. The Doel unit is a 390 Mwe Westinghouse two-loop reactor. The event consisted of a rupture of several tubes in the loop B steam generator. The resultant leakage between the primary and secondary systems was estimated to be 125 gpm. The event started when the plant was heated up after a shutdown caused by a malfunction of the main steam isolation valve. At the time of the incident the primary coolant pressure was: 2233 psi and the temperature: 491°F. The reactor remained subcritical throughout the event.

The first indication of abnormal behavior was a rapid decrease of the primary system pressure (approximately: 28 psi/min.). This was followed by the sequence of events listed below:

	<u>Time, min.</u>
1. Increase of charging flow demand, requiring startup of a second charging pump.	1.8
2. Automatic isolation of the CVCS letdown line.	2.4
3. Shut off of the pressurizer heaters due to low liquid level in the pressurizer.	2.4

DUPLICATE DOCUMENT

Entire document previously
entered into system under:

ANO 7910250488

No. of pages: 10

1500 131