

UNITED STATES
 NUCLEAR REGULATORY COMMISSION
 REGION I
 631 PARK AVENUE
 KING OF PRUSSIA, PENNSYLVANIA 19406



NOV 20 1979

Docket Nos. 50-289
 50-320

Metropolitan Edison Company
 ATTN: Mr. R. C. Arnold, Sr.
 Senior Vice President
 100 Interpace Parkway
 Parsippany, New Jersey 07054

Gentlemen:

The enclosed IE Bulletin 79-26 is forwarded to you for information. No written response is required. If you desire additional information regarding this matter, please contact this office.

Sincerely,

James M. Allan
 Boyce H. Grier
 Director

Enclosures:

1. IE Bulletin No. 79-26
2. List of Recently Issued Bulletins

CONTACT: D. L. Capton
 (215-337-5266)

cc w/encls:

J. G. Herbein, Vice President Nuclear Operations
 E. G. Wallace, Licensing Manager
 G. P. Miller, Manager Support Services and Logistics
 G. P. Miller, Acting, Superintendent Unit 1
 W. E. Potts, Unit 1 Superintendent - Technical Support
 J. J. Colitz, Manager Plant Engineering
 R. F. Wilson, Director TMI-2 Recovery, Acting
 J. B. Logan, Superintendent Unit 2
 G. A. Kunder, Unit 2 Superintendent - Technical Support
 I. R. Finfrock, Jr.
 R. W. Conrad
 G. T. Trowbridge, Esquire
 J. B. Lieberman, Esquire
 Ms. Mary V. Southard, Chairperson, Citizens for a Safe Environment
 John T. Collins, Deputy Director, NRC, TMI Support

1500 136

7912050 248

ENCLOSURE 1

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON, D.C. 20555

SSINS: 6820
Accession No.:
7910250475

IE Bulletin No. 79-26
Date: November 20, 1979
Page 1 of 4

BORON LOSS FROM BWR CONTROL BLADES

Description of Circumstances:

The General Electric Company (GE) has informed us of a failure mode for control blades which can cause a loss of boron poison material. Hot cell examinations of both foreign and domestic blades have revealed cracks near the upper end of stainless steel tubing and loss of boron from the tubes. The cracks and boron loss have so far been confined to locations in the poison tubes with more than 50 percent Boron-10 (B^{10}) local depletion. Observed crack sizes range from a quarter to a half inch in length and from one to two mils in width.

GE has postulated that the cracking is due to stress corrosion induced by solidification of boron carbide (B_4C) particles and swelling of the compacted B_4C as helium and lithium concentrations grow. Once primary coolant penetrates the cladding (i.e., the cracking has progressed through the cladding wall and the helium-lithium pressures are sufficient to open the crack), boron is leached out of the tube at locations with more than 50 percent B^{10} local depletion (local depletion is considered to be twice the average depletion). It was further found with similar cracking but with less than 50 percent local depletion of B^{10} , that leaching did not occur even though primary coolant had penetrated the cladding.

The cracking and boron loss shorten the design life of the control blade. According to the GE criteria the end of design life is reached when the reactivity worth of the blade is reduced by 10 percent, which corresponds to 42 percent B^{10} depletion averaged over the top quarter of the control blade. Because of the leaching mechanism, GE has reduced the allowance for B^{10} depletion averaged over the top quarter of the control blade from the 42 percent value to 34 percent.

The safety significance of boron loss is its impact on shutdown capability and scram reactivity. Although shutdown capability is demonstrated by shutdown margin tests after refueling, the calculation tests are based on the assumption that in scram reactivity due to boron loss of Power Ratio (CPR) reductions during the the consequences of control rod drop ad

1500 137

DUPLICATE DOCUMENT

Entire document previously
entered into system under:

ANO 7910250475

No. of pages: 5