



UNITED STATES
NUCLEAR REGULATORY COMMISSION
REGION III
799 ROOSEVELT ROAD
GLEN ELLYN, ILLINOIS 60137

NOV 20 1979

Docket No. 50-346

Toledo Edison Company
ATTN: Mr. Richard P. Crouse
Vice President
Energy Supply
Edison Plaza
300 Madison Avenue
Toledo, OH 43652

Gentlemen:

The enclosed IE Circular No. 79-24 is forwarded to you for information. No written response is required. Should you have any questions related to your understanding of the recommendations on this matter, please contact this office.

Sincerely,

James G. Keppler
James G. Keppler
Director

Enclosures:

1. IE Circular No. 79-24
2. Recently Issued IE Circulars

cc w/encls:

Mr. T. Murray, Station
Superintendent
Central Files
Director, NRR/DPM
Director, NRR/DOR
PDR
Local PDR
NSIC
TIC
Harold W. Kohn, Power
Siting Commission
Helen W. Evans, State
of Ohio

1533 337

7912100 444

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON, D.C. 20555

November 26, 1979

IE Circular No. 79-24

PROPER INSTALLATION AND CALIBRATION OF CORE SPRAY PIPE BREAK DETECTION EQUIPMENT
ON BWRs

Description of Circumstances:

During 1976 the Iowa Electric Light and Power Company identified and corrected a potential problem involving the core spray (CS) pipe break detection system at the Duane Arnold Energy Center (DAEC). The problem relates to the setpoint, function, and installation of the differential pressure (dp) instrument which monitors for a CS pipe break that is located in the annulus area of the reactor vessel (i.e., located outside the core shroud but inside the reactor vessel). The installed instrument, range of 0 - 24 psid, was found deflecting downscale (i.e., reading negative psid) during operation.

The licensee's investigation of the downscale deflection revealed that the original piping arrangement and calibration did not adequately take into account the effect of density changes of the water in the pressure leg connection. The original installation had the high pressure side of the dp instrument (see attached Figure 1) connected to the reference leg in the vessel (Figure 1 Connection X) and the low pressure side to the core spray piping outside the vessel but inside the drywell (Figure 1 Connection Y). With the piping intact, this arrangement senses the pressure difference between bottom and top of core. With a break in CS piping in the annulus area the instrument then senses the additional pressure drop across the separators (dp \approx 7 psi additional) and dryers (dp \approx 7-inches water). This installation was in accordance with GE design requirements.

Also in accordance with GE instructions the calibration of the dp instrument was performed with the reactor in the cold condition and the alarm was set to trip at 5 psid increasing. Because of this cold calibration the dp instrument then indicated full downscale negative during operation. This negative dp was due to the heat up of the reference leg (Figure 1 Connection X) which caused the fluid density to decrease as the plant reached hot conditions. The magnitude of this effect was determined to be about 3.5 psid following completion of the modification discussed below.

1533 338

DUPLICATE DOCUMENT

Entire document previously
entered into system under:

ANO 7910250492
No. of pages: 5