



UNITED STATES  
NUCLEAR REGULATORY COMMISSION  
REGION IV  
611 RYAN PLAZA DRIVE, SUITE 1000  
ARLINGTON, TEXAS 76012

CENTRAL FILES  
PDR:HQ  
~~LPDR~~  
~~IC~~  
NSIC

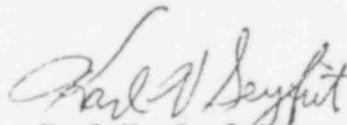
June 7, 1979

Bucket Nos. 50-313  
50-368

Arkansas Power and Light Company  
ATTN: Mr. William Cavanaugh III  
Vice President of Generation  
and Construction  
P. O. Box 551  
Little Rock, Arkansas 72203

Gentlemen:

This Information Notice is provided as an early notification of a possibly significant matter. It is expected that recipients will review the information for possible applicability to their facilities. No specific action or response is requested at this time. If further NRC evaluations so indicate, an IE Circular, Bulletin, or NRR Generic Letter will be issued to recommend or request specific licensee actions. If you have questions regarding this matter, please contact the Director of the appropriate NRC Regional Office.

  
Karl V. Seyfrit  
Director

Enclosures:

1. IE Information Notice  
No. 79-15
2. List of IE Information  
Notices Issued in 1979

cc: James P. O'Hanlon, Plant Manager  
Arkansas Nuclear One  
P. O. Box 608  
Russellville, Arkansas 72801

L. Alexander, QC Supervisor

296 087

79070600/0

UNITED STATES  
NUCLEAR REGULATORY COMMISSION  
OFFICE OF INSPECTION AND ENFORCEMENT  
WASHINGTON, D.C. 20555

IE Information Notice No. 79-15  
Date: June 7, 1979  
Page 1 of 3

DEFICIENT PROCEDURES

Summary

On June 2, 1979, at Arkansas Nuclear One - Unit 1, while observing conditions in the control room, an NRC inspector discovered an operational deficiency that could have resulted in the emergency feedwater system remaining isolated during subsequent power operation.

Description of Circumstances

On June 2 while Arkansas Nuclear One - Unit 1 was preparing for startup, an NRC inspector in the control room found that during a surveillance test of the main feedwater check valves, the controls of the emergency feedwater system were positioned so that the system could not automatically respond if needed. The NRC inspector found that the test procedure being used by the licensed operators did not include, as it should have, instructions either to bypass the emergency feedwater system or to return it to normal. The plant operators, without approved procedures covering this aspect of the test, bypassed the controls that would have started the feedwater system automatically. Lacking a procedural requirement to return the system to normal, there was no assurance that emergency feedwater would be provided automatically if needed.

Following the Three Mile Island accident, the NRC required that operators be trained to initiate promptly the emergency feedwater system manually if it does not come on automatically. Thus, while no immediate safety hazard existed at the Arkansas Unit 1 plant because of the improper action, the NRC staff is concerned about the potential safety hazard of leaving the emergency feedwater system in the bypassed condition, about the possibility that other procedures at the Arkansas plant may be deficient and about the fact that the operators deviated from procedures in performing the surveillance test.

Arkansas Power and Light Company has returned the plant to cold shutdown. The June 2, 1979, NRC Order confirmed the requirement for a cold shutdown until the Commission staff is satisfied with the utility's method of controlling the development of operating procedures, the adequacy of existing procedures, and until there is assurance that operators will not deviate from those procedures.

296 088

DUPLICATE DOCUMENT

Entire document previously entered  
into system under:

ANO 790 7020 181

No. of pages: 7