



UNITED STATES
NUCLEAR REGULATORY COMMISSION
REGION III
799 ROOSEVELT ROAD
GLEN ELLYN, ILLINOIS 60137

TIC

JUN 21 1979

Docket No. 50-483
Docket No. 50-486

Union Electric Company
ATTN: Mr. John K. Bryan
Vice President - Nuclear
P. O. Box 149
St. Louis, MO 63166

Gentlemen:

Enclosed is IE Bulletin No. 79-02 Revision No. 1, which requires action by you with regard to your power reactor facility with an operating license or a construction permit.

Should you have any questions regarding this Bulletin or the actions required by you, please contact this office.

Sincerely,

James G. Keppler
for James G. Keppler
Director

Enclosure: IE Bulletin
No. 79-02 Revision No. 1

cc w/encl:
Mr. W. H. Weber, Manager,
Nuclear Construction
Central Files
Director, NRR/DPM
Director, NRR/DOR
FDR
Local PDR
NSIC
TIC
Region I & IV
Ms. K. Drey
Hon. C. J. Frass, Chairman
Missouri Public Service
Commission

327 008

2
7907120262

U.S. NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT

REGION III

June 21, 1979

IE Bulletin No. 79-02
(Revision No. 1)
(7906200183)

PIPE SUPPORT BASE PLATE DESIGNS USING CONCRETE EXPANSION ANCHOR BOLTS

Description of Circumstances:

Since the issuance of IE Bulletin 79-02 on March 8, 1979, IE inspection experience and many inquiries from licensees indicate that additional information and clarification is needed. This revision is intended to serve that purpose. None of the requirements of the original Bulletin have been deleted, and the due date for completion of the requested actions (July 6, 1979) has not been changed. The following text supersedes the text of Bulletin 79-02. Changes from the original text are identified by lines in the margin. The purpose of this revision is to identify acceptable ways of satisfying the Bulletin requirements. *

While performing inservice inspections during a March-April 1978 refueling outage at Millstone Unit 1, structural failures of piping supports for safety equipment were observed by the licensee. Subsequent licensee inspections of undamaged supports showed a large percentage of the concrete anchor bolts were not tightened properly.

Deficiency reports, in accordance with 10 CFR 50.55(e) filed by Long Island Lighting Company on Shoreham Unit 1, indicate that design of base plates using rigid plate assumptions has resulted in underestimation of loads on some anchor bolts. Initial investigation indicated that nearly fifty percent of the base plates could not be assumed to behave as rigid plates. In addition, licensee inspection of anchor bolt installations at Shoreham has shown over fifty percent of the bolt installations to be deficient.

Vendor Inspection Audits by NRC at Architect Engineering firms have shown a wide range of design practices and installation procedures which have been employed for the use of concrete expansion anchors. The current trends in the industry are toward more rigorous controls and verification of the installation of the bolts.

The data available on dynamic testing of fatigue failures can occur at loads subsistencies due to material imperfections or also show low cycle dynamic failures at due to joint slippage.

327 009

* Lines indicate changes to previous edi

DUPLICATE DOCUMENT

Entire document previously entered into system under:

ANO 7906290232

No. of pages: 9