(177)	LICENSEE EVENT REPORT
	CONTROL BLOCK: (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)
0 1 8	N C B E P 1 2 0 0 - 0 0 0 0 - 0 C 3 4 1 1 1 1 1 4 5 6 EICENSE CODE 14 15 LICENSE NUMBER 25 26 LICENSE TYPE 30 57 CAT 58
CON'T	REPORT L 6 0 5 0 - 10 3 2 5 7 0 6 0 2 7 9 8 0 7 1 8 7 9 9 EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)
0 2	While performing an inspection of pipe supports and hangers in accordance with IE
03	Bulletin 79-07, the following snubbers were found inoperable: 1) 1G41-12SS98, RHR
0 4	discharge to fuel pool cooling; 2) 1E21-2SS31, Core Spray line to vessel;
6 5	3) 1B21-44SS138, vessel head vent; 4) 1E11-90SS275, vessel head spray;
06	5) 1PSN-D3SS71, main steam line "D"; 6) 1G41-12SS33, fuel pool cooling.
0 7	(Technical Specification 3.7.5, 6.9.1.9.b)
0 8	
0 9	SYSTEM CAUSE CAUSE COMPONENT CODE SUBCODE SUBC
	TREPORT TYPE
10	1E21-2SS31 and 1G41-12SS33 had loose bolts in the clamps. These snubbers were aligned
11	and the bolts tightened per procedure. The other four snubbers had a low fluid level
1123	due to leaking seals. These snubbers were rebuilt, functionally tested, and returned
1 3	to service. Snubber inspections will continue per Technical Specificacions.
1 4 3	9
1 5	G 28 0 0 0 0 29 NA OTHER STATUS 30 METHOD OF DISCOVERY DESCRIPTION CONTENT 12 13 44 45 46 SINCE STATUS 30 METHOD OF DISCOVERY DESCRIPTION CONTENT 12 13 80
	ELEASED OF RELEASE AMOUNT OF ACTIVITY (35) NA LOCATION OF RELEASL (36) PERSONNEL EXPOSURES 44 45 80
1 7	9 PERSONNEL INJURIES DESCRIPTION (39) 11 12 13 80
1 8	NUMBER DESCRIPTION (41) NA 12
1 9	LOSS OF OR DAMAGE TO FACILITY 43 TYPE DESCRIPTION 790725 0 320
20	PUBLICITY SSUED DESCRIPTION 45 NRC USE ONLY NRC USE ONLY
	9 10 68 69 80 3 NAME OF PREPARED A. C. Tollison, Jr. 919-457-9521