

TIC



UNITED STATES
NUCLEAR REGULATORY COMMISSION
REGION II
101 MARIETTA ST., N.W., SUITE 3100
ATLANTA, GEORGIA 30303

JUL 11 1979


In Reply Refer To:
RII:JPO
50-395

South Carolina Electric and Gas Company
ATTN: M. C. Johnson, Vice President
Special Services and Purchasing
P. O. Box 764
Columbia, SC 29218

Gentlemen:

The enclosed Bulletin No. 79-15 is forwarded to you for action. A written response is required. If you desire additional information regarding this matter, please contact this office.

Sincerely,


James P. O'Reilly
Director

Enclosures:

1. IE Bulletin No. 79-15
2. Listing of IE Bulletins
Issued in Last 12
Months

7907310386

(//)

646 128

South Carolina Electric
and Gas Company

-2-

cc w/encl:

T. B. Conners, Jr.
Conners, Moore and Corber
1747 Pennsylvania Avenue, N.W.
Washington, D.C. 20006

A. A. Smith
Quality Assurance
Post Office Box 8
Jenkinsville, South Carolina 29065

O. S. Bradham, Manager
Nuclear Operations
Post Office Box 8
Jenkinsville, South Carolina 29065

646 129

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON, D.C. 20555

July 11, 1979

IE Bulletin No. 79-15

DEEP DRAFT PUMP DEFICIENCIES

Description of Circumstances:

On October 20, 1978, Commonwealth Edison Company reported that manufacturing deficiencies had been identified in new high pressure core spray, low pressure core spray, and residual heat removal pumps manufactured by Ingersoll-Rand (I-R) Company, Cameron Pump Division.

Each of these pumps is a vertical turbine pump with impellers located in bowls in a sump or a self contained barrel. The motor (prime mover) is located at the highest pump elevation to take into account maximum flooding at the site or space considerations. The suction is at the lower end of the pump while the discharge head is just below the driver. Bearings supporting the vertical shaft segments (usually 5 to 10 segments) are either self lubricated, force fed (lubricated by fluid being pumped), or oil lubricated and maintained within their own isolated system. These pumps are designated as "Deep Draft". Figures 1&2 show typical outlines of such pumps.

The internal deficiencies, identified through dimensional and visual inspections were as follows:

Low Pressure Core Spray Pumps (I-R Model No. 29APKD-5) (Date of Manufacture - February 1973)

- . Loose impeller bolts and bolts improperly staked
- . Loose key - keyway fit
- . Excessive runout on pump shaft
- . Bearing showed wear
- . Bearing clearance exceeded recommended tolerance
- . Coupling thread galled
- . Wear ring clearance out-of-specification
- . Impeller-to-shaft clearance out of specification
- . Cracks found in second-and-third-stage impellers
- . Stuffing box bushings were severe

High Pressure Core Spray Pumps (I-R September 1972)

- . Bearing clearance exceeded record
- . Wear ring clearance out-of-spec
- . Bearings showed wear

646 130

DUPLICATE DOCUMENT

Entire document previously entered
into system under:

ANO 7907180125

No. of pages: 9