



UNITED STATES
NUCLEAR REGULATORY COMMISSION
REGION I
631 PARK AVENUE
KING OF PRUSSIA, PENNSYLVANIA 19406

POR

June 25, 1979

Docket Nos. 50-289
50-320

Metropolitan Edison Company
ATTN: Mr. J. G. Herbein
Vice President
P. O. Box 542
Reading, Pennsylvania 19640

Gentlemen:

The enclosed Bulletin 79-13 is forwarded to you for information. No written response is required. If you desire additional information regarding this matter, please contact this office.

Sincerely,

James M. Allan
Boyce H. Grier
Director

Enclosures:

1. IE Bulletin No. 79-13 w/Attachments
2. List of IE Bulletins
Issued in Last 12 Months

cc w/encls:

E. G. Wallace, Licensing Manager
J. J. Barton, Project Manager
L. L. Lawyer, Manager - Generation Operations
G. P. Miller, Manager - Generating Station - Nuclear
J. L. Seelinger, Unit 1 Superintendent
W. E. Potts, Unit 1 Superintendent - Technical Support
J. B. Logan, Unit 2 Superintendent
G. A. Kunder, Unit 2 Superintendent - Technical Support
I. R. Finfrock, Jr.
Mr. R. Conrad
G. F. Trowbridge, Esquire
Miss Mary V. Southard, Chairman, Citizens for a Safe Environment

7907180365

364 098

Q

ENCLOSURE 1

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON, D.C. 20555

IE Bulletin No. 79-13
Date: June 25, 1979
Page 1 of 4

CRACKING IN FEEDWATER SYSTEM PIPING

Description of Circumstances:

On May 20, 1979, Indiana and Michigan Power Company notified the NRC of cracking in two feedwater lines at their D. C. Cook Unit 2 facility. The cracking was discovered following a shutdown on May 19 to investigate leakage inside containment. Leaking circumferential cracks were identified in the 16-inch feedwater elbows adjacent to two steam generator nozzle elbow welds. Subsequent radiographic examination revealed crack indications in all eight steam generator feedwater lines at this location on both Units 1 and 2.

On May 25, 1979, a letter was sent to all PWR licensees by the Office of Nuclear Reactor Regulation which informed licensees of the D. C. Cook failures and requested specific information on feedwater system design, fabrication, inspection and operating histories. To further explore the generic nature of the cracking problem, the Office of Inspection and Enforcement requested licensees of PWR plants in current outages to immediately conduct volumetric examination of certain feedwater piping welds.

As a result of these actions, several other licensees with Westinghouse steam generators reported crack indications. Southern California Edison reported on June 5, 1979, that radiographic examination revealed indications of cracking in feedwater nozzle-to-piping welds on two of three steam generators of San Onofre Unit 1. On June 15, 1979, Carolina Power and Light reported that radiography showed crack indications in similar locations at their H. B. Robinson Unit 2. Duquesne Power and Light confirmed on June 18, 1979, that radiography has shown cracking in their Beaver Valley Unit 1 feedwater piping to vessel nozzle weld. Public Service Electric and Gas Company reported on June 20, 1979 that Salem Unit 1 also has crack indications. Wisconsin Public Service company decided on June 20, 1979 to cut out a feedwater nozzle-to-pipe weld which contained questionable indication, for metallurgical examination. As of June 22, 1979 and since May 15, 1979 seven other PWR facilities have inspected the feedwater nozzle-to-pipe welds without finding cracking indications.

The feedwater nozzle-to-pipe configurations for D.C. Cook and for San Onofre are shown on the attached figures 1 and 2. weld joint detail showing the principal are shown on the attached figure 3.

On March 17, 1977, during heat-up for ho Unit 1, a leak was discovered in the ves the 16-inch diameter feedwater piping to nondestructive examination of all nozzle

DUPLICATE DOCUMENT

Entire document previously entered into system under:

ANO 7906250348

No. of pages: 11

364 099