

# UNITED STATES NUCLEAR REGULATORY COMMISSION REGION I 631 PARK AVENUE

KING OF PRUSSIA, PENNSYLVANIA 19406

August 10, 1979

Docket No. 50-213

Connecticut Yankee Atomic Power Company

ATTN: Mr. W. G. Counsil

Vice President - Nuclear Engineering and Operations

P. O. Box 270

Hartford, Connecticut 06101

#### Gentlemen:

Enclosed is IE Bulletin No. 79-19, which requires action by you with regard to your reactor and/or facility(ies) with an operating license.

Should you have questions regarding this Bulletin or the actions required of you, please contact this office.

Sincerely,

Boyce H. Grier

Enclosures:

IE Bulletin No. 79-19
 List of Bulletins Issued

in Last Six Months

cc w/encls:

R. Graves, Plant Superintendent

D. G. Diedrick, Manager of Quality Assurance

J. R. Himmelwright, Licensing Safeguards Engineer

903127

### ENCLOSURE 1

# UNITED STATES NUCLEAR REGULATORY COMMISSION OFFICE OF INSPECTION AND ENFORCEMENT WASHINGTON, D.C. 20555

IE Bulletin No. 79-19 Date: August 10, 1979 Page 1 of 3

PACKAGING OF LOW-LEVEL RADIOACTIVE WASTE FOR TRANSPORT AND BURIAL

Description of Circumstances:

Low-level radioactive waste is that waste which can be transferred and shipped to one of three waste burial facilities which are located in and licensed by the Agreement States of Nevada, South Carolina, and Washington. On July 10, 1979, the Governors of the three states notified NRC Chairman Hendrie of the serious and repeated disregard for rules governing the shipments of low-level radioactive wastes to these burial facilities.

Examples of violations of Agreement State, DOT and NRC rules follow:

Improperly packaged uranium fines igniting packaged liquid scintillation vials in combustible waste is believed to have caused a fire and destruction of a truck at the Beatty, Nevada burial facility on May 14, 1979.

On July 2, 1979, three of twelve steel containers shipped to the Beatty burial facility were found to be leaking radioactive material. The material was described on the bill of lading as being a solid inorganic salt (evaporator concentrates solidified with urea formaldehyde) from a reactor facility. The Governor of the State of Nevada ordered the drums to be shipped out of the state and the burial facility was temporarily closed.

On July 30, the first shipment into the reopened Beatty facility contained free liquid in "solid" material. The radioactive contents were sand filters used at an insitu leaching process at a uranium mill.

Forty-three shipments with sixty-three deficiencies were observed during the package inspection program between April 10 and July 5, 1979, by the Agreement State of South Carolina, at the Barnwell, S.C. burial facility. The shipments were from reactor, medical, industrial and military facilities.

On June 28, 1979, the Federal Highway Administration issued a Notice of Violation to a reactor facility proposing a \$10,000 fine for truck contamination resulting from improper closures on 55-gallon grums of LSA material and for improper loading of the drums on the vehicle.

These are a few examples of shipments of radioactive material to burial facilities which did not fully meet NRC, DOT and Agreement State requirements which were developed to protect the health and safety of the public. The Governors of the three States with licensed burial facilities have indicated that if the situation is not rectified, they may have to initiate actions which would deny use of the three burial sites by violators.

IE Bulletin No. 79-19 Date: August 10, 1979 Page 2 of 3

Sources of Information:

The DOT regulatory requirements can be found in 49 CFR Parts 170-179. The NRC regulatory requirements can be found in 10 CFR Parts 19 to 71. The NRC regulatory requirements for Agreement State licensees in non-agreement states are in 10 CFR Part 150. Copies of the regulations may be purchased from the Superintendent of Documents, U. S. Government Printing Office, Washington, D.C. 20402.

Information about licensing requirements for NRC packages can be obtained from the NRC Transportation Branch (301-427-4122). Information about DOT packaging and transport requirements can be obtained by calling the DOT Office of Hazardous Materials (202-426-2311).

Action To Be Taken By Licensees:

To assure the safe transfer, packaging, and transport of low-level radioactive waste, each licensee is expected to:

- Maintain a current set of DOT and NRC regulations concerning the transfer, packaging and transport of low-level radioactive waste material.
- 2. Maintain a current set of requirements (license) placed on the waste burial firm by the Agreement State of Nevada, South Carolina, or Washington before packaging low-level radioactive waste material for transfer and shipment to the Agreement State licensee. If a waste collection contractor is used, obtain the appropriate requirements from the contractor.
- 3. Designate, in writing, people in your organization who are responsible for the safe transfer, packaging and transport of low-level radioactive material.
- 4. Provide management-approved, detailed instructions and operating procedures to all personnel involved in the transfer, packaging and transport of lowlevel radioactive material. Special attention should be given to controls on the chemical and physical form of the low-level radioactive material and on the containment integrity of the packaging.
- 5. Provide training and periodic retraining in the DOT and NRC regulatory requirements, the waste burial license requirements, and in your instructions and operating procedures for all personnel involved in the transfer, packaging and transport of radioactive material. Maintain a record of training dates, attendees, and subject material for future inspections by NRC personnel.
- 6. Provide training and periodic retraining to those employees who operate the processes which generate waste to assure that the volume of low-level radioactive waste is minimized and that such waste is processed into acceptable chemical and physical form for transfer and shipment to a low-level radioactive waste burial facility.

IE Bulletin No. 79-19 Date: August 10, 1979 Page 3 of 3

- 7. Establish and implement a management-controlled audit function of all transfer, packaging and transport activities to provide assurance that personnel, instructions and procedures, and process and transport equipment are functioning to ensure safety and compliance with regulatory requirements.
- 8. Perform, within 60 days of the date of this bulletin, a management-controlled audit of your activities associated with the transfer, packaging and transport of low-level radioactive waste. Maintain a record of all audits for future inspections by NRC or DOT inspectors. (Note: If your have an established audit function and have performed such an audit of all activities in Items 1-6 within the past six months, this audit requirement is satisfied.)
- 9. Report, in writing within 45 days, your plan of action and schedule with regard to the above items. In addition, provide responses to the three questions below. Reports should be submitted to the Director of the appropriate NRC Regional Office and a copy should be forwarded to the NRC Office of Inspection and Enforcement, Division of Fuel Facility and Materials Safety Inspection, Washington, D.C. 20555.

Provide answers for 1978 and for the first six months of 1979 to the following questions:

1. How many low-level radioactive waste shipments did you make? What was the volume of low-level radioactive waste shipped?

(Power reactor licensees who report this information in accordance with Technical Specifications do not need to respond to this question.)

What was the quantity (curies) of low-level radioactive waste shipped? What were the major isotopes in the low-level radioactive waste?

(Power reactor licensees who report this information in accordance with Technical Specifications do not need to respond to this question.)

3. Did you generate liquid low-level radioactive waste? If the answer is 'yes,' what process was used to solidify the liquid waste?

Licensees who do not generate low-level radioactive waste should so indicate in their responses and do not need to take other actions specified in the above items.

Approved by GAO, B180225 (R0072); clearance expires 7-31-80. Approval was given under a blanket clearance specifically for identified generic problems.

IE Bulletin No. 79-19 Date: August 10, 1979 Page 1 of 4

### ENCLOSURE 2

## LISTING OF IE BULLETINS ISSUED IN LAST SIX MONTHS

Bulletin No.	Subject	Date Issued	Issued To
78 <b>-</b> 12B	Atypical Weld Material in Reactor Pressure Vessel Welds	3/19/79	All Power Reactor Facilities with an OL or CP
79-01A	Environmental Qualification of Class 1E Equipment (Deficiencies in the Environmental Qualification of ASCO Solenoid Valves)		All Power Reactor Facilities with an OL or CP
79-02 (Rev 1)	Pipe Support Base Plate Design Using Concrete Expansion Anchor Bolts	6/21/79	All Power Reactor Facilities with an OL or CP
79-03	Longitudinal Weld Defects in ASME SA-312 Type 304 Stainless Steel Pipe Spools Manufactured by Youngstown Welding and Engineering Company	3/12/79	All Power Reactor Facilities with an OL or CP
79-04	Incorrect Weights for Swing Check Valves Manufactured by Velan Engineering Corporation	3/30/79	All Power Reactor Facilities with an OL or CP
79-05	Nuclear Incident at Three Mile Island	4/1/79	All Babcock and Wilcox Power Reactor Facilities with an OL, Except Three Mile Island 1 and 2 (For Action), and All Other Power Reactor Facilities With an OL or CP (For Information)

IE Bulletin No. 79-19 Date: August 10, 1979 Page 2 of 4

## LIST OF IE BULLETINS ISSUED IN LAST SIX MONTHS (CONTINUED)

Bulletin No.	Subject	Date Issued	Issued To
79-05A	Nuclear Incident at Three Mile Island - Supplement	4/5/79	Same as 79-05
79-058	Nuclear Incident at Three Mile Island - Supplement	5/21/79	Same as 79-05
79-06	Review of Operational Errors and System Mis- alignments Identified During the Three Mile Incident	4/11/79	All Pressurized Water Power Reactor Facil- ities with an OL Except B&W Facilities (For Action), All Other Power Reactor Facil- ities with an OL or CP (For Information)
79-06A	Same Title as 79-06	4/14/79	All Westinghouse Designed Pressurized Power Reactor Facil- ities with an OL (For Action), and All Other Power Reactor Facilities with an OL or CP (For Information)
79-06A (Revision 1)	Same Title as 79-06	4/18/79	All Westinghouse Designed Pressurized Power Reactor Facil- ities with an OL (For Action), and All Other Power Reactor Facilities with an OL or CP (For Information)

IE Bulletin No. 79-19 Date: August 10, 1979 Page 3 of 4

## LISTING OF IE BULLETINS ISSUED IN LAST SIX MONTHS (CONTINUED)

Bulletin No.	Subject	Date Issued	Issued To
79-068	Same Title as 79-06	4/14/79	All Combustion Engineering Designed Pressurized Power Reactor Facilities with an OL (For Action), and All Other Power Reactor Facilities with an OL or CP (For Information)
79-05C&06C	Nuclear Incident at Three Mile Island - Supplement	7/26/79	All PWR Power Reactor Facilities with an OL
79-07	Seismic Stress Analysis of Safety-Related Piping	4/14/79	All Power Reactor Facilities with an OL or CP
79-08	Events Relevant to Boiling Water Power Reactors Identified During Three Mile Island Incident	4/14/79	All BWR Power Reactor Facilities with an OL (For Action), All Other Power Reactor Facil- ities with an OL or CP (For Information)
79-09	Failures of GE Type AK-2 Type Circuit Breaker in Safety Related Systems	4/17/79	All Power Reactor Facilities with an OL or CP
79-10	Requalification Training Program Statistics	5/11/79	All Power Reactor Facilities with an OL

IE Bulletin No. 79-19 Date: August 10, 1979 Page 4 of 4

## LISTING OF IE BULLETINS ISSUED IN LAST SIX MONTHS (CONTINUED)

Bulletin No.	Subject	Date	Issued	Issued To
79-11	Faulty Overcurrent Trip Device in Circuit Breakers for Engineered Safety Systems		5/22/79	All Power Reactor Facilities with an OL or CP
79-12	Short Period Scrams at BWR Facilities		5/31/79	All GE BWR Facilities with an OL
79-13	Cracking in Feedwater System Piping		6/25/79	All PWRs with an OL (for Action), All Other Power Reactor Facilities with an OL or CP (For Information)
79-14	Seismic Analysis for As-Built Safety Related Piping Systems		7/2/79	All Power Reactor Facilities with an OL or CP
79-15	Deep Draft Pump Defi- ciencies		7/11/79	All Power Reactor Facilities with an OL or CP
79-16	Vital Area Access Con- trols		7/30/79	All Holders of and Applicants for Reactor Operating Licenses
79-17	Pipe Cracks in Stagnant Borated Water Systems at PWR Plants		7/26/79	All PWR Power Reactor Facilities with an OL
79-18	Audibility Problems Encountered on Evacuation of Personnel From High Noise Areas		8/7/79	All Power Reactor Facilities with an OL