

NUCLEAR REGULATORY COMMISSION REGION II 101 MARIETTA ST., N.W., SUITE 3100 ATLANTA, GEORGIA 30303

In Reply Refer To: RII:JPO 50-424 50-425

AUG 2 0 1979

Georgia Power Company
ATTN: J. H. Miller, Jr.
Executive Vice President
270 Peachtree Street
Atlanta, GA 30303

Gentamen:

Enclosed is IE Bulletin No. 79-02, Revision 1, Supplement No. 1, which is forwarded to you for information. No written response is required. If you desire additional information regarding this matter, please contact this office.

Sincerely,

James P. O'Reilly Director

Enclosures:

1. IE Bulletin No. 79-02, Revision No. 1 (Supplement No. 1)

Listing of IE Bulletins
 Issued in Last Six Months

POOR

7909070261

cc w/encl: K. M. Gillespie Construction Project Manager Post Office Box 282 Waynesboro, Georgia 30830

E. D. Groover QA Site Supervisor Post Office Box 28. Waynesboro, Georgia 30830

SSINS: 6820 Accession No: 7908150164

UNITED STATES NUCLEAR REGULATORY COMMISSION OFFICE OF INSPECTION AND ENFORCEMENT WASHINGTON, D.C. 20555

August 20, 1979

IE Bulletin No. 79-02 Revision No. 1 (Supplement No. 1)

PIPE SUPPORT BASE PLATE DESIGNS USING CONCRETE EXPANSION ANCHOR BOLTS

Description of Circumstances:

The supplement to IE Bulletin No. 79-02 is intended to establish criteria for the evaluation of interim acceptability of plant operation with less than the design factors of safety for piping supports due to as-built problems, under design, base plate flexibility, or anchor bolt deficiencies.

In the reviews for system operability of the Duane Arnold and Crystal River facilities, criteria have been developed by the NRC staff that defines pipe support operability. The criteria has been applied in lieu of other analysis or evaluation. Specifically, the licensees identified problems with pipe supports in which the original design factors of safety were not met but some lesser margin was available. The design margins of four or five are intended to be final design and installation objectives but systems may be classed as operable on an interim basis with some lesser margin providing a program of restoration to at least the Bulletin factors of safety has been developed. Facilities which fall outside the operability criteria are considered to probably require a Technical Specification exception and will require review on a case by case basis.

Action to be Taken by Licensees:

For the following two cases, plant operation may continue or may begin:

- a. For the support as a unit, the factor of safety compared to ultimate strengths is less than the original design but equal to or greater than two.
- b. For the anchor bolts the factor of safety is equal to or greater than two and for the support steel the original design factor of safety compared to ultimate strengths is met.

The above criteria may be applied graded to design margins of safety DUPLICATE DOCUMENT and by the next refueling for nona fined in Bulletin No. 79-14 where of the plant which can be entered

ffected systems are up-

Entire document previously entered into system under:

No. of pages: