



TIC

UNITED STATES
NUCLEAR REGULATORY COMMISSION
REGION II
101 MARIETTA ST., N.W., SUITE 3100
ATLANTA, GEORGIA 30303

NOV 5 1979

 
In Reply Refer To:
RII:JPO
50-437

Offshore Power Systems
Attn: A. R. Collier, President
P. O. Box 8000
Jacksonville, Florida 32211

Gentlemen:

This Information Notice is provided as an early notification of a possibly significant matter. It is expected that recipients will review the information for possible applicability to their facilities. No specific action or response is requested at this time. If further NRC evaluations so indicate, an IE Circular, Bulletin, or NRR Generic Letter will be issued to recommend or request specific licensee actions. If you have questions regarding the matter, please contact the Director of the appropriate NRC Regional Office.

Sincerely,


James P. O'Reilly
Director

Enclosures:

1. IE Information Notice
No. 79-26
2. List of IE Information
Notices Issued in the
Last Six Months

1351 291

7911160 384

SSINS: 6870
Accession No:
7908220133

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON, D. C. 20555

November 5, 1979

IE Information Notice No. 79-26

BREACH OF CONTAINMENT INTEGRITY

Description of Circumstances:

On September 14, 1979, the Consumers Power Company (CPC) notified the NRC of discovery at the Palisades Nuclear Generating Plant of a valve misalignment that had resulted in containment integrity being breached for an indeterminate length of time.

While preparing to perform a Type "C" leak test between two manual valves in a 3" bypass line around the main 48" containment purge valve, plant personnel discovered that both of these manual isolation valves were locked in the open position. These valves should have been locked closed. Investigation by the licensee indicated that the valves may have been improperly positioned since April, 1978, when an efficiency test of the bypass line filters was performed. The plant has operated at power for the major portion of that time period.

The valve misalignment had no actual impact on the public health. However, in the event of a design basis accident wherein fuel damage and release of primary coolant inside the containment are postulated, the open valves would provide a significant path for a radioactive release from the containment.

The initial design purpose for the bypass system was to provide a long term hydrogen control capability for the containment atmosphere following a design basis accident.^{1/} It was intended that after approximately 30 days following an accident, when containment pressure and activity levels dropped sufficiently to permit venting, this system would be manually valved to vent the containment atmosphere, through high efficiency and charcoal filters, to the exhaust stack. Thus the components in the bypass line beyond the two manual isolation valves were not designed for the severe service they would be exposed to with the valves open during the initial pressure surge of the design basis accident, and significant uncontrolled release would result. High radiation in the vicinity of the bypass line would also make immediate closing of the manual isolation valves, even if identified as the source of leakage, an extremely hazardous

The principal cause for this event was proper use and positioning of these valve line-up checklist, which is performed

^{1/} Current NRC requirements call for the hydrogen buildup. Palisades has recombi

DUPLICATE DOCUMENT

Entire document previously entered into system under:

ANO 7908220133

No. of pages: 4

1351 292