



UNITED STATES  
NUCLEAR REGULATORY COMMISSION  
REGION II  
101 MARIETTA ST., N.W., SUITE 3100  
ATLANTA, GEORGIA 30303

MAY 22 1979

In Reply Refer To:

RIL:JPO

50-339

50-404

50-405

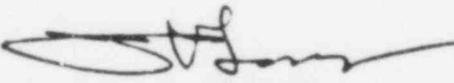
Virginia Electric and Power Company  
ATTN: W. L. Proffitt  
Senior Vice President, Power  
P. O. Box 26666  
Richmond, VA 23261

Gentlemen:

Enclosed is IE Bulletin 79-11 which requires action by you with regard to your power reactor facility(ies) with an operating license or a construction permit.

Should you have questions regarding this Bulletin or the actions required of you, please contact this office.

Sincerely,

  
James P. O'Reilly  
Director

Enclosures:

1. IE Bulletin 79-11
2. List of IE Bulletins  
Issued in Last  
Twelve Months

836 150

7907110127

MAY 22 1979

Virginia Electric and  
Power Company

-2-

cc w/encl:  
W. R. Cartwright, Station Manager  
Post Office Box 402  
Mineral, Virginia 23117

P. G. Perry  
Senior Resident Engineer  
Post Office Box 38  
Mineral, Virginia 23117

835 156

UNITED STATES  
NUCLEAR REGULATORY COMMISSION  
OFFICE OF INSPECTION AND ENFORCEMENT  
WASHINGTON, D.C. 20555

May 22, 1979

IE Bulletin No. 79-11

FAULTY OVERCURRENT TRIP DEVICE IN CIRCUIT BREAKERS FOR ENGINEERED  
SAFETY SYSTEMS

Discussion:

We have received information from Westinghouse and an NRC licensee relating to the potential failure of a circuit breaker in an engineered safety system of a nuclear power plant. This circuit breaker had a defect in one of its three time delay dashpots which resulted in a reduced time delay for overcurrent protection. The defect was a small hairline crack in the end cap of the dashpot. Further investigation by this licensee disclosed that 7 out of 17 spare dashpot end caps and 2 non-engineered safety feature breakers also had similar defects. The circuit breaker is a Westinghouse type DB-75. Westinghouse type DB-50 breakers also use the same type of dashpot and end cap. DB-50 and -75 breakers are used extensively in PWR's, and some BWR's may also have the same breakers.

Similar make and model circuit breakers, when used for scram purposes, do not require the overcurrent trip feature and thus are not of concern. The end cap crack defect, if severe enough, could result in premature tripping of the circuit breaker because of insufficient time delay in overcurrent protection, i.e., the motor starting (inrush) current could cause the breaker to trip inadvertently and thus prevent the motor start.

The defects reported by the licensee in April 1979, occurred in the replacement end caps which were provided to solve the problem described in IE Bulletin 73-1. The subject of Bulletin 73-1 was end caps made of a black phenolic material. As a result of that Bulletin, the black end caps were replaced with a new type made of fibre-filled polyester material called "navy-gray". Prior to the April 1979 report, there have been no reports of suspect "navy-gray" end caps either from scheduled testing or unusual behavior in service. The manufacturer of the "navy-gray" end caps believes the crack defects may be linked to a raw material batch problem. That is, the molding ingredient materials used may have neared the end of their shelf life before use. It is not believed the end caps, after fabrication, have a significant shelf life limit, due to the low residual stress and low crack propagation probabilities.

DUPLICATE DOCUMENT

836 157

Entire document previously entered  
into system under:

ANO 790613C037

No. of pages: 6