

TIC



UNITED STATES  
NUCLEAR REGULATORY COMMISSION  
REGION II  
101 MARIETTA ST., N.W., SUITE 3100  
ATLANTA, GEORGIA 30303

DEC 7 1979

In Reply Refer To:

RII:JPO

50-348

50-364

Alabama Power Company  
Attn: F. L. Clayton, Jr.  
Senior Vice President  
Post Office Box 2641  
Birmingham, Alabama 35291

Gentlemen:

Enclosed is IE Bulletin No. 79-28 which requires action by you with regard to your power reactor facility(ies) with an operating license or a construction permit.

Should you have questions regarding this Bulletin or the actions required of you, please contact this office.

Sincerely,

James P. O'Reilly  
Director

Enclosures:

1. IE Bulletin No. 79-28 w/its Attachment
2. List of Recently Issued IE Bulletins

1828 207

Alabama Power Company

-2-

cc w/encl:

A. R. Barton  
Executive Vice President  
Post Office Box 2641  
Birmingham, Alabama 35291

J. T. Young  
Vice President-Production  
Post Office Box 2641  
Birmingham, Alabama 35291

C. Biddinger, Jr.  
Manager-Corporate Quality Assurance  
Post Office Box 2641  
Birmingham, Alabama 35291

H. O. Thrash  
Manager-Nuclear Generation  
Post Office Box 2641  
Birmingham, Alabama 35291

H. G. Hairston, III  
Plant Manager  
Drawer 470  
Ashford, Alabama 36312

R. E. Hollands, Jr.  
QA Supervisor  
Post Office Box U  
Ashford, Alabama 36312

1829 208

UNITED STATES  
NUCLEAR REGULATORY COMMISSION  
OFFICE OF INSPECTION AND ENFORCEMENT  
WASHINGTON, D.C. 20555

SSINS No.: 6820  
Accession No.:  
7910250505

December 7, 1979

IE Bulletin No. 79-28

POSSIBLE MALFUNCTION OF NAMCO MODEL EA180 LIMIT SWITCHES AT ELEVATED  
TEMPERATURES

Description of Circumstances:

The NRC has been recently advised through a 10 CFR 21 report from Namco Controls that a malfunction of a Namco Model EA180 stem mounted limit switch (SMLS) occurred at the Cooper Nuclear Station. Investigation into the switch failure by the licensee revealed yellow and brown "crystal-like" resin deposits on the internal components of the switch. The affected switch is located inside the drywell containment at this facility and was being used as the replacement switch for an unqualified SMLS previously identified in IE Bulletin Nos. 78-04 and 79-01.

According to the manufacturer, the problem was traced to a batch of top cover gaskets of which some were over-impregnated and insufficiently heat cured. It has been determined that this condition can leave an uncured residue of "Loctite" in the gasket, which vaporizes at sustained temperatures above 175°F. To correct the problem, the manufacturer has revised production techniques beginning September 1979 in order to better control the impregnation process and to properly heat cure the gaskets following impregnation. This problem is unique to all Namco Model EA180 series switches received by licensees after March 1, 1979. According to the manufacturer, the suspect switches can be identified by checking the date code which is a 4 digit number stamped on the conduit boss of the switch housing. Namco recommends that any EA180 series switch with a date code between 02-79 through 08-79 should have its top cover gasket replaced. Also, licensees should request from their suppliers of equipment on which Namco EA180 series switches are used that they check their inventory and replace top cover gaskets on switches date coded between 02-79 through 08-79.

The enclosed letter from Namco further describes the high-temperature environmental problem with the top cover gaskets used in their EA180 switches and provides recommendations to correct the problem. According to Namco, this letter has been sent to each customer who was shipped EA180 switches between February 21, 1979, and August 24, 1979.

Action to be Taken by Licensees of Power  
Holders of Construction Permits:

1. Determine if your facility has installed switches in any safety-related equipment containment, including valve position containment isolation valves.

1829 209

DUPLICATE DOCUMENT

Entire document previously  
entered into system under:

ANO

No. of pages: 4