

UNITED STATES
NUCLEAR REGULATORY COMMISSION
REGION IV
8 RYAN PLAZA DRIVE, SUITE 1000
ARLINGTON, TEXAS 76010

bcc to DAC:ADM:
CENTRAL FILES
PDR:HQ
TIC
NSIC
LIPOR
STATE

January 17, 1980

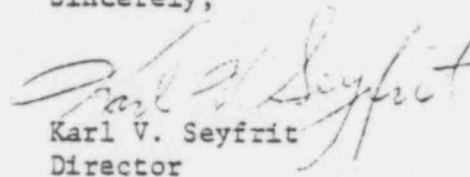
Docket No. 50-285

Omaha Public Power District
ATTN: W. C. Jones, Division Manager -
Production Operations
1623 Earney Street
Omaha, Nebraska 68102

Gentlemen:

The enclosed IE Circular No. 80-01 is forwarded to you for information and, if applicable, necessary action in accordance to the attached General Electric Company Service Advice 721-162.2. No written response to this Circular is required. If you have any questions related to the subject, please contact this office.

Sincerely,


Karl V. Seyfrit
Director

Enclosures:

1. IE Circular No. 80-01
2. List of IE Circulars Recently Issued

cc: S. C. Stevens, Manager
Fort Calhoun Station
Post Office Box 98
Fort Calhoun, Nebraska 68102

1832 042

8001290067

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON, D.C. 20555

SSINS No.: 6830
Accessions No.:
7912190644

IE Circular No. 80-01
January 17, 1980
Page 1 of 1

SERVICE ADVICE FOR GENERAL ELECTRIC INDUCTION DISC RELAYS

Alabama Power Company reported to the NRC on October 16, 1979 a potential problem with certain General Electric Company induction disc type protective relays. A higher than normal pick-up value was caused by petroleum jelly lubricant which under high temperature conditions can migrate to the backstop. At room temperature the lubricant can become adhesive and cause pickup values to be higher than setpoint values.

General Electric (GE) laboratory confirmed some higher than normal pickup values and recommended that users determine whether relays meeting the following criteria are in use at their facilities:

- (1) Relay type: IAC, IAV, ICR, or IJCV, AND
- (2) The relay date code (which is printed on a 3/4" x 3/8" sticker affixed to the relay cradle) has a number less than 50, followed by any of the following two letter codes:
 - (a) Any first letter followed by H, J, K, L, or M; or
 - (b) The letter combinations AN, BN, CN, DN, EN, DG, EG, FG, GG, HG, JG, KG, LG or MG.

For example, 31GK would be considered, while 50 GK or 23HN would not be considered.

Experience has shown that the cleaning procedure recommended in GE Service Advice 721-162.1 may not in all cases remove all of the petroleum jelly which is lodged in place.

Based on the above, licensees are advised to apply G.E. Service Advice 721-162.2 (Enclosure A) to all relays that fall within the above two criteria.

No written response to this Circular is required. If you desire additional information regarding this matter contact the Director of the appropriate NRC Regional Office.

Attachment:
Enclosure A

1832 043

DUPLICATE DOCUMENT

Entire document previously
entered into system under:

ANO 7912190644

No. of pages: 5