

LICENSEE EVENT REPORT

CONTROL BLOCK: _____ (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0 1 M D C C N 2 0 0 - 0 0 0 0 0 0 - 0 0 4 1 1 1 1 _____
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

CON'T
0 1 REPORT SOURCE L 0 5 0 0 0 3 1 8 1 2 2 6 7 9 0 1 2 5 8 0
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES
0 2 CEA motion inhibit was inoperable from 1045 to 1107 on December 26, 1979,
0 3 and from 1030 to 1413 on December 28, 1979. These two out of service periods
0 4 were made necessary by repairs made to the metrascope. The CEA drive system
0 5 was placed in manual and CEA's withdrawn as required by T.S. 3.1.3.1 action
0 6 3. The redundant CEA indication system remained operable throughout these
0 7 events. This is not a repetitive occurrence.

0 8 _____
7 8 9
0 9 SYSTEM CODE R B CAUSE CODE E CAUSE SUBCODE X COMPONENT CODE I N S T R U COMP. SUBCODE I VALVE SUBCODE Z
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

17 LER/RO REPORT NUMBER 7 9 EVENT YEAR 7 9 SEQUENTIAL REPORT NO. 0 5 2 OCCURRENCE CODE 0 3 REPORT TYPE L REVISION NO. 0
ACTION TAKEN B EFFECT ON PLANT Z SHUTDOWN METHOD Z HOURS 0 0 0 0 0 ATTACHMENT SUBMITTED N NPRD-4 FORM SUB. N PRIME COMP. SUPPLIER N COMPONENT MANUFACTURER M 2 8 5
33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS
1 0 The cause of these events was found to be worn lands on the Metrascope
1 1 Master Alarm Card resulting in improper connection with the printed circuit
1 2 board's connector causing an out of sequence alarm to be initiated. The
1 3 board was repaired and replaced into the Metrascope. No preventive action
1 4 is deemed necessary.

1 5 FACILITY STATUS E % POWER 1 0 0 OTHER STATUS NA METHOD OF DISCOVERY A DISCOVERY DESCRIPTION Operator Observation
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

1 6 ACTIVITY CONTENT Z AMOUNT OF ACTIVITY NA LOCATION OF RELEASE NA
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

1 7 PERSONNEL EXPOSURES b 0 0 0 DESCRIPTION NA
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

1 8 PERSONNEL INJURIES 0 0 0 DESCRIPTION NA
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

1 9 LOSS OF OR DAMAGE TO FACILITY z DESCRIPTION NA
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

2 0 PUBLICITY ISSUED N DESCRIPTION NA
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80