



UNITED STATES
NUCLEAR REGULATORY COMMISSION
REGION IV
611 RYAN PLAZA DRIVE, SUITE 1000
ARLINGTON, TEXAS 76012

MSIC

January 17, 1980

In Reply Refer To:

RIV

Docket No. STN 50-482/IE Circular No. 80-01

Kansas Gas & Electric Co.
Attn: Mr. Glenn L. Koester
Vice President-Operations
Post Office Box 208
Wichita, Kansas 67201

Gentlemen:

The enclosed IE Circular No. 80-01 is forwarded to you for information and, if applicable, necessary action in accordance to the attached General Electric Company Service Advice 721-162.2. No written response to this Circular is required. If you have any questions related to the subject, please contact this office.

Sincerely,

Karl V. Seyfrit
Karl V. Seyfrit
Director

Enclosures:

1. IE Circular No. 80-01
2. List of IE Circulars Recently Issued

cc: w/enclosures

Messrs. Nicholas A. Petrick, SNUPPS
D. T. McPhee, Kansas City Power and Light Company
Gerald Charnoff, Shaw, Pittman, Potts & Trowbridge
E. W. Creel, Kansas Gas and Electric Company

1942 311

8002080 110

Q

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON, D.C. 20555

SSINS No.: 6830
Accessions No.:
7912190644

IE Circular No. 80-01
January 17, 1980
Page 1 of 1

SERVICE ADVICE FOR GENERAL ELECTRIC INDUCTION DISC RELAYS

Alabama Power Company reported to the NRC on October 16, 1979 a potential problem with certain General Electric Company induction disc type protective relays. A higher than normal pick-up value was caused by petroleum jelly lubricant which under high temperature conditions can migrate to the backstop. At room temperature the lubricant can become adhesive and cause pickup values to be higher than setpoint values.

General Electric (GE) laboratory confirmed some higher than normal pickup values and recommended that users determine whether relays meeting the following criteria are in use at their facilities:

- (1) Relay type: IAC, IAV, ICR, or IJCV, AND
- (2) The relay date code (which is printed on a 3/4" x 3/8" sticker affixed to the relay cradle) has a number less than 50, followed by any of the following two letter codes:
 - (a) Any first letter followed by H, J, K, L, or M; or
 - (b) The letter combinations AN, BN, CN, DN, EN, DG, EG, FG, GG, HG, JG, KG, LG or MG.

For example, 31GK would be considered, while 50 GK or 23HN would not be considered.

Experience has shown that the cleaning procedure recommended in GE Service Advice 721-162.1 may not in all cases remove all of the petroleum jelly which is lodged in place.

Based on the above, licensees are advised to apply G.E. Service Advice 721-162.2 (Enclosure A) to all relays that fall within the above two criteria.

No written response to this Circular is required. If you desire additional information regarding this matter contact the Director of the appropriate NRC Regional Office.

Attach
Enclos

DUPLICATE DOCUMENT

Entire document previously
entered into system under:

ANO

No. of pages: 4

1942 312
DUPLICATE