

Appendix A

NOTICE OF VIOLATION

Union Electric Company

Docket No. 50-483

Based on the results of the NRC inspection conducted between November 5 and November 30, 1979, it appears that certain of your activities were not conducted in full compliance with NRC requirements as noted below. Each item is an infraction. See the details of this report for a full description of the infractions.

1. 10 CFR 50, Appendix B, Criterion XIII and SNUPPS PSAR, paragraph 17.1. require in part that, "Measures shall be established to control the handling, storage, shipping, cleaning, and preservation of material and equipment in accordance with work and inspection instructions to prevent damage or deterioration."

Contrary to the above, the measures taken have not precluded:

- a. Liquid from wetting the internal surfaces of coolant pump volute number 4 and coolant piping.
 - b. The reactor vessel from becoming uncovered thereby exposing internal surfaces to possible contamination and damage.
2. 10 CFR 50, Appendix B, Criterion XVI and SNUPPS PSAR paragraph 17.1.16 require in part that, "Measures shall be established to assure that conditions adverse to quality, such as failures, malfunctions, deficiencies, deviations, defective material and equipment, and nonconformances are promptly identified and corrected."

Contrary to the above:

- a. Liquid present in the coolant pump volute was not identified as a deficient condition.
- b. Liquid in the coolant system pipe was not promptly reported or removed. The liquid was observed on November 8 and on November 13, 1979.
- c. Debris such as steel washers, wire and wood chips were not identified before concrete placement 2C241W24 was made or when the forms were removed.

1926 261

002076 069