



UNITED STATES  
NUCLEAR REGULATORY COMMISSION  
REGION III  
799 ROOSEVELT ROAD  
GLEN ELLYN, ILLINOIS 60137

TIC

JUL 26 1979

Docket No. 50-483  
Docket No. 50-486

Union Electric Company  
ATTN: Mr. John K. Bryan  
Vice President - Nuclear  
P. O. Box 149  
St. Louis, MO 63166

Gentlemen:

The enclosed IE Bulletin No. 79-17 is forwarded to you for information. No written response is required. However, the potential corrosion behavior of safety related systems as it regards your plant over the long term should be taken into consideration. If you desire additional information concerning this matter, please contact this office.

Sincerely,

*James G. Kepler*  
James G. Kepler  
Director

Enclosure: IE Bulletin  
No. 79-17

cc w/encl:

Mr. W. H. Weber, Manager,  
Nuclear Construction  
Central Files  
Director, NRR/DPM  
Director, NRC/DOR  
PDR  
Local PDR

NSIC  
TIC  
Region I & IV  
Ms. K. Drey  
Hon. C. J. Frass, Chairman  
Missouri Public Service  
Commission

2031 052

7908300429+

UNITED STATES  
NUCLEAR REGULATORY COMMISSION  
OFFICE OF INSPECTION AND ENFORCEMENT  
WASHINGTON, D. C. 20555

July 26, 1979

IE Bulletin No. 79-17

PIPE CRACKS IN STAGNANT BORATED WATER SYSTEMS AT PWR PLANTS

Description of Circumstances:

During the period of November 1974 to February 1977 a number of cracking incidents have been experienced in safety-related stainless steel piping systems and portions of systems which contain oxygenated, stagnant or essentially stagnant borated water. Metallurgical investigations revealed these cracks occurred in the weld heat affected zone of 8-inch to 10-inch type 304 material (schedule 10 and 40), initiating on the piping I.D. surface and propagating in either an intergranular or transgranular mode typical of Stress Corrosion Cracking. Analysis indicated the probable corrodents to be chloride and oxygen contamination in the affected systems. Plants affected up to this time were Arkansas Nuclear Unit 1, R. E. Ginna, H.B. Robinson Unit 2, Crystal River Unit 3, San Onofre Unit 1, and Surry Units 1 and 2. The NRC issued Circular 76-06 (copy attached) in view of the apparent generic nature of the problem.

During the refueling outage of Three Mile Island Unit 1 which began in February of this year, visual inspections disclosed five (5) through-wall cracks at welds in the spent fuel cooling system piping and one (1) at a weld in the decay heat removal system. These cracks were found as a result of local boric acid build-up and later confirmed by liquid penetrant tests. This initial identification of cracking was reported to the NRC in a Licensee Event Report (LER) dated May 16, 1979. A preliminary metallurgical analysis was performed by the licensee on a section of cracked and leaking weld joint from the spent fuel cooling system. The conclusion of this analysis was that cracking was due to Intergranular Stress Corrosion Cracking (IGSCC) originating on the pipe I.D. The cracking was localized to the heat affected zone where the type 304 stainless steel is sensitized (precipitated carbides) during welding. In addition to the main through-wall crack, incipient cracks were observed at several locations in the weld heat affected zone including the weld root fusion area where a miniscule lack of fusion had occurred. The stresses responsible for cracking are believed to be primarily residual welding stresses in as much as the calculated applied stresses were found to be less than code design limits. There is no conclusive evidence at this time to identify those aggressive chemical species which promoted this IGSCC attack. Further analytical efforts in this area and on other system welds are being pursued.

2031 053

DUPLICATE DOCUMENT

Entire document previously  
entered into system under:

AND

No. of pages:

7908020183  
11